

4R44E Remanufactured Valve Body

Part No.

F054

NOTE: Fits '95-later units.

4R55E Remanufactured Valve Body

Part No.

F055

NOTE: Fits '95-'96 units.

5R44E/5R55E Remanufactured Valve Body

Part No.

F056

NOTE: Fits '97-later units with 4.0L.

EPC Adjustment Needed on Ranger Pickup Trucks



If this valve body is to be used in a Ranger pickup or Mazda B-series pickup with 2.3L or 2.5L engine, the 1-2 shift and 3-2 coastdown shift may be too firm.

On these units (Ranger pickup or Mazda B-series pickup with 2.3L or 2.5L engine) **only**, use a T-20 Torx driver to turn the EPC solenoid 1/8th of a turn counterclockwise to clear up firm shifts. If more adjustment is needed, the adjuster can be turned another 1/8th turn.

Do not exceed 1/4th of a turn total!