

Condition: Repeated planetary failure, TCC lining failure.

Correction: Replace cooler lines and/or radiator. Converter failure plugs lines and then overheats planets.

Notes: Flow is less due to 5/16" vs. 3/8" cooler line on 42RE and 47RE units. Good cooler flow circuits have sharp increase/decrease of lockup control. Updated valves allow fluid in park to charge converter.