sonnax®
TIME TESTED • INDUSTRY TRUSTED®

TRANSMISSION PARTS

Instructions

Hyundai-Kia A6GF1, A6LF1/2/3, A6MF1/2

TCC Pressure Control Plunger Valve Kit

Part No.
102741-01K

- Valve
- Sleeve

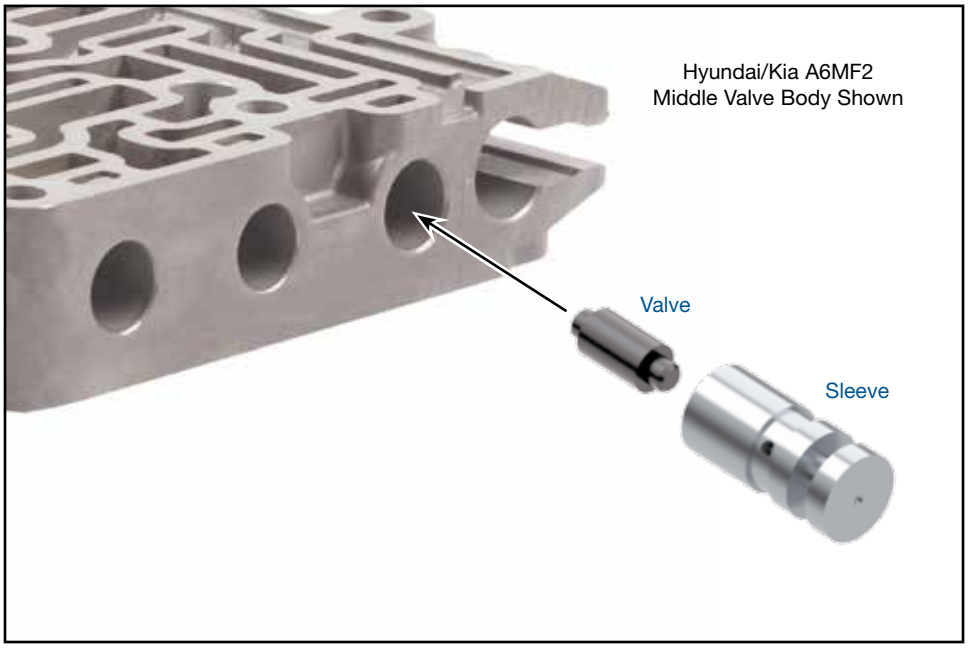

Excessive wear can often be visually identified by shiny patches on inside diameter of sleeve. Wear can also be determined by vacuum testing, done through feed hole in OE sleeve. Using a small tip (available in Sonnax vacuum test stand kit **VACTEST-01K**) attached to the line, apply vacuum to one of the feed holes while covering hole on the opposite side. If sleeve fails to hold at least 18 in-Hg, install this kit.

Vacuum test at OE sleeve feed hole.

1. Disassembly

a. Remove OE retainer and set aside for reuse.

b. Remove and discard OE TCC pressure control sleeve and plunger valve.

2. Installation & Assembly

a. Install Sonnax TCC pressure control plunger valve and sleeve.

b. Reinstall OE retainer.

©2014 Sonnax Industries, Inc.

800-843-2600 • 802-463-9722 • F: 802-463-4059 • www.sonnax.com