


GM 4T65-E

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

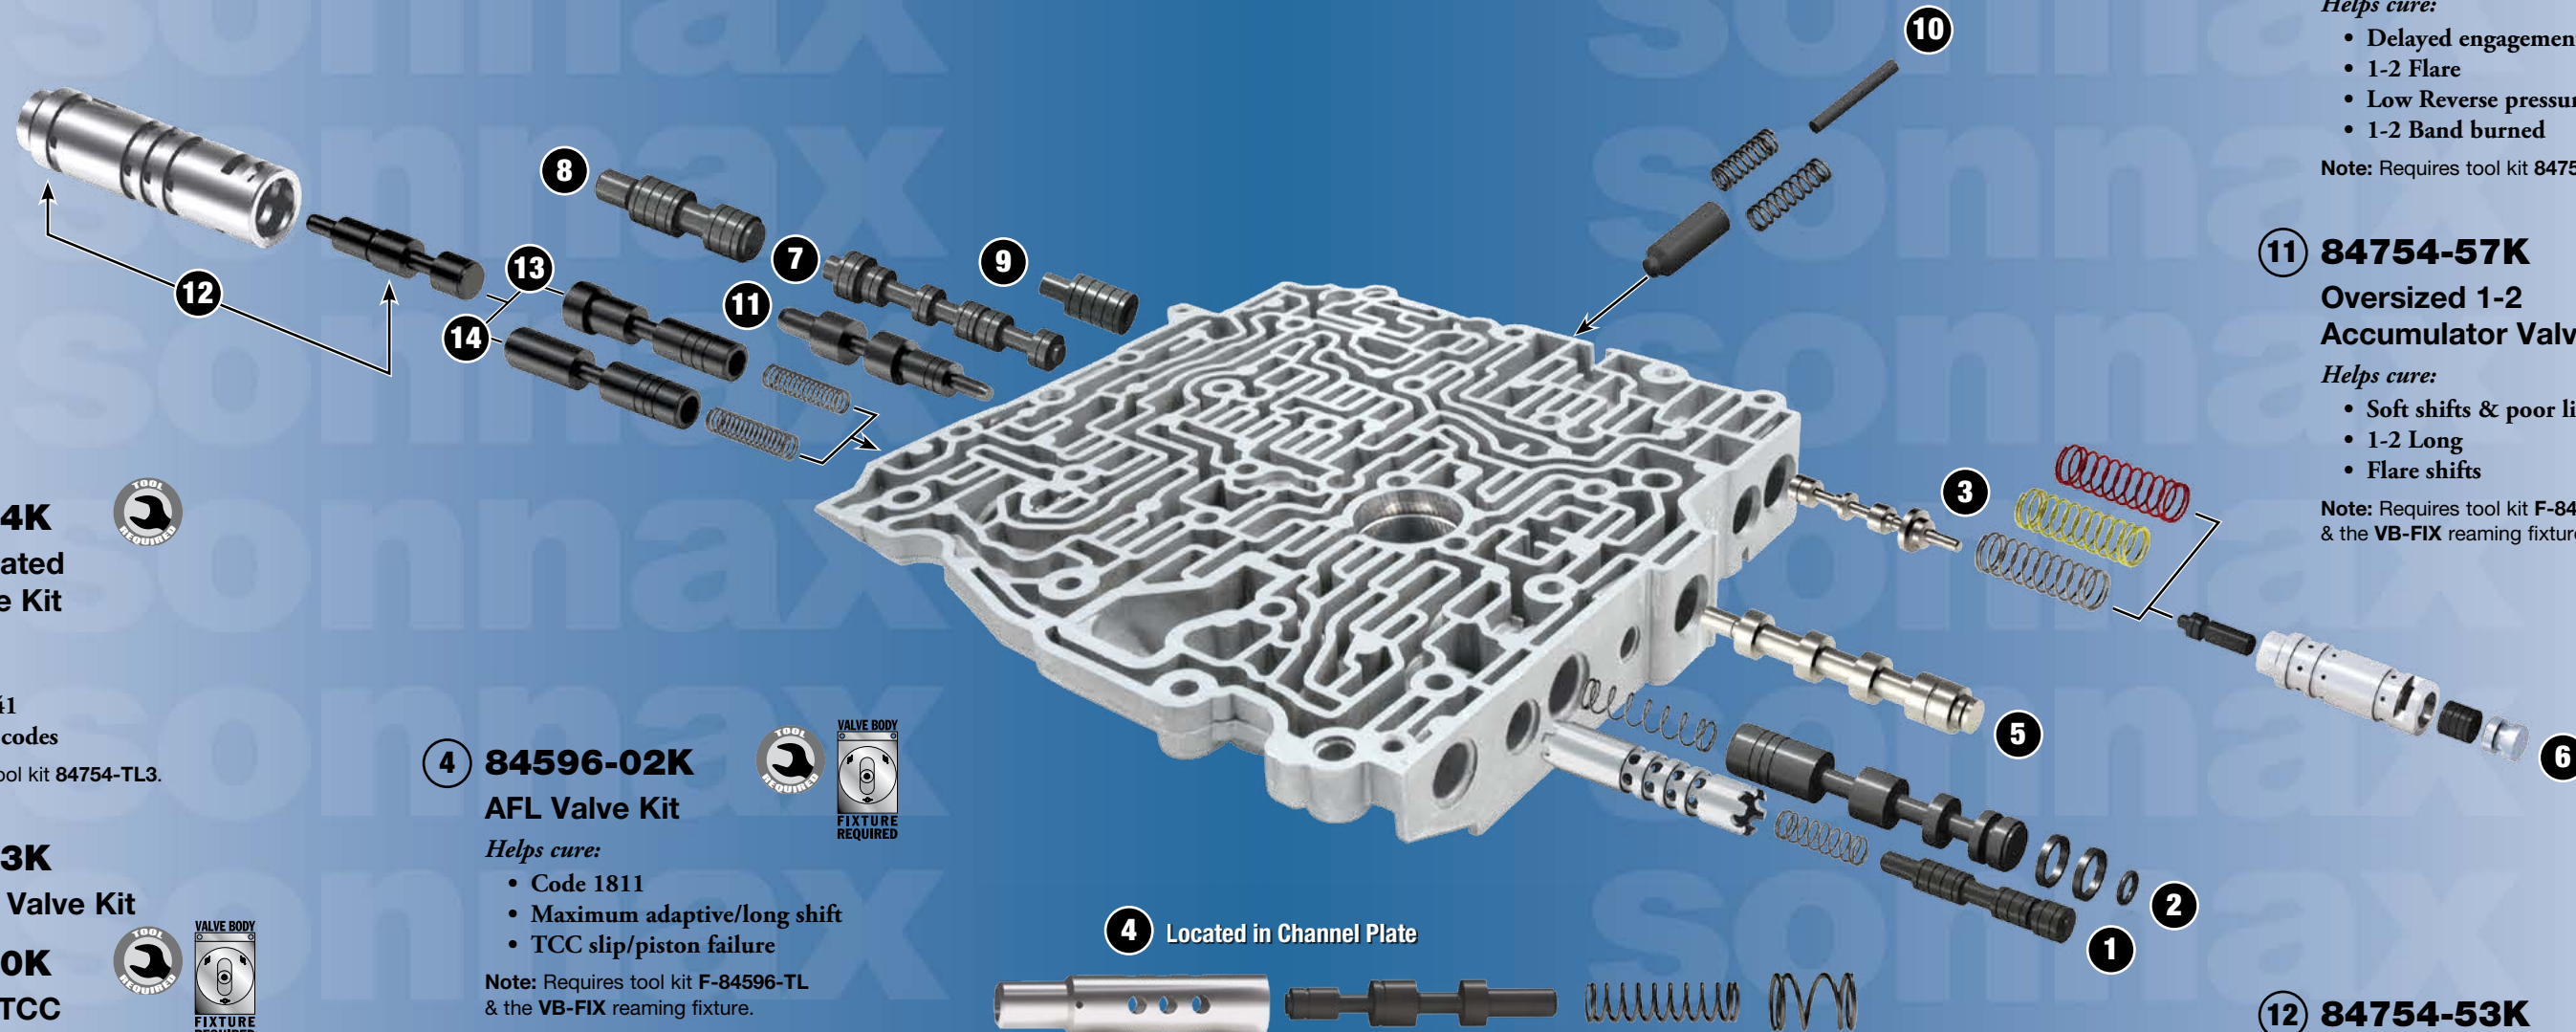

1 84754-34K
TCC Regulated
Apply Valve Kit



Helps cure:

- TCC slip
- Code P0741
- Gear ratio codes

Note: Requires tool kit 84754-TL3.

2 84754-43K
TCC Apply Valve Kit



2 84754-50K
Oversized TCC
Apply Valve Kit

Helps cure:

- Code P0741
- No lockup
- Falling out of lockup hot
- Converter shudder
- High TCC slip RPM

Note: 84754-50K requires tool kit F-84754-TL50 & the VB-FIX reaming fixture.

3 84754-46K
Oversized Pressure
Regulator Valve Kit



Helps cure:

- Erratic line pressure
- Slide & rotor failure
- Lube/Overheated converter issues

Note: Requires tool kit 84754-TL46.

4 84596-02K
AFL Valve Kit



Helps cure:

- Code 1811
- Maximum adaptive/long shift
- TCC slip/piston failure

Note: Requires tool kit F-84596-TL & the VB-FIX reaming fixture.

4 Located in Channel Plate



5 84754-44 '97-Later
Oversized Torque
Signal Valve



Helps cure:

- Code 1811
- Poor/Intermittent line rise
- Slip/Shudder condition
- Code P0741, P0742

Note: Requires tool kit 84754-TL44.

6 84754-30K
Boost Valve Kit

Helps cure:

- Harsh Reverse
- Soft shifts, especially 1-2
- Low line rise in Forward/Reverse

7 84754-36K
2-3 Shift Valve

Does Not Fit Geartronic® or Tapshift® Units

8 84754-37K
3-2 Downshift Valve

Does Not Fit Geartronic® or Tapshift® Units

9 84754-39K
4-3 Downshift Valve

Helps cure:

- Erratic/Temperature-sensitive shifts
- Wrong gear starts

10 84754-40K
Oversized 1-2 & Reverse
Servo Boost Valve Kit



Fits Either of 2 Locations

Helps cure:

- Delayed engagement
- 1-2 Flare
- Low Reverse pressure
- 1-2 Band burned

Note: Requires tool kit 84754-TL2.

11 84754-57K
Oversized 1-2
Accumulator Valve



Helps cure:

- Soft shifts & poor line rise
- 1-2 Long
- Flare shifts

Note: Requires tool kit F-84754-TL57 & the VB-FIX reaming fixture.

12 84754-53K GM Only
2-3 Accumulator Valve Kit

Helps cure:

- 2-3 Shift complaints
- Soft shifts
- Poor line rise

13 84754-55K GM Only



14 84754-58K Volvo Only
Oversized 3-4 Accumulator
Valve Kits

Helps cure:

- 3-4 Concerns
- Soft shifts
- Poor line rise

Note: Requires tool kit F-84754-TL55. & the VB-FIX reaming fixture