
Toyota/Lexus UA80E/F, UB80E/F





			Drop-In	
Symptoms/Benefits	Product Name	Part No.	Details ZIP Zip Valve [™] Parts	Tooling
Pressure Problems				
Inadequate lubrication, Lube failures due to lack of cooler flow, Overheated fluid	Oversized Cooler/Lube Flow Control Valve Kit	1 168740-08K		F-168740-TL8*
Poor shift quality, Pressure loss	O-Ringed End Plug Kit	2 168740-10K	ZIP Includes 1 large and 3 small end plugs	
Burnt clutches, Low line pressure, High line pressure, Burnt transmission components	Oversized Pressure Regulator Valve Kit	3 168740-06K		F-168740-TL6*
Poor shift quality, Burnt clutches, Delayed engagement, TCC apply & release concerns	Solenoid Damper Kit	4 168740-12K	ZIP Fits any of 8 locations	
Lube failures, Overheated fluid, Cooler drain back, Overheated converter, Delayed engagement	TCCRV & TCCV Damper Kit	5 168740-11K	ZìP	
Shift/Engagement Concerns				
Delayed engagement, C1 Clutch burned, Poor shift quality	C1 Apply Boost Valve Kit	6 168740-01K	ZIP	
C4 Clutch burned, Poor shift quality, 4th & 6th Gear shift concerns	C4 Apply Boost Valve Kit	7 168740-02K	ZIP	
Slips in Forward & Reverse, Delayed engagement, Poor shift quality, Harsh engagement	Forward/Reverse Accumulator Piston Kit	8 168740-05K	ZIP Fits either of 2 locations	

* VB-FIX Required

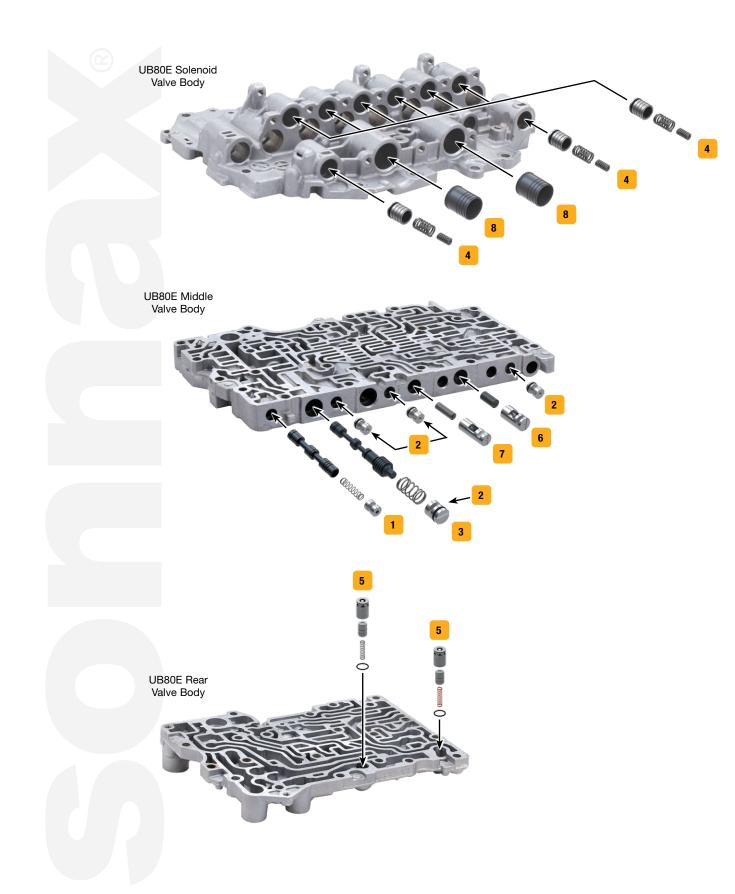

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.