


GM 6T30/40/45/50 (Gen. 1)

sonnax®

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

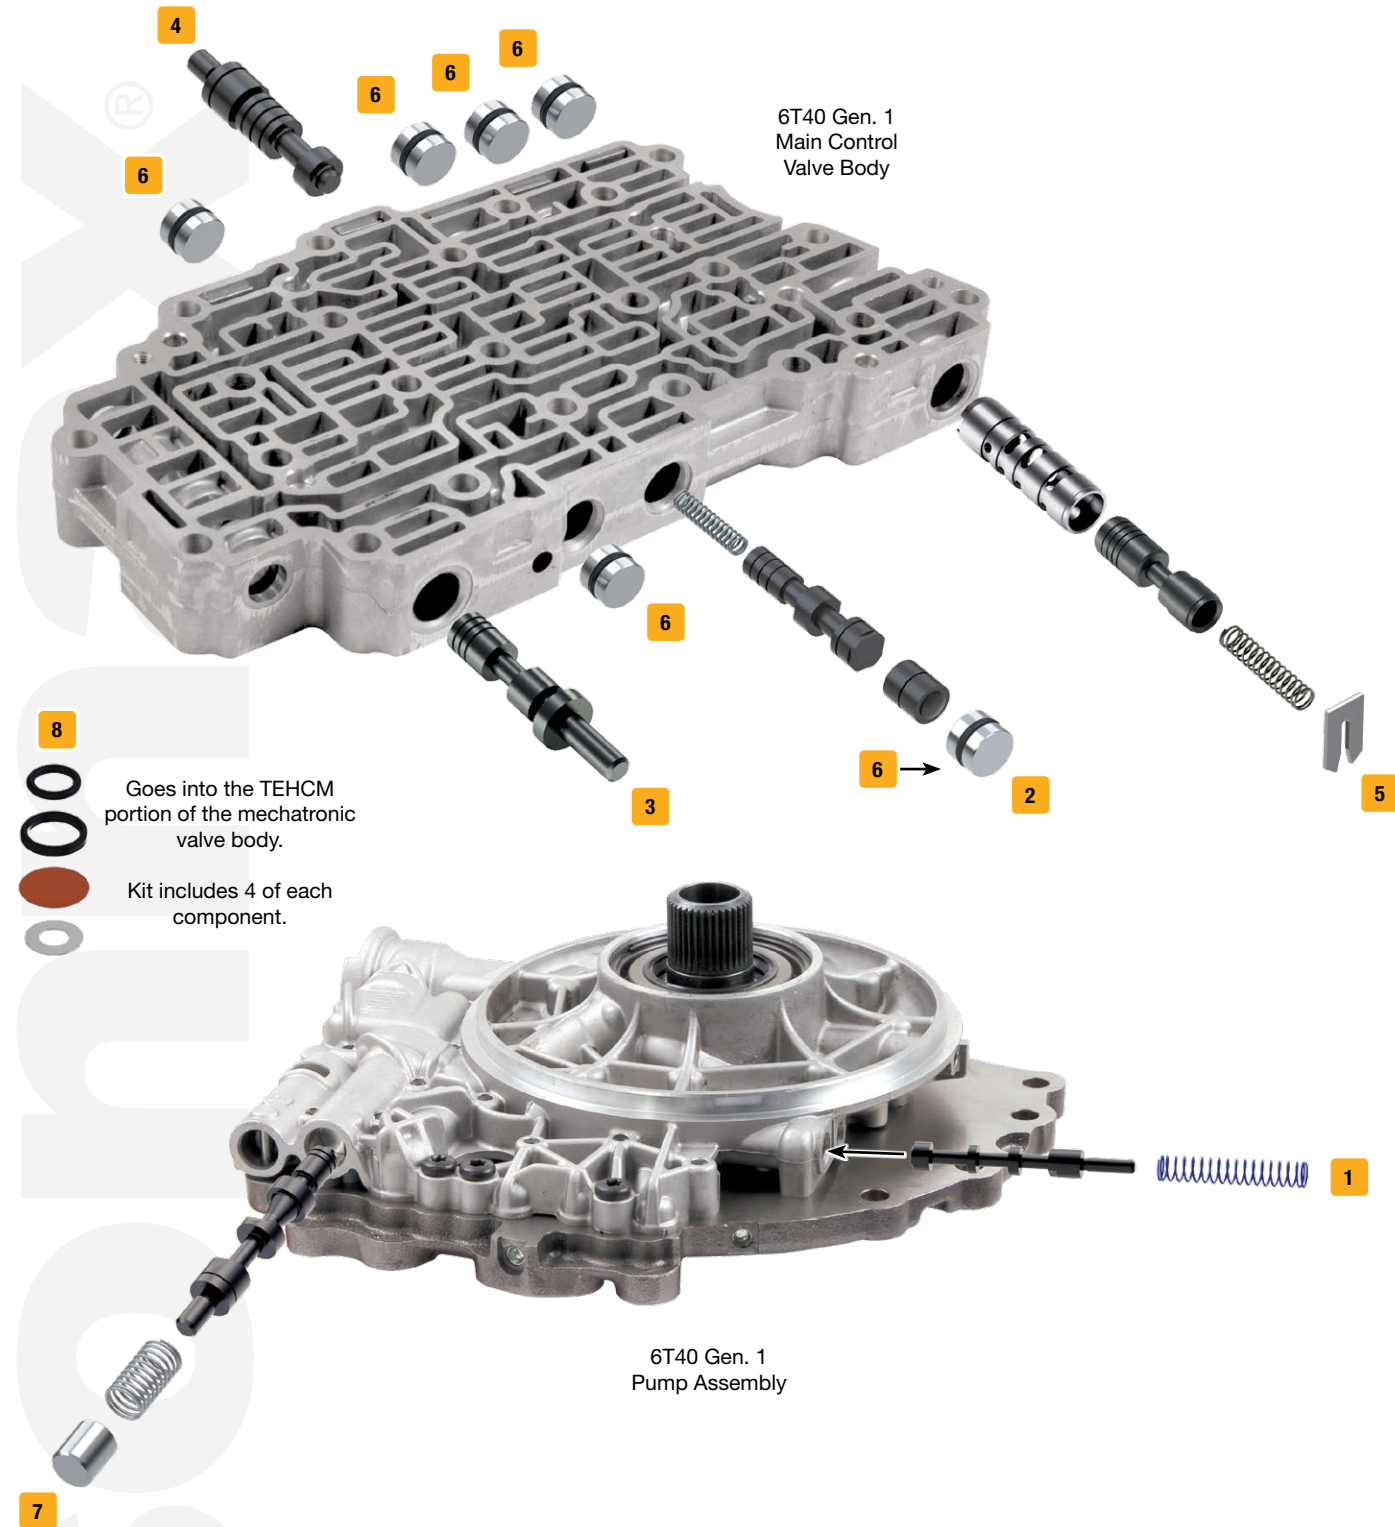

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	6T40-ZIP	Fits Gen. 1 6T40, 6T45, 6T50 units only	
TCC/Lockup Symptoms				
Excess TCC slip, Low cooler flow, Overheating, Low converter & lube flow, TCC codes	Oversized TCC Control Valve Kit	1 144510-05K		F-144510-TL5C*
Code P0741, Code 742, No lockup, TCC slip, Loss of fuel economy, Low TCC apply pressure	Oversized TCC Regulator Valve Kit	2 144740-16K		F-144740-TL16*
Shift/Engagement Concerns				
No 4th, No 5th, No 6th, Low clutch oil pressure, Harsh shifts, Flare shifts	Oversized Actuator Feed Limit Valve	3 144740-01		144740-TL
Delayed engagement, 1-2-3-4 Clutch burned, Slip codes, Shift quality is not load sensitive	Oversized Clutch Boost Valve	4 144740-22		F-144740-TL22*
Harsh shifts, Downshift clunk, 3-4 Bump, Bump shifts, Flare shifts, Bind-up, Burnt clutches	Compensator Feed Regulator Valve Kit	5 104740-09K		
Pressure loss, Burnt clutches, Shift concerns, TCC apply concerns	O-Ringed End Plug Kit	6 144740-02K	Includes 6 end plugs	
Erratic line pressure, Burnt clutches, Poor shift quality, Low converter & lube flow	Oversized Pressure Regulator Valve Kit	7 144510-01K		F-144510-TLC*
Pressure switch codes, Pressure control out-of-range codes, Failsafe mode, Harsh shifts	Pressure Switch Rebuild Kit	8 144510-09K	Repairs 4 switches	

* VB-FIX Required



See kit components at www.sonnax.com.