


# Mitsubishi F4A, F5A

These parts fit '96-later Mitsubishi F4A41/42/51, F5A51 as well as Hyundai/Kia A5HF1 and A5GF1. Several parts also fit R4/V4A51, R5/V5A51. Verify applications at [www.sonnax.com](http://www.sonnax.com).



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

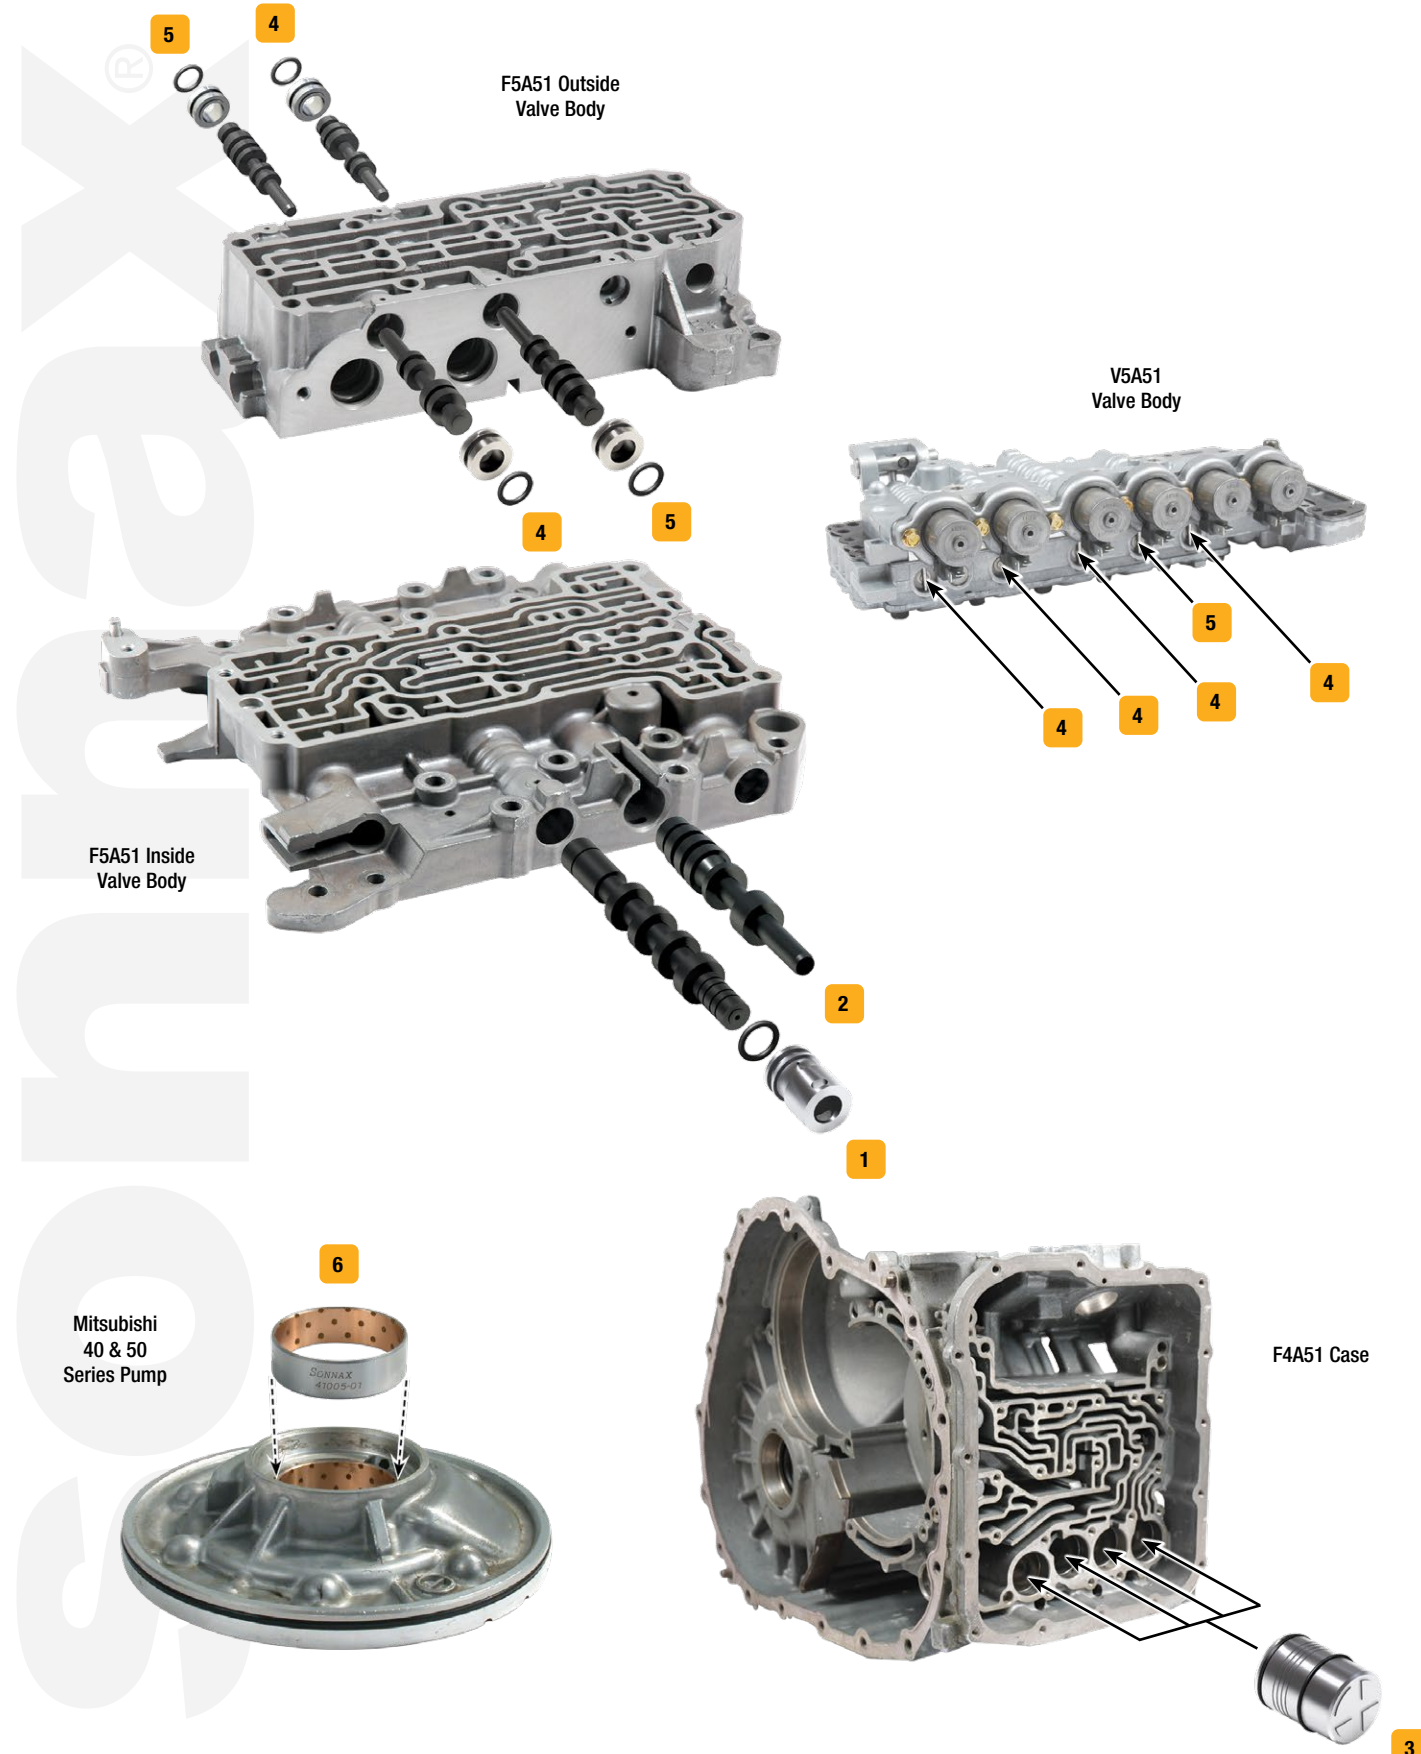

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
<b>TCC/Lockup Symptoms</b>				
Excess TCC slip, TCC apply & release concerns, TCC cycling, High TCC release pressure	TCC Control Valve Kit	1 41954-03K	ZIP Replaces OE valves with .405", .531" & .344" spool dia.	
<b>Pressure Problems</b>				
Flare shifts, Soft shifts, Harsh shifts, Low line pressure, High line pressure	Oversized Pressure Regulator Valve	2 41954-01K	FWD only, replaces OE valves with .540", .616" & .645" spool dia.	F-41954-TL*‡
<b>Shift/Engagement Concerns</b>				
Worn accumulator bores, Soft shifts, Harsh shifts, Delayed engagement, Shudder on engagement	Accumulator Piston Kit	3 41954-02K	Fits any of 4 locations, dual-seal design	
Burnt clutches, Flare shifts, Shuttle shifts, Cycling RPM during shift, Delayed engagement	Pressure Control Valve Kit	4 41954-06K	ZIP No orifice, replaces OE valves with .382", .472" & .354" spool dia., fits either of 2 locations	
	Pressure Control Valve Kit	5 41954-07K	ZIP With orifice, replaces OE valves with .382", .472" & .354" spool dia., fits either of 2 locations	
<b>Component Damage/Failure</b>				
Bushing wear, Bushing failure	Pump Bushing	6 41005-01	Mitsubishi 40 & 50 series only, precision	41005-TL‡

\* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.