


# ZF6HP19/26/32 (Gen. 1) with 053 Separator Plate



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

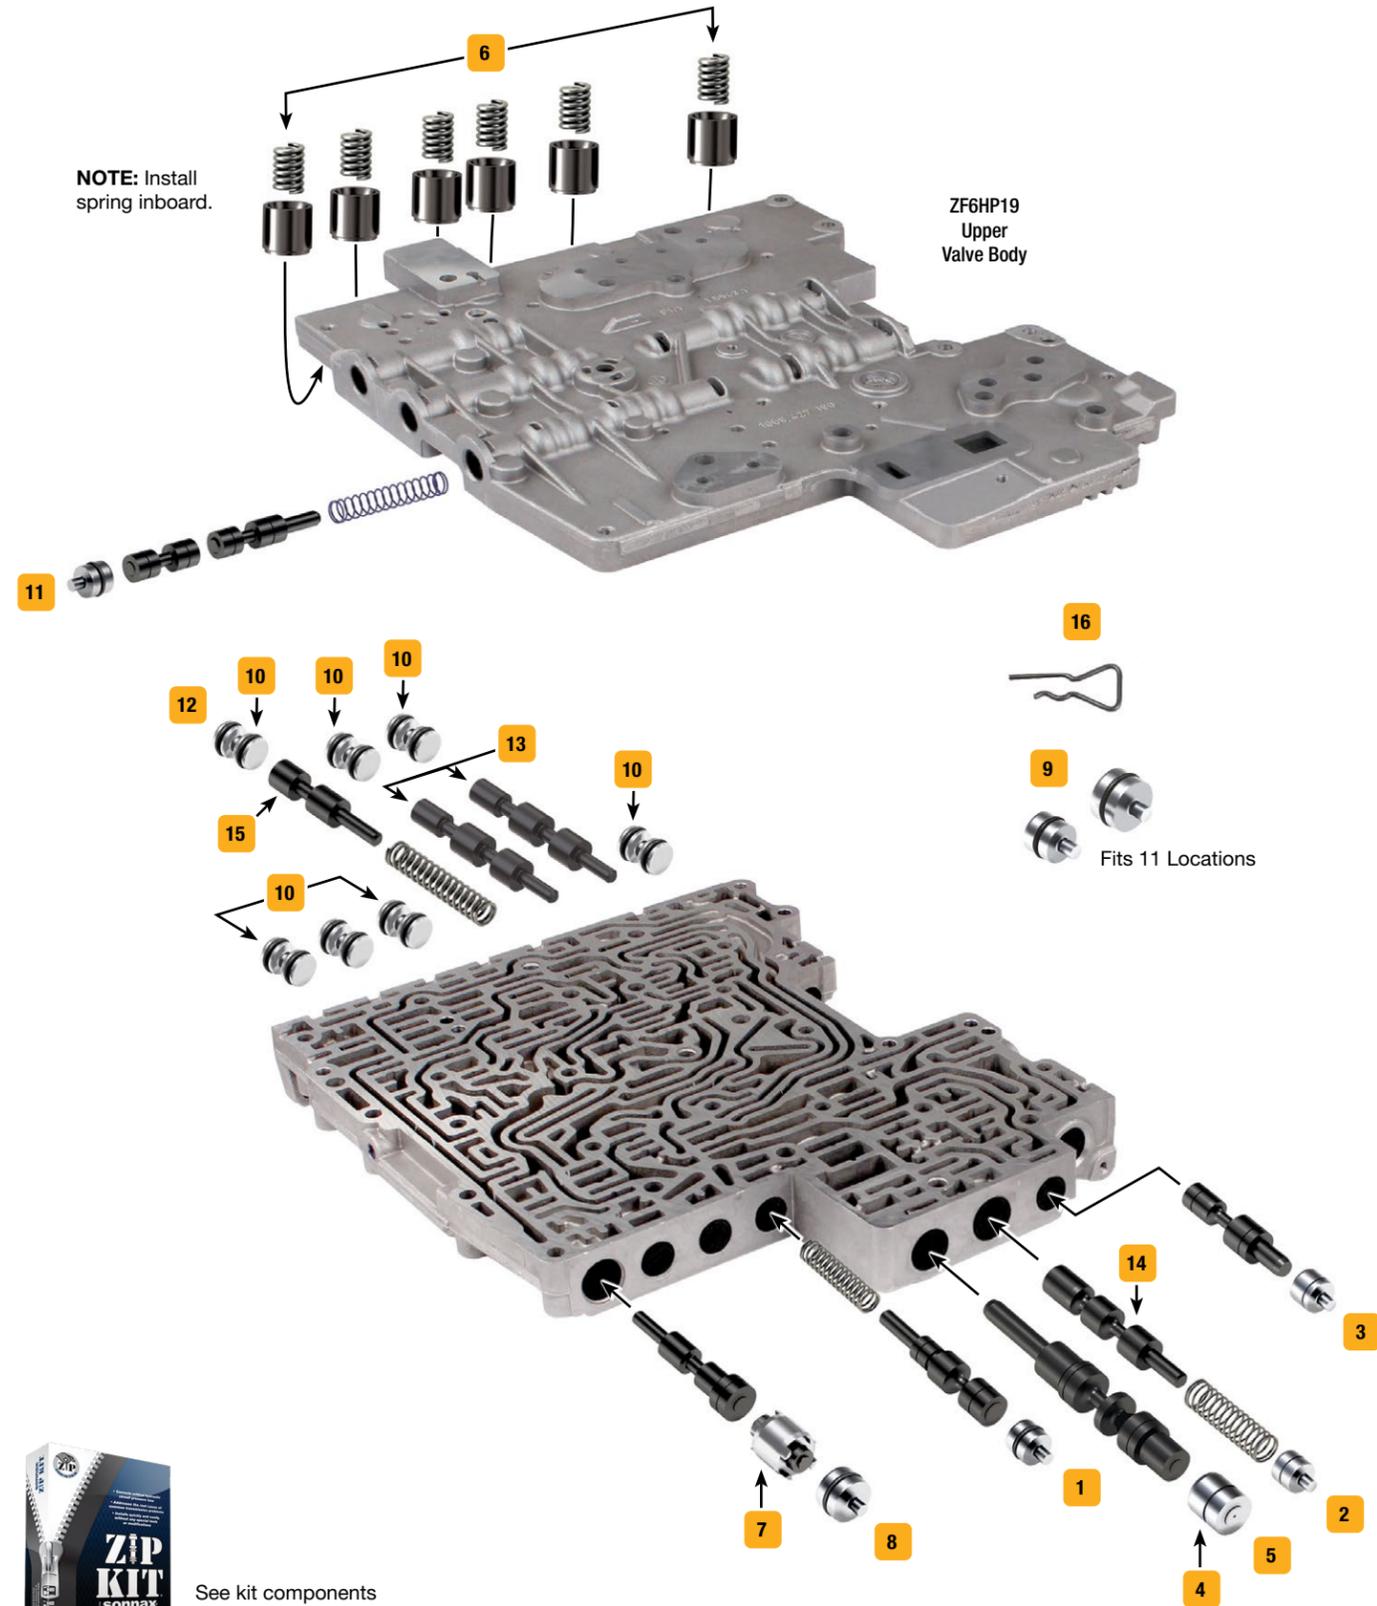

See kit components at [www.sonnax.com](http://www.sonnax.com).



Symptoms/Benefits	Product Name	Part No.	Details	Tooling
<b>Multiple Symptoms</b>				
The first step in correcting common shift problems	Zip Kit®	ZF6-053-ZIP	ZIP	
<b>TCC/Lockup Symptoms</b>				
TCC codes, Excess TCC slip, Cycling RPM, Low TCC release pressure, Flare shifts, Harsh shifts	Oversized Bypass Clutch Control Valve Kit	1 95740-13K		F-95740-TL13*
Excess TCC slip RPM & related codes, Harsh TCC apply & release, Low TCC release pressure	Oversized Converter Release Regulator Valve Kit	2 95740-05K		F-95740-TL5*
Planetary failure, Bushing failure, Lube failures, Overheating, Low converter pressure	Oversized Lubrication Control Valve Kit	3 95740-11K		F-95740-TL11*
<b>Pressure Problems</b>				
Broken parts due to excessive line pressure, Erratic line pressure, High line pressure	Pressure Regulator Sleeve	4 95740-79	ZIP Replaces OE sleeve with .657" outer dia. & .725" length	
Broken parts due to excessive line pressure, Erratic line pressure, Harsh shifts, TCC slip	Oversized Pressure Regulator Valve Kit	5 95740-78K	Replaces OE sleeve with .657" outer dia. & .725" length	F-95740-TL78*
<b>Shift/Engagement Concerns</b>				
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	6 95740-15K	ZIP Includes 7 pistons & springs	
5-4 Flare, 5-4 Neutral, No 4-5, VFS 1/A solenoid control code, Delayed Forward, Harsh Forward	Clutch A Control Boost Valve Kit	7 95740-21K	ZIP	
Downshift bind-ups, Flare shifts, Excess clutch overlap & clutch distress	Oversized Clutch A Control Valve Kit	8 95740-09K		F-95740-TL8*
Inconsistent shift quality	O-Ringed End Plug Kit	9 95740-81K	ZIP Includes 1 large & 10 small end plugs	
	O-Ringed Internal End Plug Kit	10 95740-30K	ZIP Includes 7 end plugs	
Shift concerns, "A" Clutch burned, B Clutch burned, E Clutch burned	Oversized Position Valve Kit	11 95740-75K	E-shift only	F-95740-TL75*
Flare shifts, Neutral shifts, Harsh upshifts, Harsh downshifts, Gear ratio codes, TCC slip	Oversized Solenoid Pressure Regulator Valve Kit	12 95740-17K		F-95740-TL17*
<b>Component Damage/Failure</b>				
Lost or damaged component	Drive Enable/Solenoid Multiplex Valve	13 95740-04A	ZIP Fits either of 2 locations	
	Converter Release Regulator Valve	14 95740-05A	ZIP	
	Solenoid Pressure Regulator Valve	15 95740-17A	ZIP	
	"Y" Shaped Valve Retainer	16 95740-04K	10/Bag	
<b>Tools</b>				
	Solenoid Test Manifold Kit	95430-VTK		VACTEST-01K

\* VB-FIX Required