


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

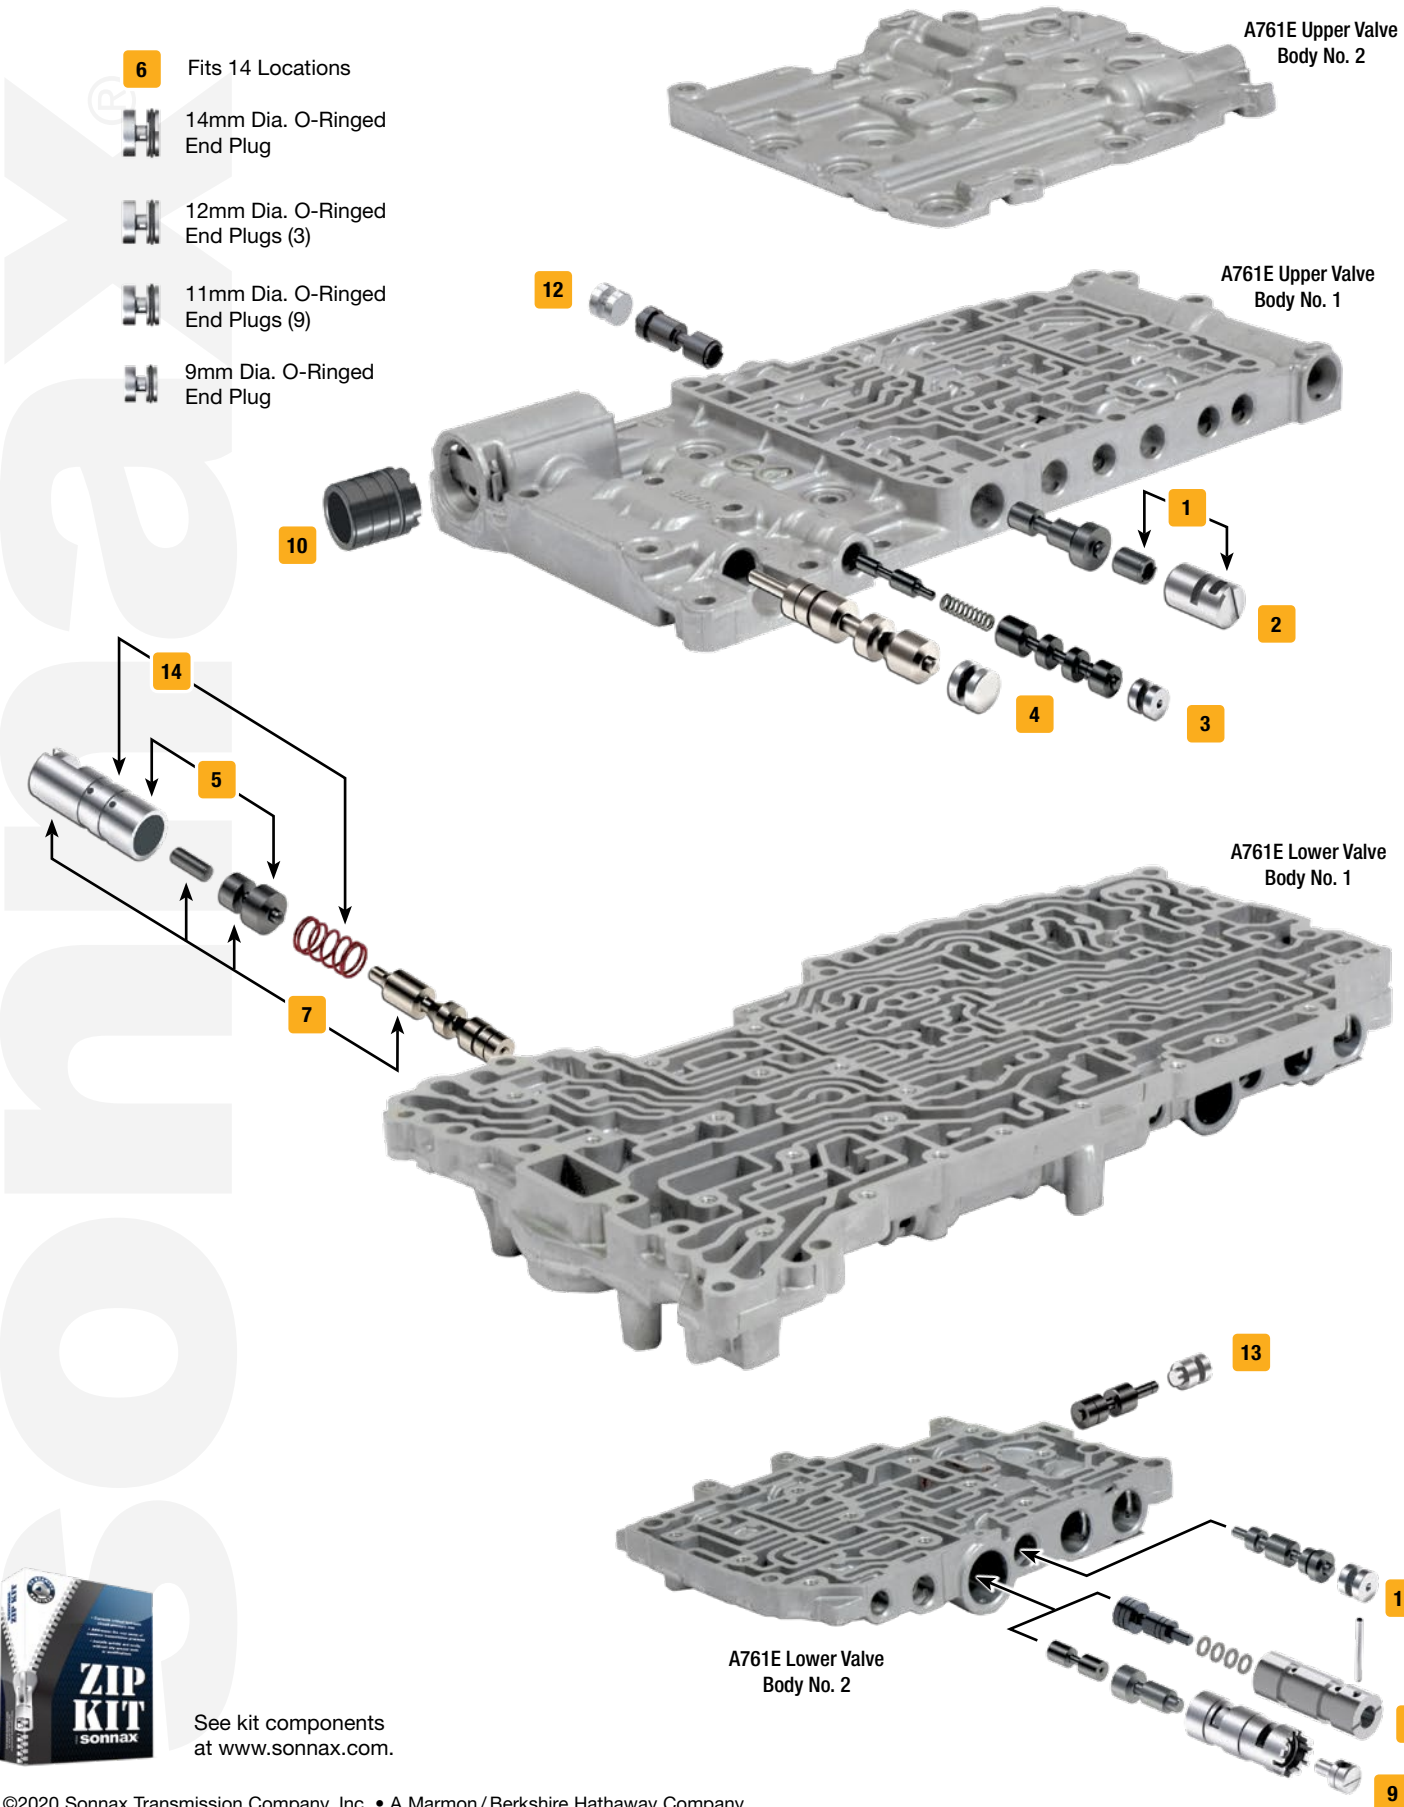

See kit components at www.sonnax.com.

| Symptoms/Part Type | Product Name | Part No. | Details | Tooling |
|---|---|-----------------|-------------------------|----------------|
| Multiple Symptoms | | | | |
| The first step in correcting common shift problems | Zip Kit® | A750E-A761E-ZIP | | |
| TCC/Lockup Symptoms | | | | |
| Harsh downshifts, TCC apply & release concerns, TCC codes, Cycling TCC RPM, Overheated fluid | Lockup Control Plunger Valve Kit | 1 147741-37K | A761E, A960E/F only | |
| | Lockup Control Plunger Valve Kit | 1 157740-37K | A760E/F/H, AB60E/F Only | |
| TCC apply & release concerns, Harsh downshifts, RPM fluctuation, TCC codes | Oversized Lockup Control Valve Kit | 2 147741-16K | A761E, A960E/F only | F-147741-TL16* |
| | Oversized Lockup Control Valve Kit | 2 157740-16K | A760E/F/H, AB60E/F only | F-157740-TL16* |
| TCC apply & release concerns, TCC apply codes, Burnt converter, Shudder, Overheating | Oversized Lockup Relay Valve Kit | 3 147741-07K | | F-147741-TL7* |
| Harsh lockup, TCC apply & release concerns, Burnt converter, Lube failures | Oversized Secondary Pressure Regulator Valve Kit | 4 147741-10K | | F-147741-TL4* |
| Pressure Problems | | | | |
| Clutch failure, Soft shifts, Harsh shifts, High line pressure in Reverse, High line pressure | Boost Valve Kit | 5 147741-01K | | |
| Various concerns depending on location of leaking end plug, Pressure loss | O-Ringed End Plug Kit | 6 147741-30K | Includes 14 end plugs | |
| Clutch failure, Soft shifts, Harsh shifts, Low line pressure, High line pressure, Overheating | Oversized Main Pressure Regulator & Boost Valve Kit | 7 147741-04K | | F-147741-TL4* |
| Shift/Engagement Concerns | | | | |
| Harsh shifts, Shift codes, Shift concerns | Accumulator Control Plunger Valve Kit | 8 147741-43K | | |
| | Oversized Accumulator Control Valve Kit | 9 147741-24K | | 147741-TL24 |
| Delayed engagement, Flare shifts, Forward slip, Burnt clutches | Accumulator Piston Kit | 10 57917E-19K | | |
| Burnt clutches, Harsh shifts, Flare shifts, Shift concerns | Oversized Brake Control Valve Kit | 11 147741-28K | | F-147741-TL28* |
| Harsh upshifts, Harsh downshifts, Gear ratio codes, Flare shifts, Solenoid performance codes | Oversized Clutch Control Valve Kit | 12 147741-14K | | F-147741-TL14* |
| Solenoid performance codes, Bang shifts, TCC cycling, Shift concerns, Bind-up, TCC slip | Oversized Solenoid Modulator Valve Kit | 13 147741-05K | | F-147741-TL5* |
| High Performance/Heavy Duty Upgrades | | | | |
| Classic, large-ratio boost valve for crisp, clean shifts without harshness | Line Pressure Booster Kit | 14 A750-LB1 | | |

* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.