








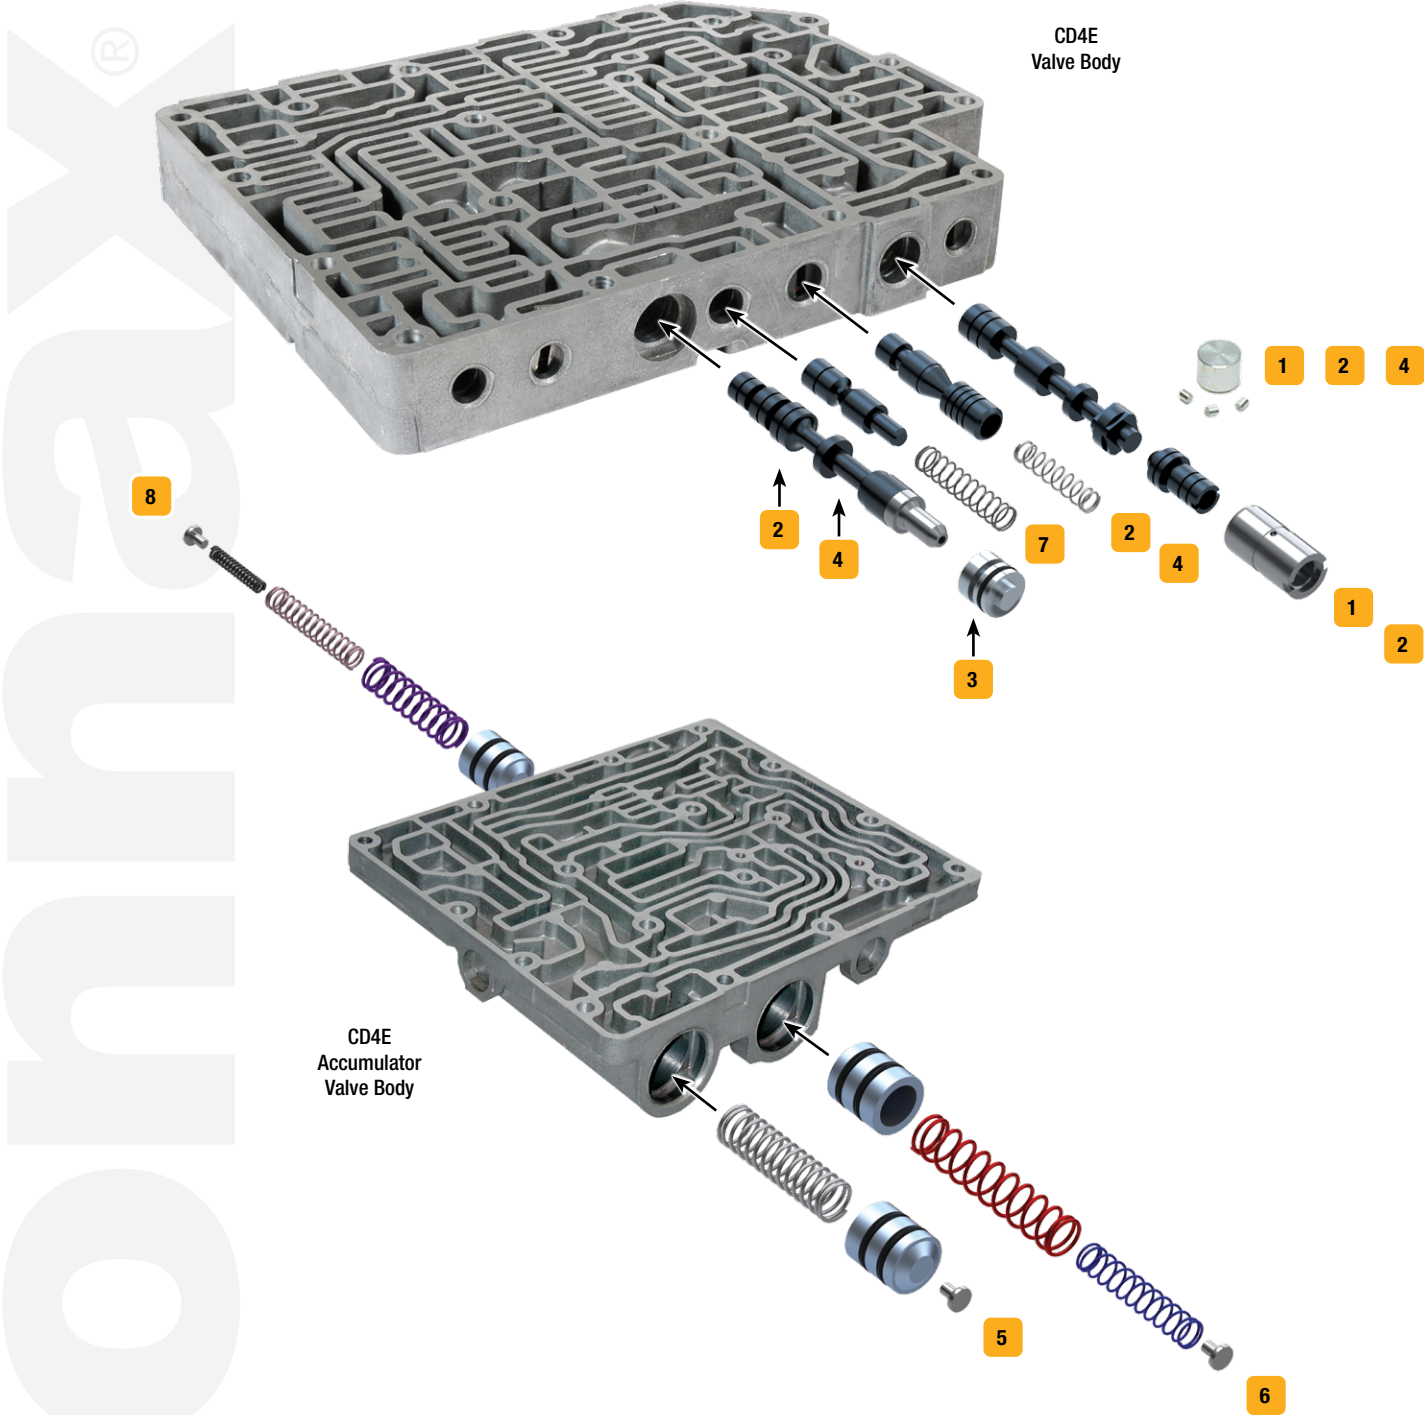


Ford CD4E

These parts also fit Mazda LA4A-EL.



Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.



Symptoms/Part Type	Product Name	Part No.	Details	 Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms					
Code 628, 1744, 1740, Reduced converter clutch life, Planetary failure, Bushing failure	Oversized Bypass Clutch Control Valve Kit	 73840-BK			73840-BTL
Code 28, 1744, 1740, High line pressure, Cracked drum, Planetary failure, Bushing failure	Master Kit	 73840-MK	Includes 73840-RK & 73840-BK		73840-BTL, F-73840-TL*
Pressure Problems					
Line pressure instability, Burnt clutches & bands, Low EPC pressure, Low line pressure	O-Ringed End Plug Kit	 73840-06	ZIP Fits pressure regulator valve bore, includes 1 end plug		
Code 28, 1744, 1740, High line pressure, Cracked drum, Planetary failure, Bushing failure	Oversized Pressure Regulator & Converter Regulator Valve Kit	 73840-RK			F-73840-TL*
Shift/Engagement Concerns					
1-2 Bump, 3-4 Bump, Soft shifts, Harsh shifts	2-4 Accumulator Piston Kit	 73840-24	ZIP		
Soft Forward, Harsh Forward, Delayed Forward	Forward Accumulator Piston Kit	 73840-FWD	ZIP		
1-2 Long, 1-2 Harsh, Erratic shifts, Low line rise, High line pressure	Oversized Line Modulator Valve Kit	 73840-27K			F-73840-TL27*
Soft Reverse, Harsh Reverse, Delayed Reverse	Low/Reverse Accumulator Piston Kit	 73840-LR	ZIP		

* VB-FIX Required