


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

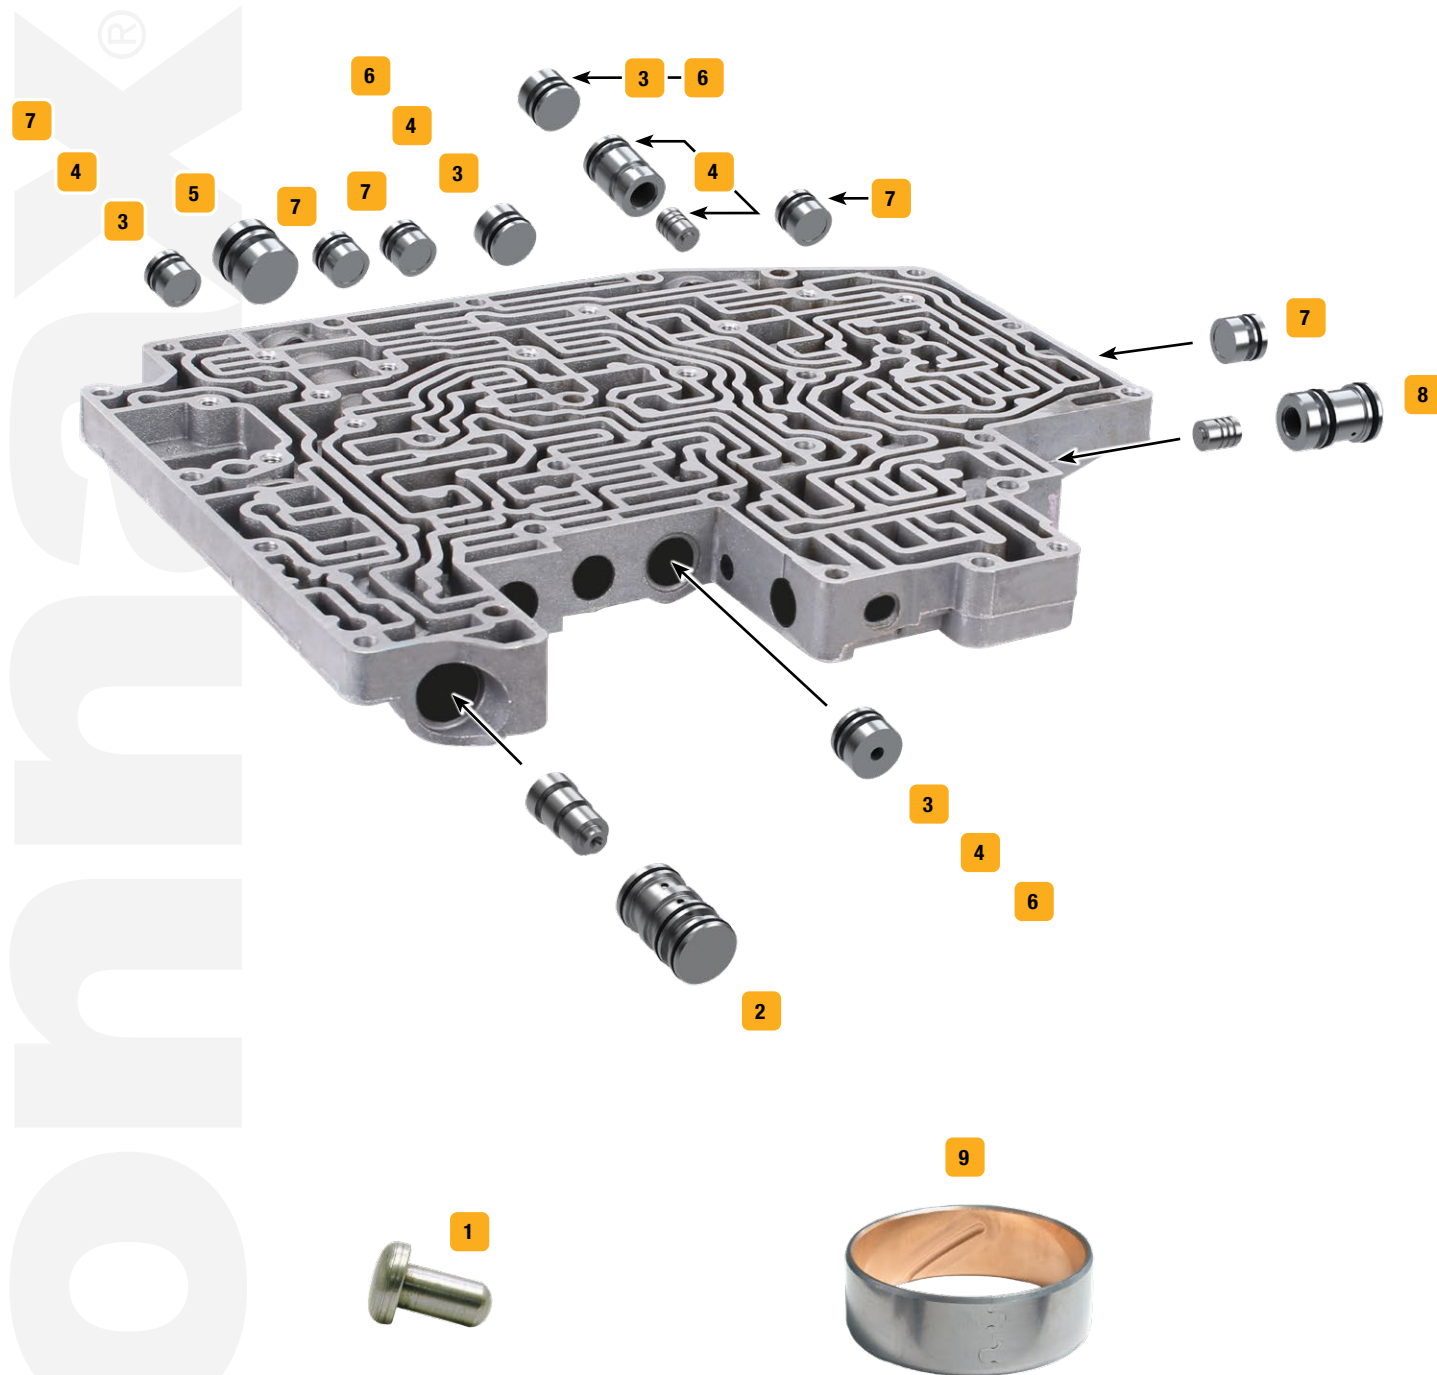

| Symptoms/Part Type | Product Name | Part No. | Details | ZIP Drop-In Zip Valve™ Parts | Tooling |
|--|-------------------------------|-------------|---|------------------------------|---------|
| Pressure Problems | | | | | |
| Pressure loss, Converter drain back | Relief Valve | 1 10000-01K | Low radius, 10/bag | | |
| Shift/Engagement Concerns | | | | | |
| Soft slide shifts, Delayed Reverse, Low line rise, Direct clutch failure | Boost Valve Kit | 2 76990K | ZIP O-Ring style, OE ratio | | |
| | Boost Valve Kit | 2 76990-03K | ZIP Factory style, OE ratio | | |
| | Boost Valve Kit | 2 76990-04K | ZIP Factory style, large ratio | | |
| Erratic shift timing, Oil leaks | Governor Circuit End Plug Kit | 3 76999-04K | ZIP Mid '83-earlier, includes 3 medium & 1 small end plugs | | |
| | Governor Circuit End Plug Kit | 4 76999-05K | ZIP Mid '83-later, includes 2 medium & 1 small end plugs, a 3-4 shift sleeve & valve assembly | | |
| | O-Ringed End Plug Kit | 5 76999-LRG | ZIP Large, includes 3 end plugs | | |
| | O-Ringed End Plug Kit | 6 76999-MED | ZIP Medium, includes 3 end plugs | | |
| | O-Ringed End Plug Kit | 7 76999-SML | ZIP Small, includes 3 end plugs | | |
| Uncontrollable shift timing, Low line rise, Overheated clutch, Overheated band | Throttle Valve Plug Kit | 8 76989K | ZIP O-Ring style | | |
| | Throttle Valve Plug Kit | 8 76989-03K | ZIP Factory style | | |
| Component Damage/Failure | | | | | |
| Leaking front seal, Pump noise, Excess converter hub-to-bushing clearance, Low pump volume | Pump Bushing | 9 36002-01 | Finish-in-place | | |