


# 4R70W ('95-HIGH MILEAGE)

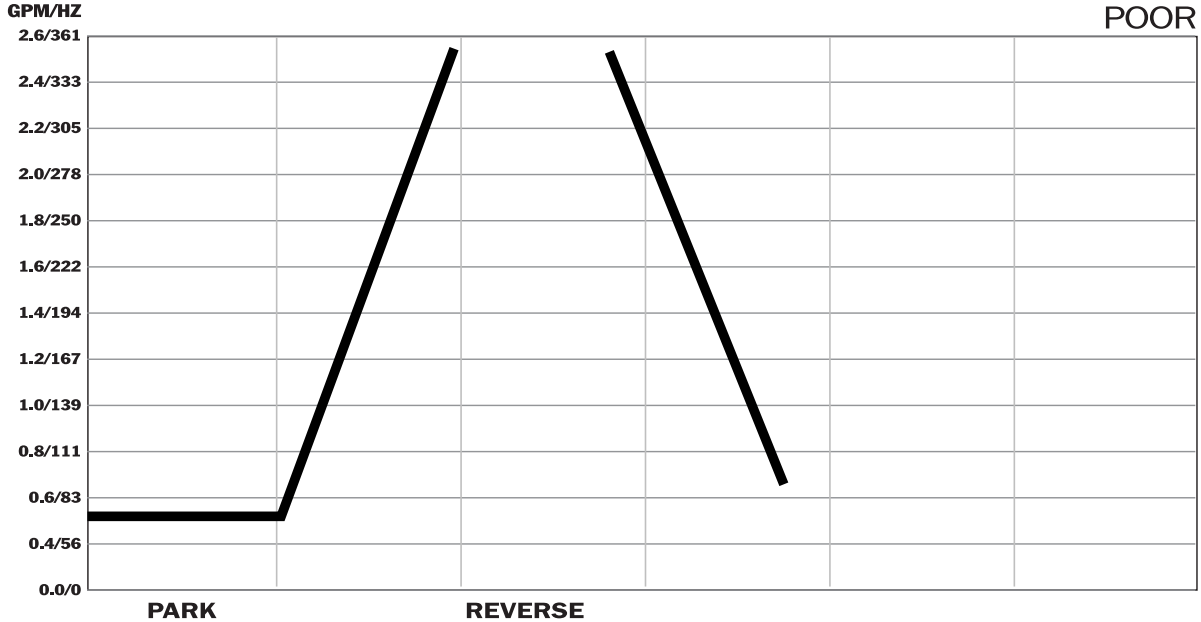

**Condition:** Aerated fluid (pump grabbing air), poor suction porting, gaskets, etc.

**Correction:** New pump, Sonnax Bypass Clutch Control Sleeve & Plunger Valve **76948-04K**, pressure regulator valve and converter regulator valve.

*Notes: Initial start, then reverse engagement. Can occur at end of 1-2 shift.*