
## 4R100 ('99 & up)

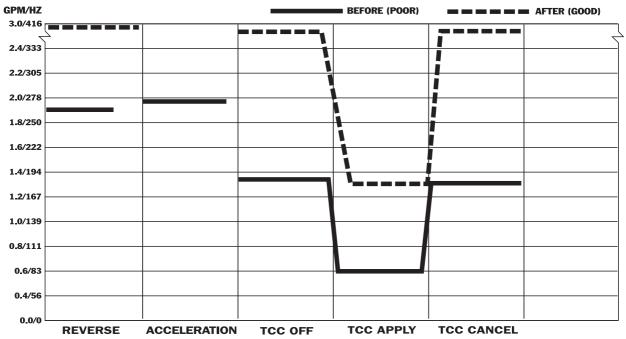

**Condition:** Repeated overdrive failure, overheat.

**Correction:** Replace cooler, bypassing OEM completely, cooler above, Tru-Cool LPD 4590.

Notes: Low flow even after extensive hot flush. OE external cooler may also have restrictions.

## sonnax