

GM

6T40 (Gen. 1), 6T45 (Gen. 1), 6T50 (Gen. 1)

sonnax®

TIME TESTED • INDUSTRY TRUSTED®


1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



Zip Kit®
6T40-ZIP

This Sonnax kit is also available,
see www.sonnax.com for details.

1 144740-16K Oversized TCC Regulator Valve Kit

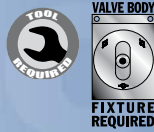


Helps cure:

- Harsh/No TCC Apply
- Codes 741, 742

Note: Requires tool kit F-144740-TL16
& the VB-FIX reaming fixture.

2 144510-05K Oversized TCC Control Valve Kit

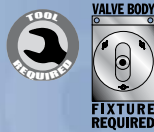


Helps cure:

- TCC apply/release complaints
- Low cooler flow

Note: Requires tool kit F-144510-TL5C
& the VB-FIX reaming fixture.

3 144510-01K Oversized Pressure Regulator Valve Kit

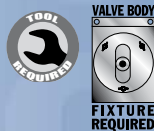


Helps cure:

- Harsh/Soft shifts
- Burnt clutches
- TCC apply & release concerns

Note: Requires tool kit F-144510-TLC
& the VB-FIX reaming fixture.


4 144740-22 Oversized Clutch Boost Valve

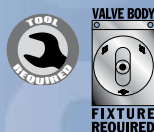

Helps cure:

- 1-2-3-4 Clutch burned
- Delayed engagement

Note: Requires tool kit F-144740-TL22
& the VB-FIX reaming fixture.

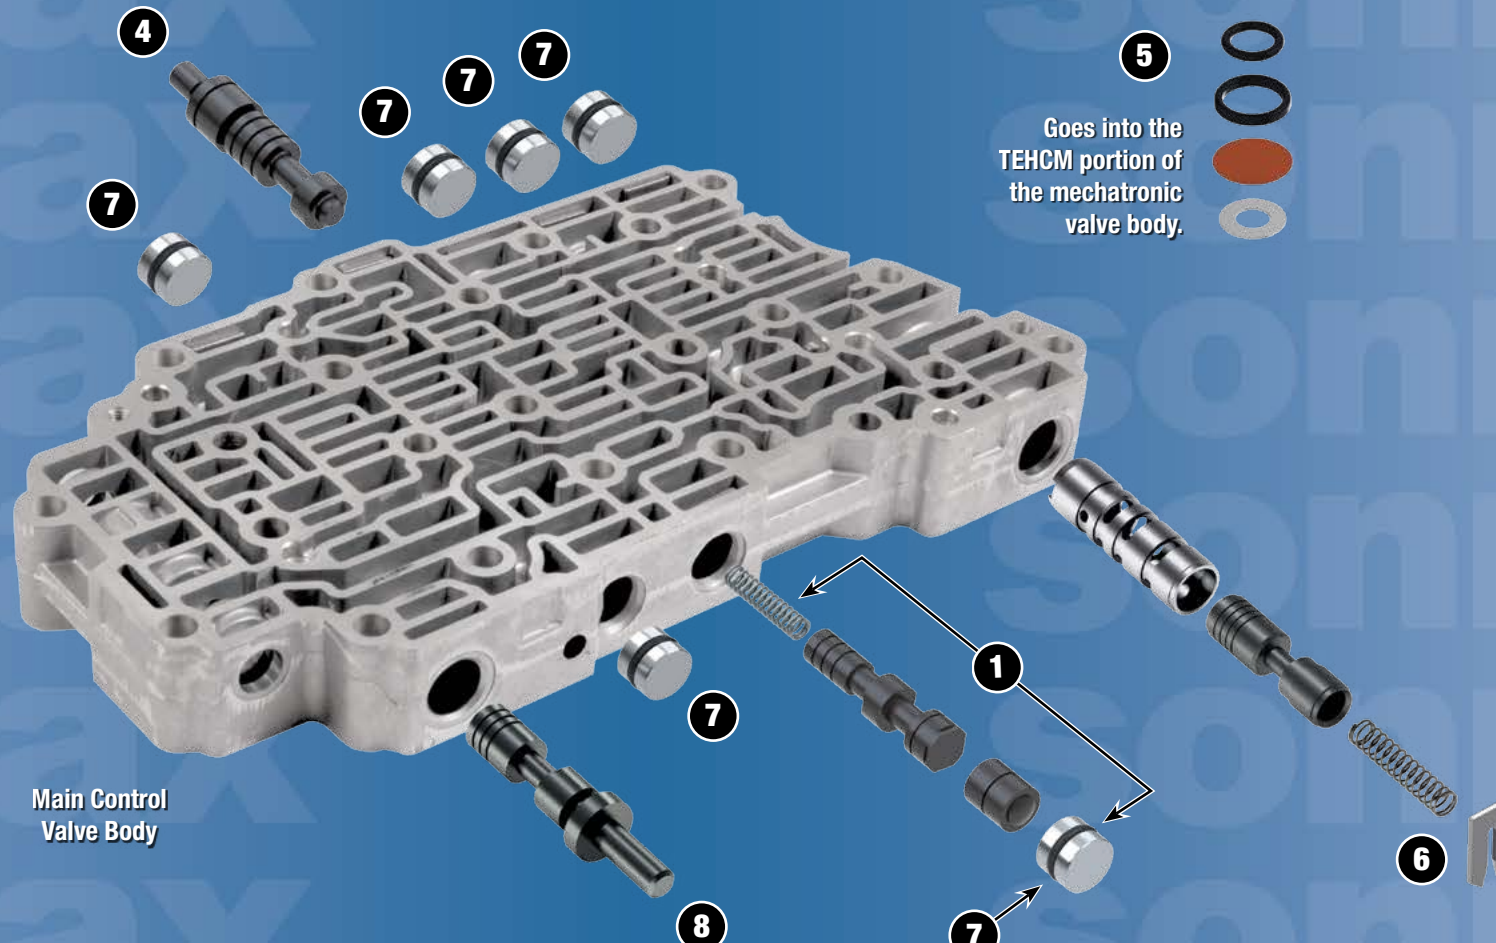

5 144510-09K Pressure Switch Rebuild Kit

Fits 4 locations

Helps cure:

- Codes 0752, 0872, 0877, 0989
- Shift concerns

Note: Patent Pending

6 104740-09K Compensator Feed Regulator Valve Kit

Helps cure:

- Bump/Flare/Harsh shifts
- Burnt clutches

7 144740-02K O-Ringed End Plug Kit

Fits 6 locations

Helps cure:

- Shift concerns
- Burnt clutches

8 144740-01 Oversized Actuator Feed Limit Valve



Helps cure:

- Solenoid codes
- Harsh/Slipping shifts
- No 4th, 5th, 6th

Note: Requires tool kit 144740-TL.

Note: Proper identification of this valve body and pump is critical. See unit page at www.sonnax.com for identification guide.