

Mercedes 722.9


sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 88740-09K Oversized Lubrication Pressure Regulator Valve Kit

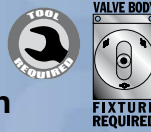

Helps cure:

- Low cooler & lube pressure
- Harsh TCC apply & release
- Erratic TCC apply pressure

Note: Requires tool kit **F-88740-TL9** & the **VB-FIX** reaming fixture.

2 88740-01 Oversized Working Pressure Regulator Valve




Replaces both early- and late-style OE valves.

Helps cure:

- Erratic line pressure
- Poor shift quality
- Burnt clutches

Note: Requires tool kit **F-88740-TL** & the **VB-FIX** reaming fixture.

3 88740-08 Oversized K1 Regulator Valve

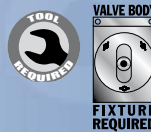


Helps cure:

- Bump shifts
- 2-3 Flare/Harsh
- 5-6 Flare/Harsh

Note: Requires tool kit **F-88740-TL8** & the **VB-FIX** reaming fixture.


4 88740-04K Oversized B2/BR Regulator Valve Kit

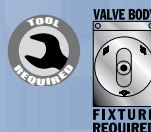


Helps cure:

- Harsh engagement
- Delayed Forward & Reverse
- 4-5 Flare/Harsh

Note: Requires tool kit **F-88740-TL4** & the **VB-FIX** reaming fixture.

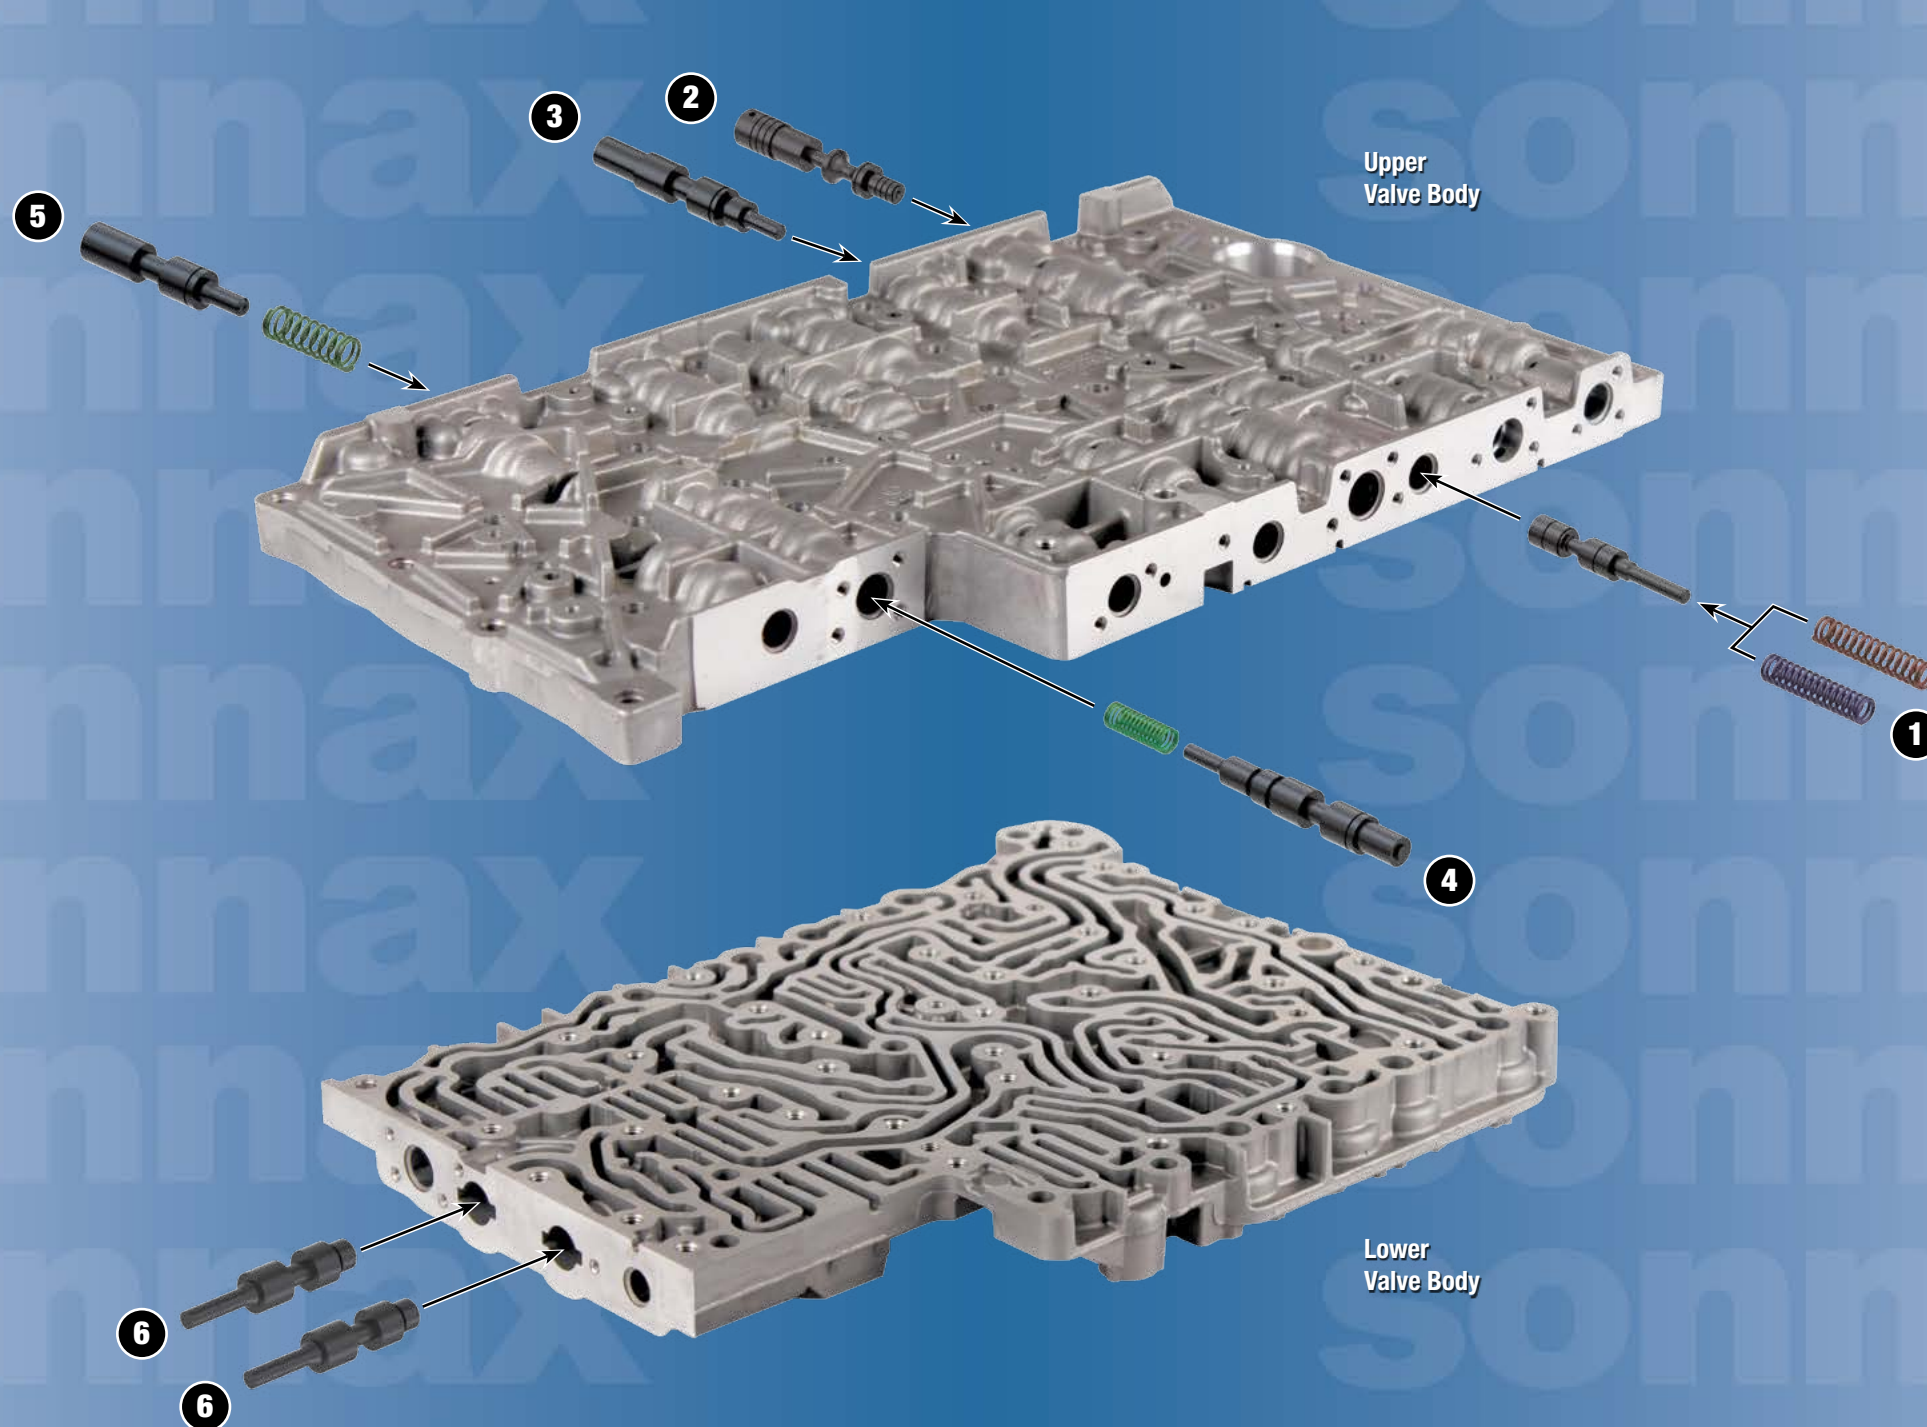

5 88740-06K Oversized K3 Shift Valve Kit

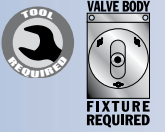


Helps cure:

- K3 clutch burned
- 4-5 Flare/Harsh
- No Forward

Note: Requires tool kit **F-46892-TL3*** & the **VB-FIX** reaming fixture (tool kit also installs oversized solenoid pressure regulator or converter relief valve **46892-03**).

6 88740-02 Oversized Solenoid Regulator Valve

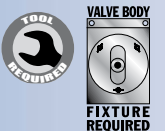

Fits either of 2 locations.

Helps cure:

- Solenoid codes
- Wrong gear starts
- Burnt clutches

Note: Requires tool kit **F-88740-TL2** & the **VB-FIX** reaming fixture.