

# Toyota

# U660E/F, U760E/F

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



These Sonnax kits are also available, see [www.sonnax.com](http://www.sonnax.com) for details.


Zip Kit®  
**U660E-ZIP**  
Zip Kit®  
**U760E-ZIP**

## 1 47740-06K Lockup Control Boost Valve Kit

*Helps cure:*

- TCC apply & release concerns
- TCC slip codes

## 2 47740-02K Oversized Primary Pressure Regulator & Reverse Boost Valve Kit

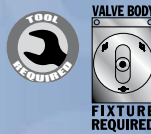

Replaces Either OE Ratio

*Helps cure:*

- Poor line rise
- Clutch/Brake slippage

**Note:** Requires tool kit F-47740-TL2 & the VB-FIX reaming fixture.

## 3 47740-17K 47740-38K Reverse Boost Valve Kits

U660E/F Only

U760E/F Only


*Helps cure:*

- Low line rise in Reverse
- Delayed Reverse

## 4 47740-24K 47740-25K Oversized Solenoid Modulator Valve Kits

U660E/F Only

U760E/F Only

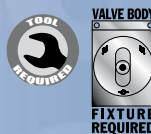

*Helps cure:*


- Shift concerns
- Solenoid codes

**Note:** Both 47740-24K and 47740-25K require tool kit F-47740-TL24 the VB-FIX reaming fixture.

## 5 47740-30K 47740-31K Oversized Lockup Control Valve Kits

U660E/F Only

U760E/F Only

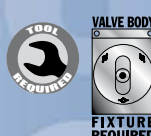

*Helps cure:*

- Harsh 2-3
- Harsh downshifts

**Note:** Both 47740-30K and 47740-31K require tool kit F-47740-TL30 the VB-FIX reaming fixture.

## 6 47740-11K B1, B2, B3, C2 Accumulator Piston Kit

Fits Any of 4 Locations


*Helps cure:*

- Harsh/Flare shifts
- Delayed Reverse with harsh engagement

## 7 47740-12K C1 Accumulator Piston Kit

*Helps cure:*

- Harsh/Delayed Forward
- Burnt C1 clutch

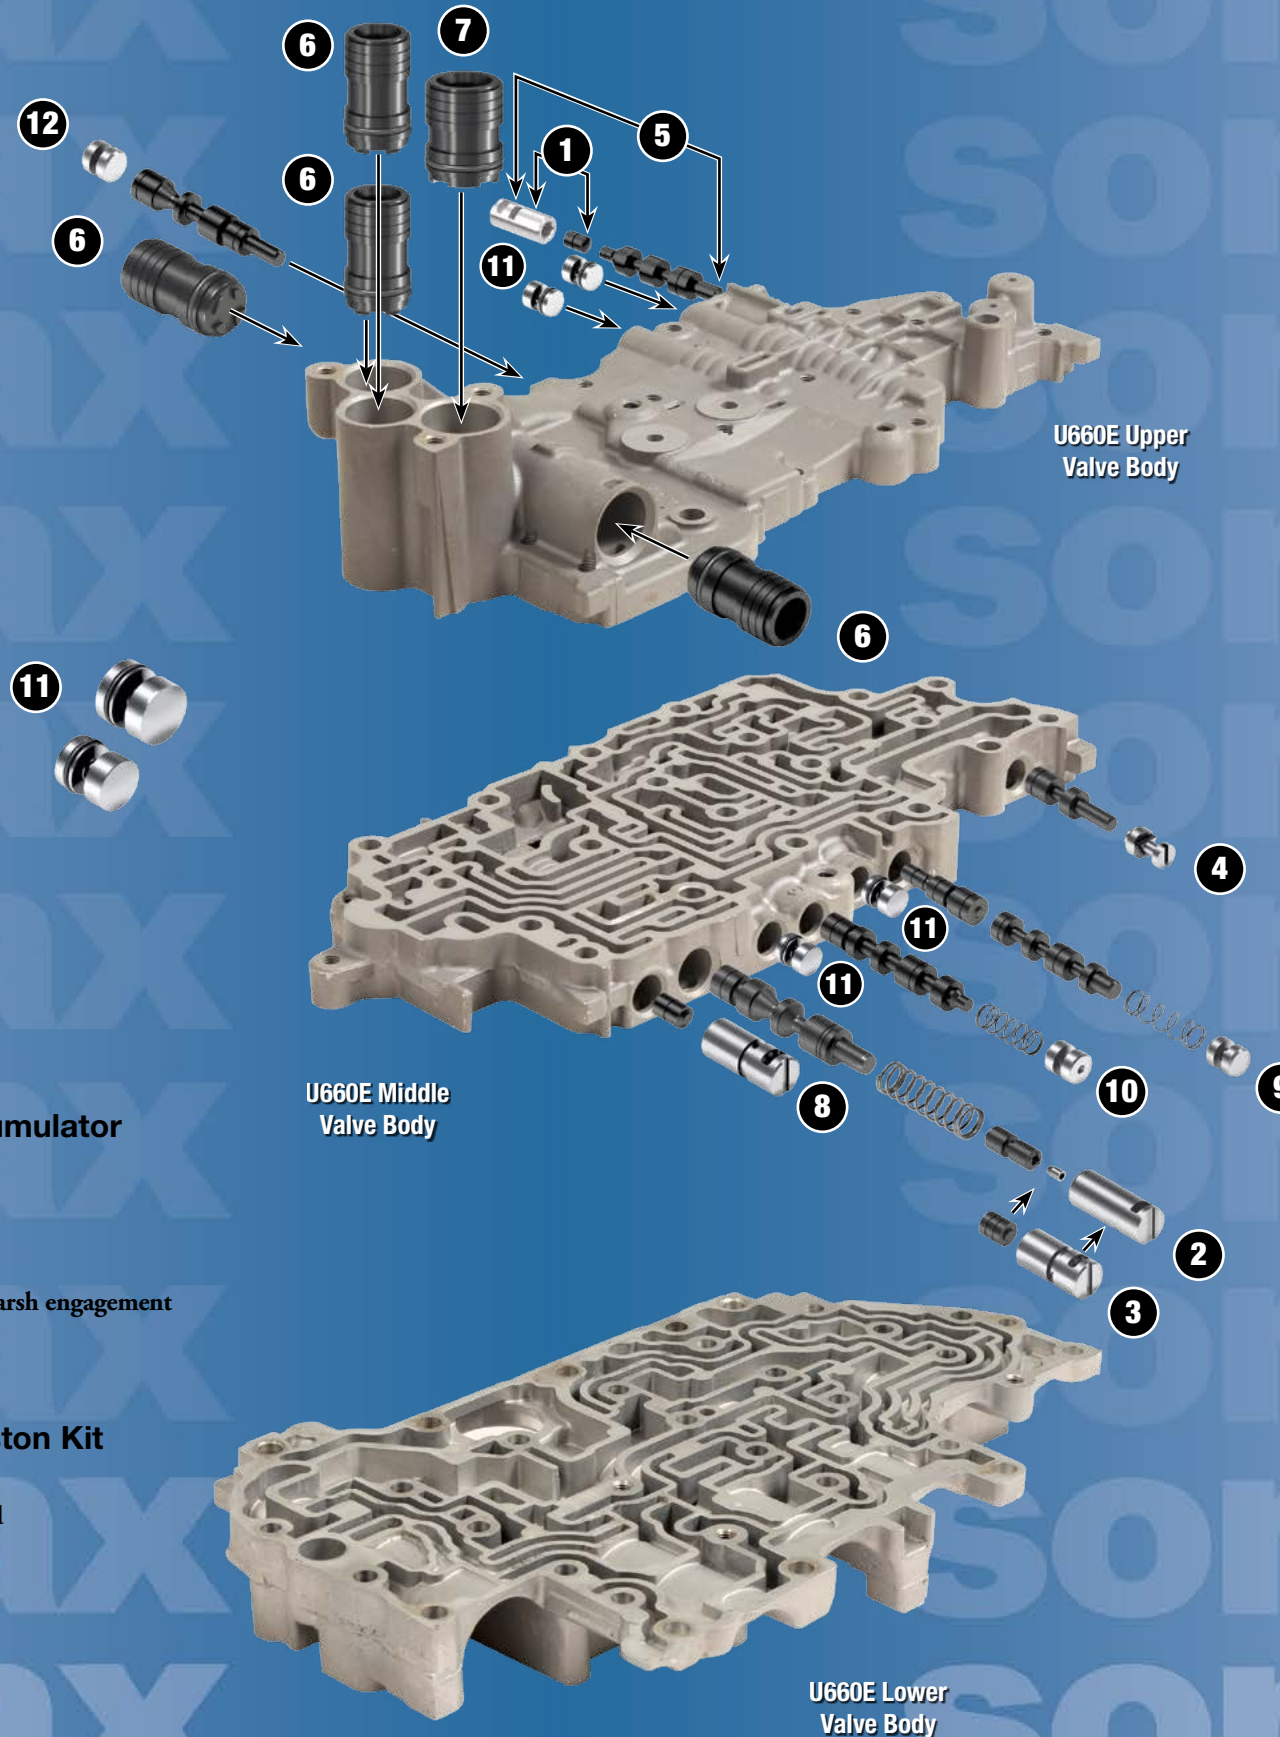

U660E Upper Valve Body

U660E Middle Valve Body

U660E Lower Valve Body

## 8 47740-19K 47740-40K B1 Apply Boost Valve Kits


U660E/F Only

U760E/F Only

*Helps cure:*

- 2<sup>nd</sup> & 6<sup>th</sup> Gear shift concerns
- B1 Brake clutches burnt

## 9 47740-27K Oversized B2 Apply Control Valve Kit

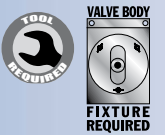


*Helps cure:*

- Delayed/Slip/No Reverse
- B2 Clutch burned

**Note:** Requires tool kit F-47740-TL27 & the VB-FIX reaming fixture.

## 10 47740-22K Oversized Clutch Control Valve Kit

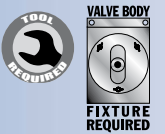

*Helps cure:*

- Harsh/Flared 4-5 shifts
- Delayed Reverse

**Note:** Requires tool kit F-47740-TL22 & the VB-FIX reaming fixture.


## 11 47740-21K O-Ringed End Plug Kit

*Helps cure:*

- Shift concerns
- Burnt clutches

**Note:** Includes seven end plugs in various sizes. Follow usage chart on website or in packaging to determine correct location and size correlation.

## 12 47740-26K Oversized Secondary Pressure Regulator Valve Kit

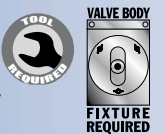

*Helps cure:*

- Overheated transmission
- Bushing, bearing & other lube-related failures

**Note:** Requires tool kit F-47740-TL26 & the VB-FIX reaming fixture.