Aisin AW

*Also fits Mini 6F21WA & VW/Audi 09G, 09K, 09M units

(1) 15741-29K



Lockup Clutch Control Valve Kit

Helps cure:

- RPM surge on coast/light acceleration
- Harsh downshifts

Note: Requires tool kits F-15741-TL29, F-15741-TL29PL & the VB-FIX reaming fixture.

15741-53K

Lockup Clutch Control Plunger Valve Kit

Helps cure:

- TCC apply & release concerns/TCC codes
- RPM surge on coast/light acceleration

15741-01K



Oversized Pressure Regulator & Boost Valve Kit

Helps cure:

- High line pressure in Reverse
- Overheated fluid & TCC lining

Note: Requires tool kit F-15741-TL & the VB-FIX reaming fixture.

(4) 15741-11K



Secondary Pressure Regulator Valve Kit

Helps cure:

- Overheated fluid, bushing & converter
- Harsh Reverse

Note: Requires tool kit F-15741-TL11 & the VB-FIX reaming fixture.

(5) 15741-18K



Solenoid Modulator

Valve Kit Fits Either of 2 Locations

Helps cure:

- Kickdown slip/shock
- 4th/5th/6th Slip

Note: Requires tool kits F-15741-TL18. F-15741-TL29PL & the VB-FIX reaming fixture.



Helps cure:

Helps cure:

• Low line pressure

• Delayed engagement


& the VB-FIX reaming fixture.

15741-51K

Boost Valve Kit

• Delayed Reverse

Note: Requires tool kit F-15741-TL41





(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA

15741-63K

Fits Any of 3 Locations

Oversized Clutch Cutoff Valve Kit

Helps cure:

• Burnt clutches

(13a

Valve

- Overheated fluid
- Harsh/Soft shifts Erratic shift timing

Note: Requires tool kit F-15741-TL63 & the require VB-FIX reaming fixture.



• Low line rise in Reverse

C1/K1 Clutch **Control Valve Kit**



Helps cure:

- Flare/Harsh shifts
- Gear ratio & solenoid codes

Note: 15741-25K requires tool kit F-15741-TL25, 15741-55K requires tool kit F-15741-TL55 & they both require VB-FIX reaming fixture.

15741-05K Valve/Sleeve/Spring 15741-57K Oversized Valve/Spring




K2 Clutch Control Valve Kit

Helps cure:

- Flare/Harsh shifts
- Gear ratio & solenoid codes

Note: 15741-05K requires tool kit F-15741-TL5, 15741-57K requires tool kit F-15741-TL57 & they both require VB-FIX reaming fixture.

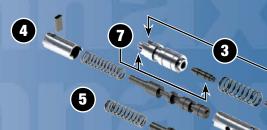

15741-08K Valve/Sleeve/Spring 15741-59K Oversized Valve/Spring

K3 Clutch Control Valve Kit

Helps cure:

- Flare/Harsh shifts
- Gear ratio & solenoid codes

Note: 15741-08K requires tool kit F-15741-TL8, 15741-59K requires tool kit F-15741-TL59 & they both require VB-FIX reaming fixture.




















Middle

Valve Body

Valve Body

8

(12) 15741-22K 15741-61K Oversized Valve/Spring

Valve/Sleeve/Spring

Several Locations

B1 Clutch Control Valve Kit

Helps cure:

- Harsh shifts 2nd/6th Slip
- 1-2/5-6 Flare B1 Clutch burned

Note: 15741-22K requires tool kit F-15741-TL22, 15741-61K requires tool kit F-15741-TL61 & they both require VB-FIX reaming fixture.



Helps cure:


- Delayed engagement Forward slip
- · Burnt clutches/bands




Helps cure:


- Severe wear at accumulator bores
- Loss clutch oil pressure
- Low TCC/EPC pressure





Oversized Two-Spool Relay/Signal Valve Kit





• No shift/various shift concerns

Note: Requires tool kit F-33741B-TL1 & the VB-FIX reaming fixture.

15741-50K Fits Any of 2 Locations

Oversized Three-Spool Relay/Control/Switch Valve Kit



Helps cure:

- Gear ratio & solenoid codes
- No shifts/various shift concerns

Note: Requires tool kit F-33741B-TL1 & the VB-FIX reaming fixture.

15741-70K



Helps cure:

• Gear ratio & solenoid codes

· No 4th/5th/6th

Note: Requires tool kit F-15741-TL70 & the VB-FIX reaming fixture.

(17) 15741-35K

(18) 15741-36K

O-Ringed End Plug Kit

Helps cure:

 Shift concerns associated with circuit pressure loss

Note: These kits fit multiple locations.

(19) 15741-48K

Spring Adjuster Kit

Helps cure:

• Soft/Long/Flare shifts

• Intermediate clutch/solenoid codes



Fits 4 Locations

