


Mercedes 722.6


sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

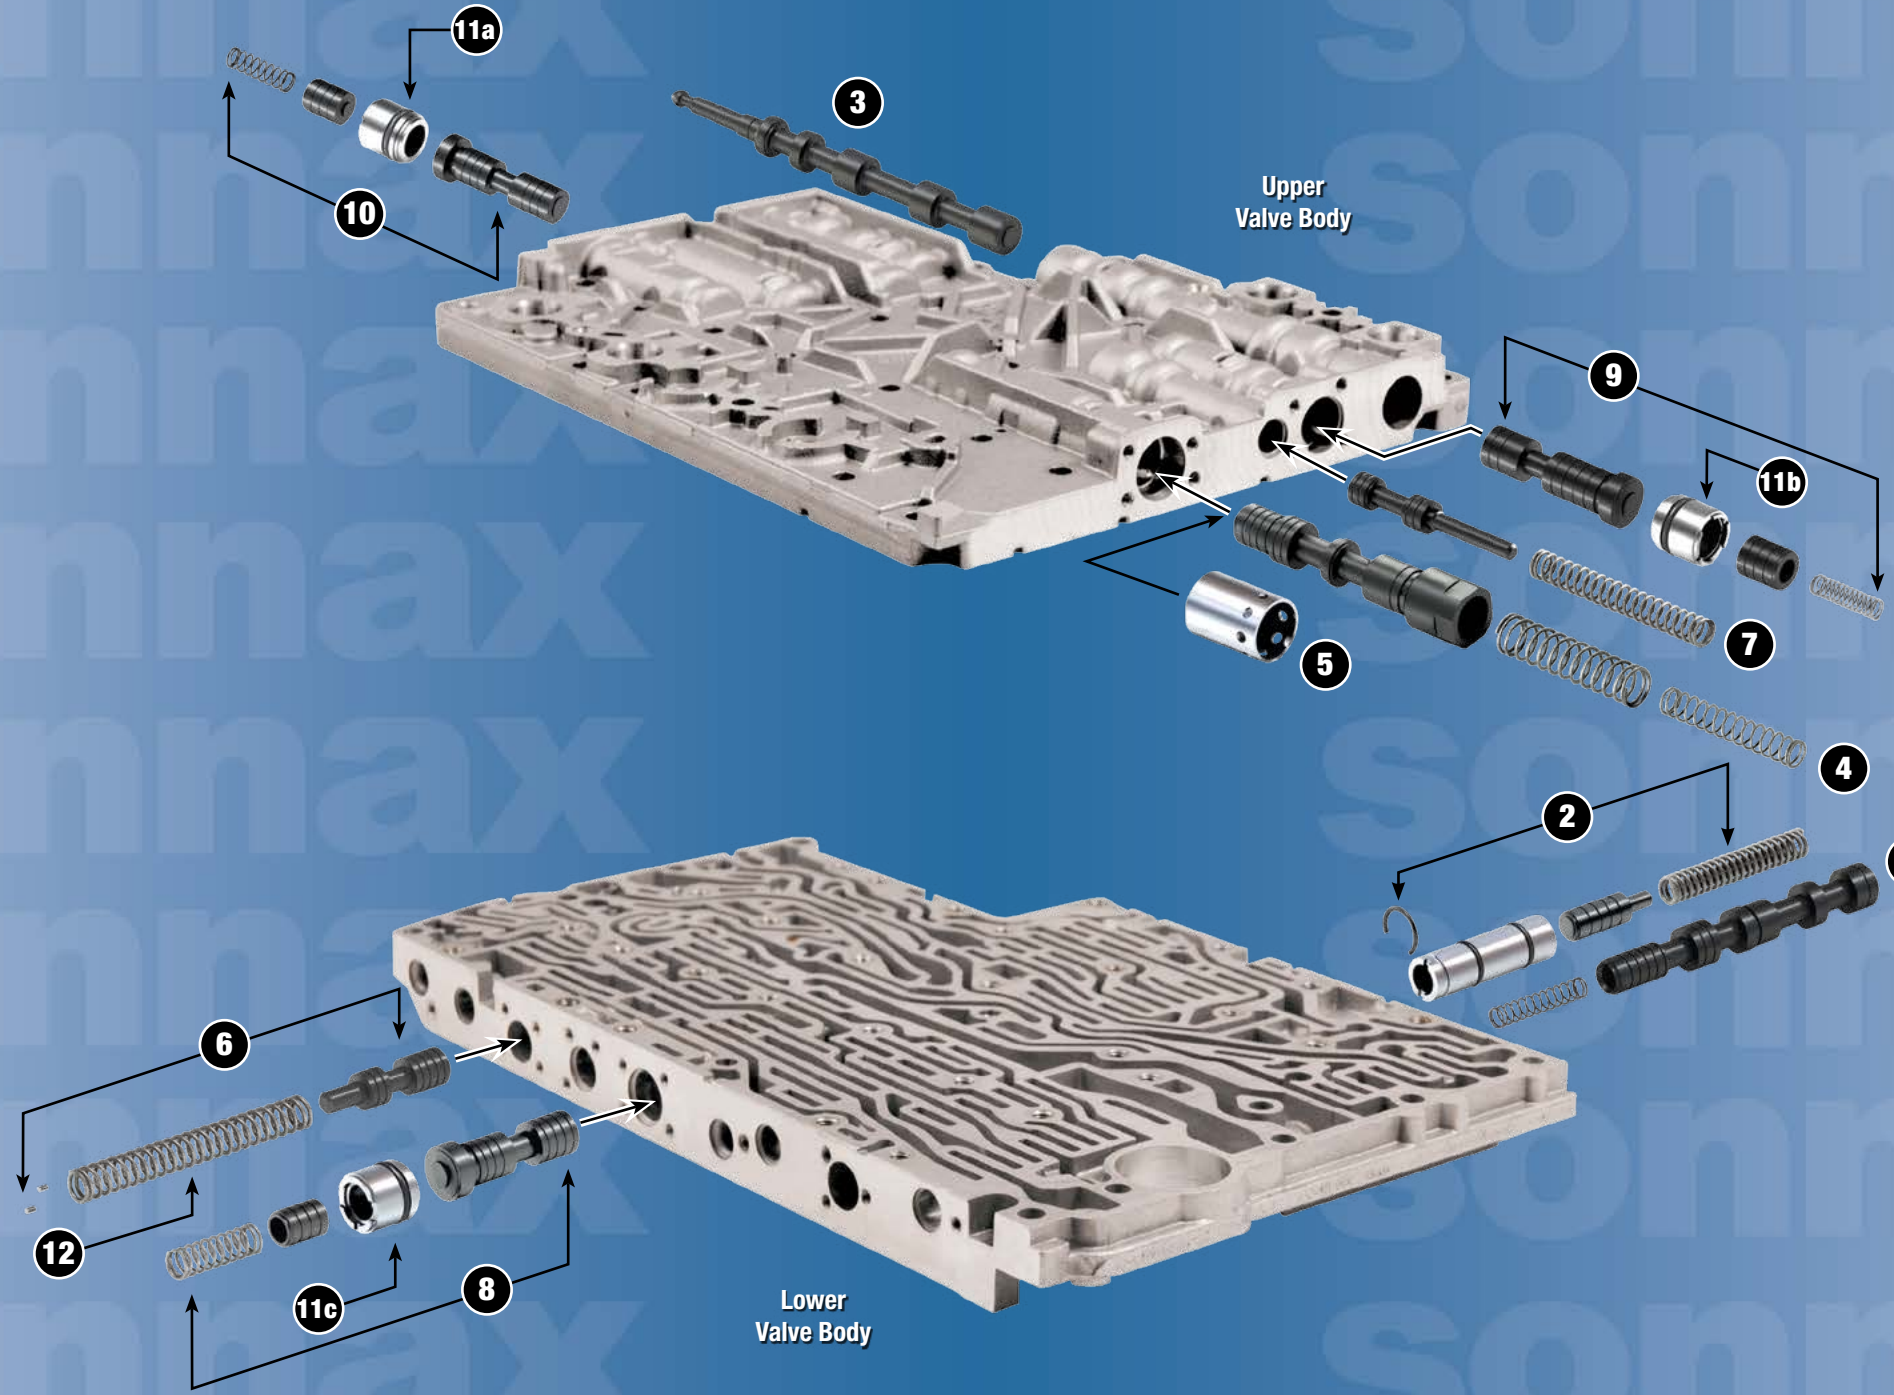

1 68942-10K
Oversized TC Lockup Clutch Regulator Valve Kit

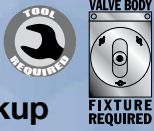

- Helps cure:*
- TCC apply & release complaints
 - TCC codes
 - Lube failures


Note: Requires tool kit F-68942-TL10 & the VB-FIX reaming fixture.

2 68942-23K
TCC Damper Valve & Sleeve Kit

Late Only

- Helps cure:*
- Harsh lockup


3 68942-16
Oversized Manual Valve

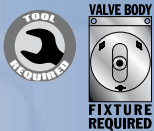

- Helps cure:*
- Low line pressure
 - Delayed engagement

Note: Requires tool kit F-68942-TL16 & the VB-FIX reaming fixture.


4 68942-07K
Oversized Pressure Regulator Valve Kit

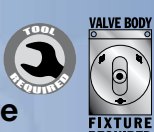

- Helps cure:*
- No 2-3, 4-3 Neutral
 - Soft shifts under acceleration

Note: Requires tool kit F-68942-TL7 & the VB-FIX reaming fixture.

5 68942-06
Outer Pressure Regulator Sleeve

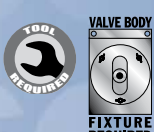

Repairs Outer Bore Only

- Helps cure:*
- No 2-3, 4-3 neutral
 - Soft shifts under load

Note: Requires tool kit F-68942-TL6 & the VB-FIX reaming fixture.

6 68942-17K
Oversized Regulating Valve Pressure Control Valve Kit



- Helps cure:*
- Delayed engagement
 - Flare shifts

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.

7 68942-14K
Oversized Lubricating Pressure Control Valve Kit



- Helps cure:*
- Delayed engagement
 - Poor performance & higher stall speeds

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.


8 68942-19K
Oversized 1-2/4-5 Overlap Control Valve Kit



- Helps cure:*
- Harsh/Flare/Cycling of 1-2/4-5 shifts
 - Slipping gears

Note: Requires tool kit F-68942-TL19 & the VB-FIX reaming fixture.


9 68942-27K
Oversized 2-3 Overlap Control Valve Kit

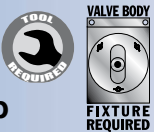

- Helps cure:*
- Harsh/Bumpy/Flare 2-3 shifts
 - Slipping gears

Note: Requires tool kit F-68942-TL27 & the VB-FIX reaming fixture.

10 68942-31K
Oversized 3-4 Overlap Control Valve Kit

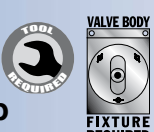

- Helps cure:*
- Harsh/Bumpy/Flare 3-4 shifts
 - Slipping gears

Note: Requires tool kit F-68942-TL31 & the VB-FIX reaming fixture.

11 68942-05K
Master Overlap Control Valve Sleeve Kit

Fits 3 Locations

- Helps cure:*
- Harsh/Bumpy/Flare shifts
 - Slipping

11a 68942-04
3-4 Overlap Control Sleeve Kit

11b 68942-03
2-3 Overlap Control Sleeve Kit

11c 68942-02
1-2, 4-5 Overlap Control Sleeve Kit

12 68942-01
Regulating Pressure Control Valve Spring

Early Only

- Helps cure:*
- Delayed engagement
 - Flare 2-3, 3-4 or 4-5 shifts