


Pressure Regulator Sleeve

Part No.

92835-07

NOTE: Non-VLP units only. Does not fit 41TE and 42RLE units with variable line pressure (VLP). VLP units can be identified by the presence of the line pressure solenoid and transducer mounted on the valve body.

Chrysler 40TE, 41AE, 41TE, 42LE, 42RLE

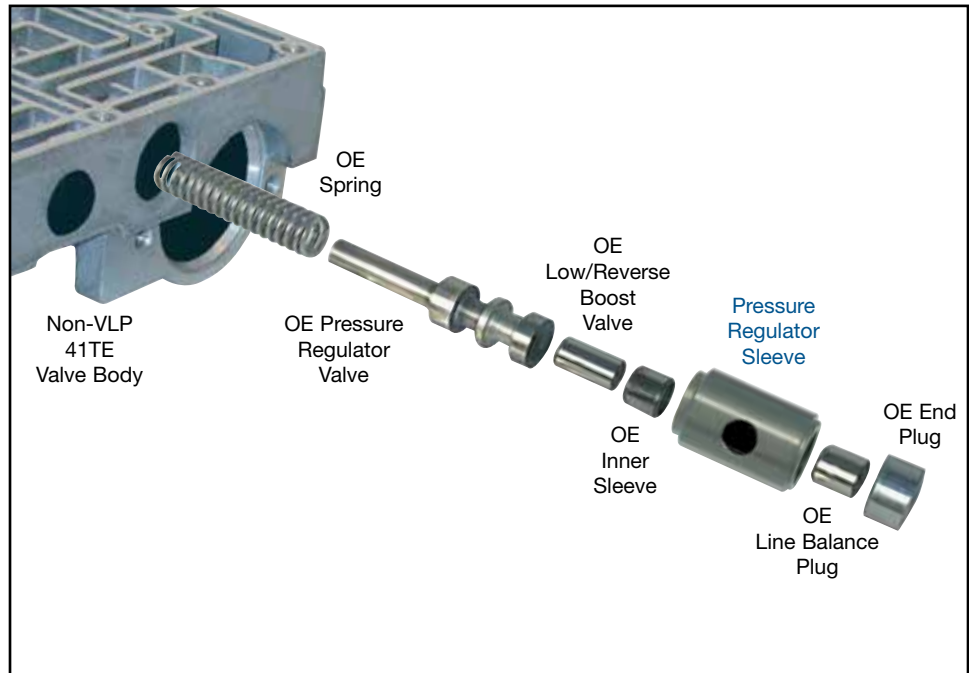

1. Disassembly

- Remove OE retainer, end plug and pressure regulator sleeve assembly from the valve body bore.
- Discard the worn pressure regulator sleeve.
- Keep other OE parts for reuse.

2. Installation & Assembly

Insert the Sonnax pressure regulator sleeve into the assembly and reinstall OE line balance plug and end plug, ensuring the parts are in the correct orientation.

3. Final Testing

Vacuum testing at the port(s) indicated holds the recommended minimum 18 in.-Hg.

NOTE: Some early valve bodies are experiencing high line pressure even with new regulator sleeves. This condition is created by pressure regulator bore wear, warped casting and loose end plugs.

