


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

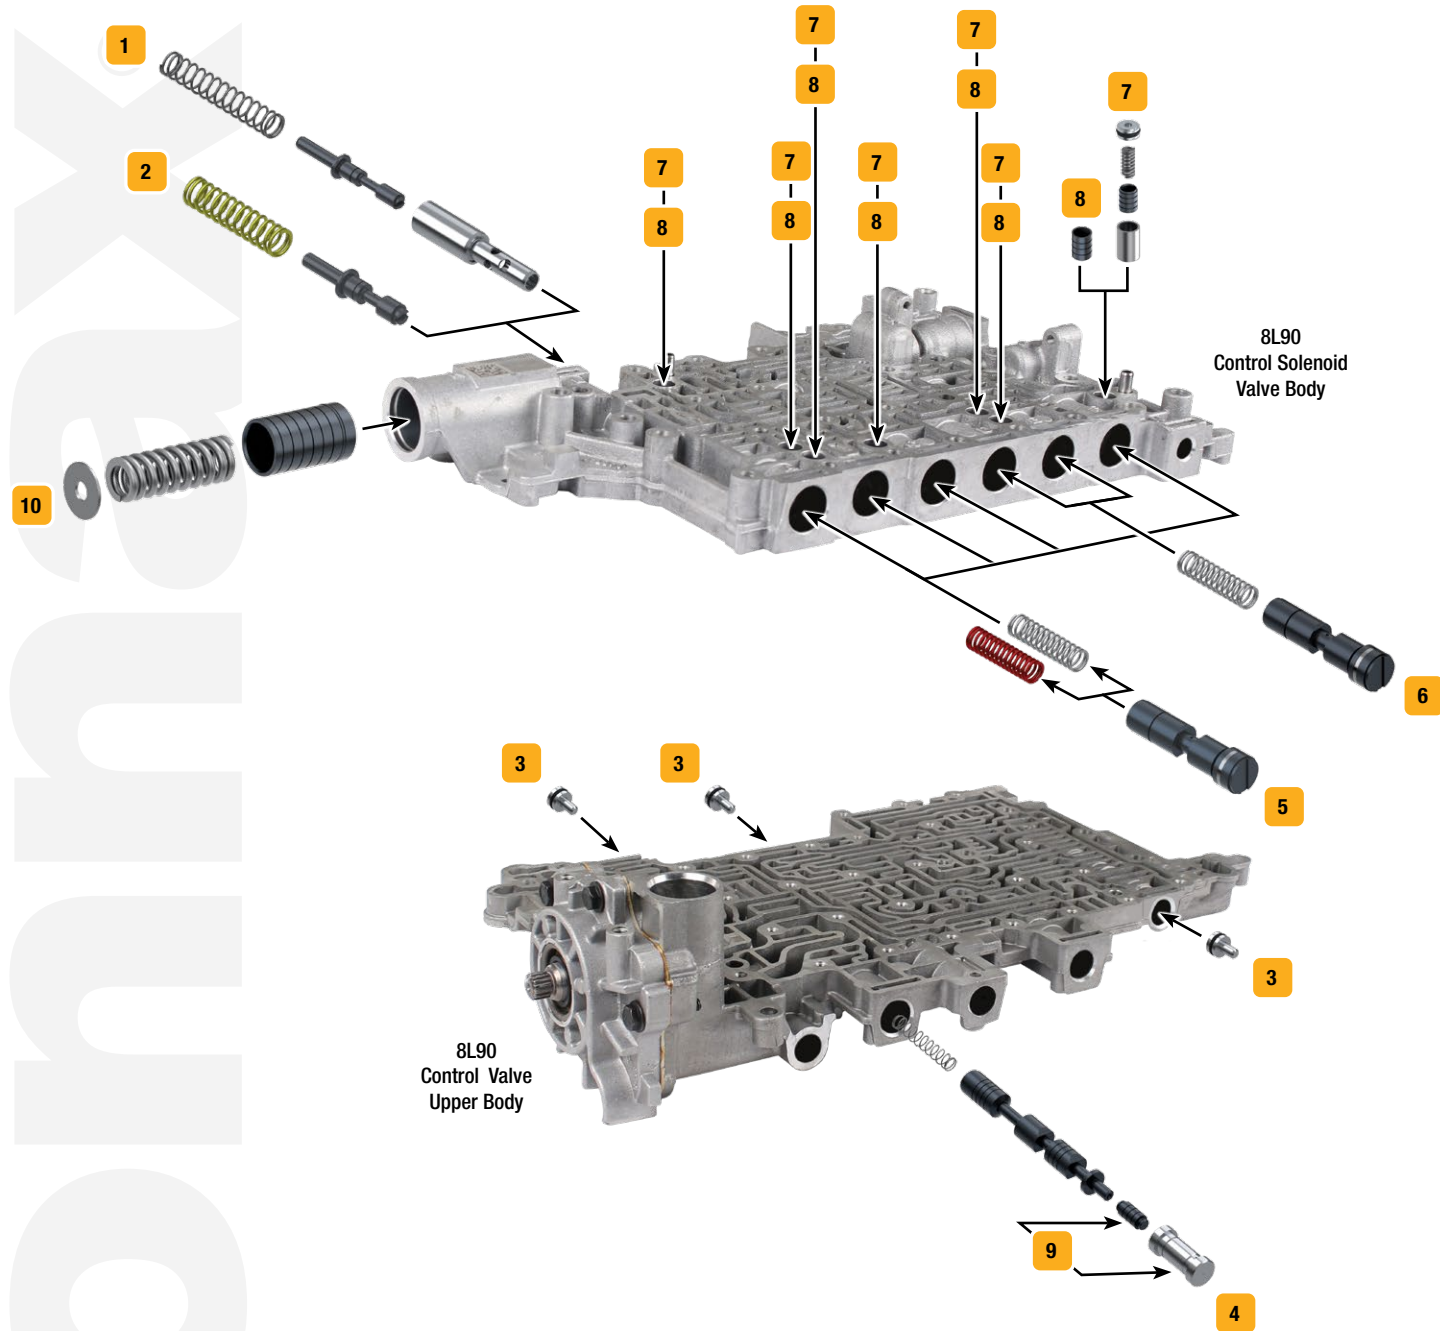

See kit components at [www.sonnax.com](http://www.sonnax.com).

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>Multiple Symptoms</b>					
Poor shift quality, Burnt clutches, Flare shifts, Soft shifts, Clutch slippage, Low line pressure, Ratio codes	Shift Zip Kit®	8L45-8L90-SHIFT-ZIP	ZIP	The first step in correcting common shift problems	
TCC apply & release concerns, Overheated transmission & converter, Loss of cooler flow, Loss of lube oil, Burnt converter, High TCC slip RPM, Code P0218, Code P0741	TCC Zip Kit®	8L45-8L90-TCC-ZIP	ZIP	The first step in correcting common shift problems	
<b>TCC/Lockup Symptoms</b>					
Code P0218, Code P0741, High TCC slip RPM, Overheated converter, Inadequate lubrication	Converter Feed Limit Valve Kit	1 154740-19K	ZIP	OE vacuum testing at the inboard spool requires 154740-TL22	154740-TL22 †
Excess converter pressure, High TCC slip RPM, Code P0218, Code P0741, Overheated converter	Oversized Converter Feed Limit Valve Kit	2 154740-22K	ZIP	OE vacuum testing at the inboard spool requires 154740-TL22	F-154740-TL22*, 154740-TL22 †
<b>Pressure Problems</b>					
Gear ratio & solenoid codes, Lube failures, Poor lube oil control, Converter concerns	O-Ringed End Plug Kit	3 154740-17K	ZIP	Includes 3 end plugs	
Low line pressure, Burnt clutches, Harsh shifts, Low cooler flow, Loss of lube oil	Pressure Regulator & Shuttle Valve Kit	4 154740-02K	ZIP		
Burnt clutches, Pressure loss, Poor shift quality, Burnt converter	S2/S3/S4/TCC Clutch Control Valve Kit	5 154740-11K	ZIP	Fits any of 4 locations	154740-BST11†
Burnt clutches, Pressure loss, Poor shift quality	S1/S5 Clutch Control Valve Kit	6 154740-13K	ZIP	Fits either of 2 locations	154740-BST13†
Poor shift quality, Low line pressure, No converter apply, Burnt clutches, Soft shifts	Signal Accumulator Piston Kit	7 154740-06K	ZIP	Includes 4 piston sets, fits any of 7 locations	
	Oversized Signal Accumulator Piston Kit	8 154740-01K	ZIP	Includes 7 pistons	154740-TL
High line pressure, Harsh shifts, Low cooler flow, Loss of lube oil	Shuttle Valve Kit	9 154740-09K	ZIP		
<b>Shift/Engagement Concerns</b>					
Clutch slippage, Burnt clutches, Flare shifts, Ratio codes	1-3-5-6-7 Accumulator Piston Kit	10 154740-15K	ZIP		

\* VB-FIX Required

† Recommended Tool