


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

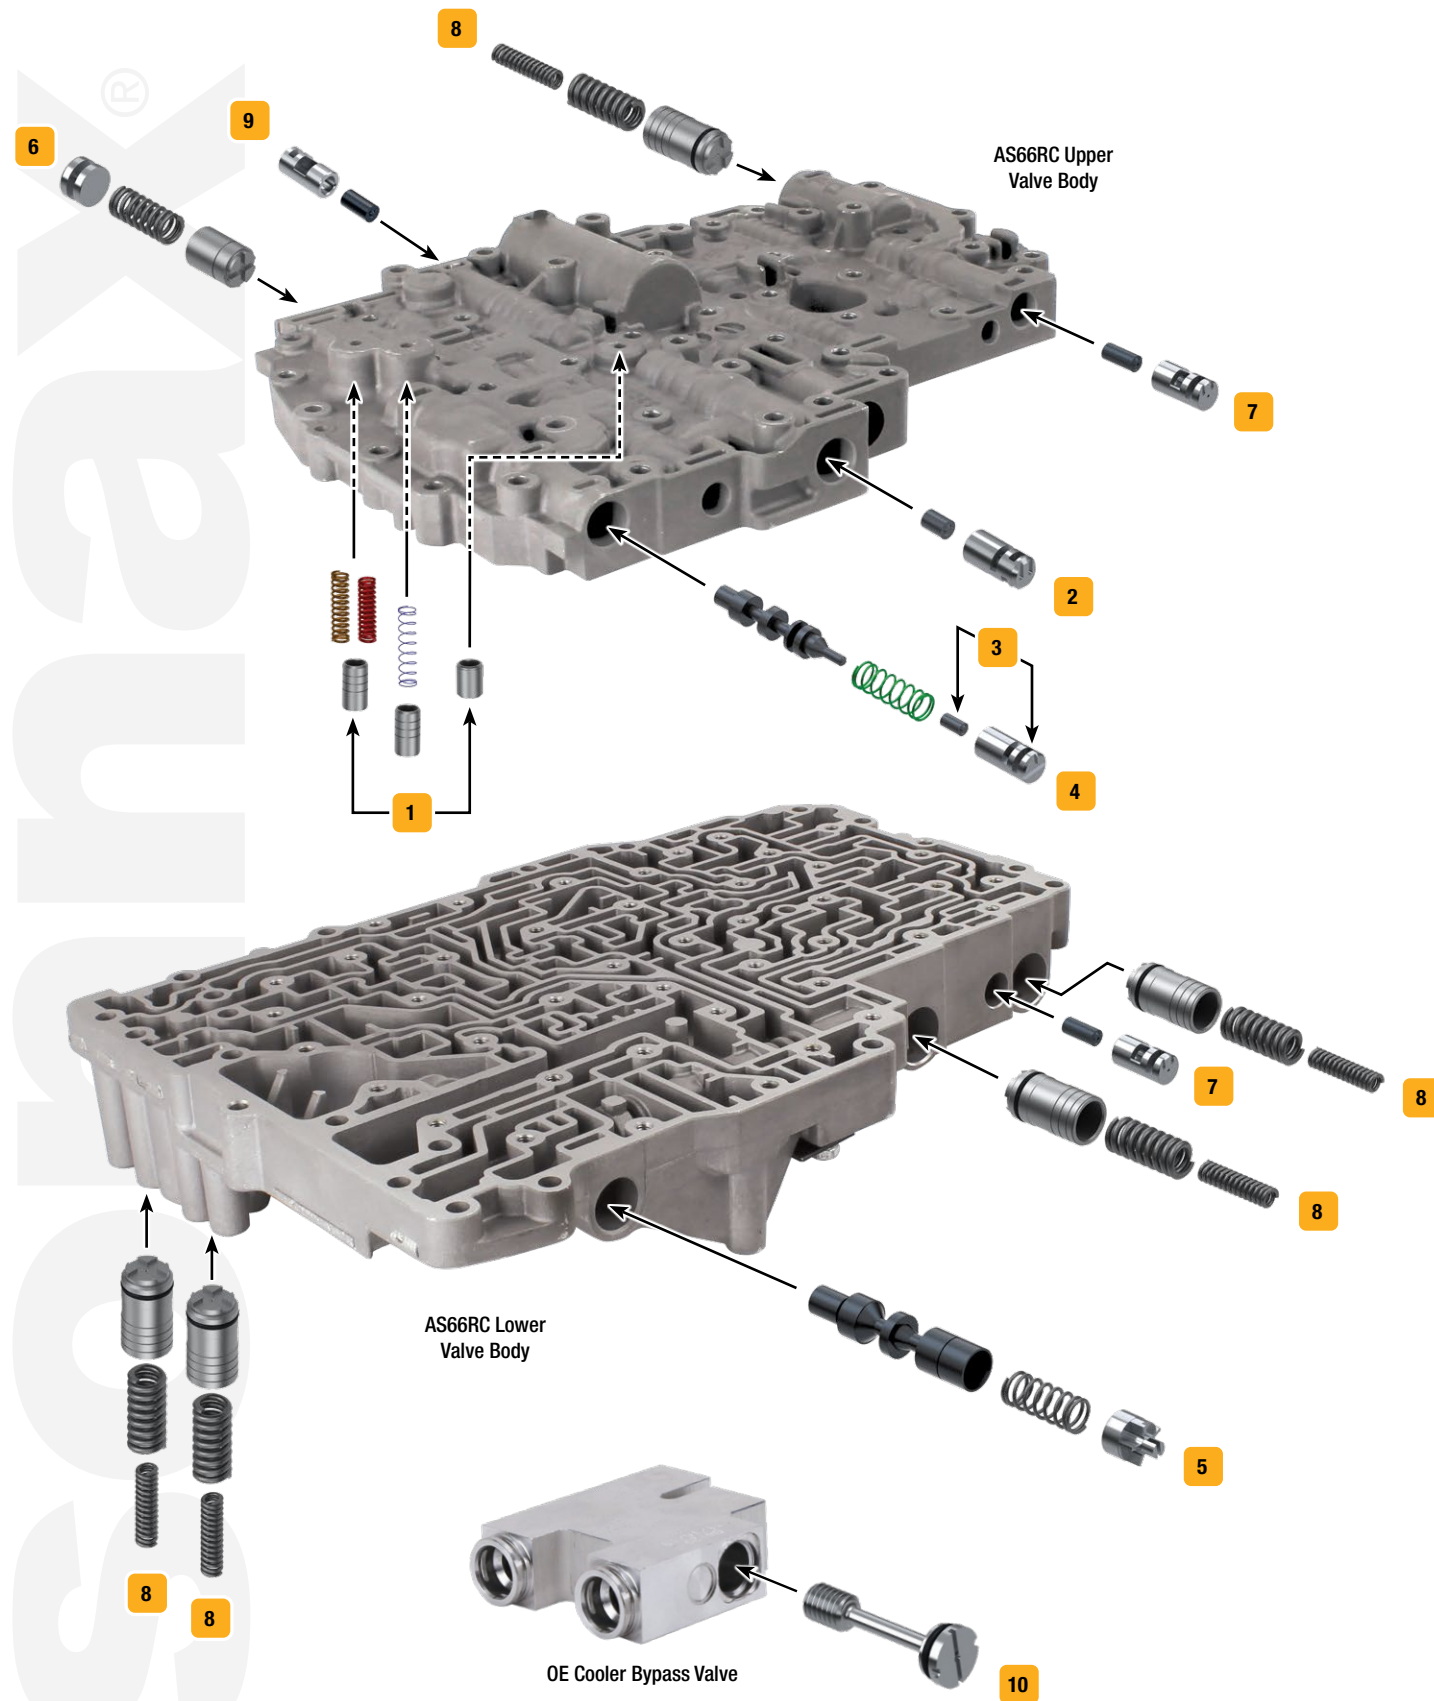

Symptoms/Benefits	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
Low cooler flow, Overheated fluid, Low converter pressure, TCC slip, TCC slip codes	Oversized Cooler, Main Converter & Converter Relief Valve Kit	1 122740-10K	Selective springs	122740-TL10
TCC slip, TCC slip codes, TCC apply & release concerns	Lockup Boost Valve Kit	2 122740-30K	ZIP	
TCC codes, Converter shudder, Overheated fluid, bushings & converter, Low SLT pressure	Secondary Pressure Regulator Plunger Valve Kit	3 122740-03K	ZIP AS66RC only, .255" dia. plunger valve	
	Secondary Pressure Regulator Plunger Valve Kit	3 122740-05K	ZIP AS69RC only, .321" dia. plunger valve	
Low cooler flow, Overheated transmission & converter, Reduced converter clutch life	Oversized Secondary Pressure Regulator Valve Kit	4 122740-24K	AS66RC only	F-122740-TL24*
	Oversized Secondary Pressure Regulator Valve Kit	4 122740-28K	AS69RC only	F-122740-TL28*
Pressure Problems				
High line pressure, Low line pressure, Poor shift quality, Burnt clutches	Oversized Pressure Regulator Valve Kit	5 122740-07K		F-122740-TL7*
Harsh shifts, Delayed shifts, Erratic SLT pressure, Low line pressure, Erratic line pressure	Oversized SLT Piston Kit	6 122740-17K		F-122740-TL17*
Shift/Engagement Concerns				
1-2 Flare, 5-6 Flare, B1 Clutches burned, Low line pressure, Delayed engagement	B1/B2 Apply Control Plunger Valve Kit	7 122740-01K	ZIP Fits either of 2 locations	
Flare shifts, Harsh shifts, Slipping gears, Burnt clutches	B1, B2, K1, K2, K3 Accumulator Piston Kit	8 122740-13K	ZIP Fits any of 5 locations	
Coastdown clunk, Delayed Forward, Forward slip	K1 Apply Boost Valve Kit	9 122740-29K	ZIP	
Component Damage/Failure				
Overheating, Overheated fluid	Thermal Bypass Eliminator Kit	10 72760-01K	ZIP AS69RC only, for use in OE 68186711AB	

* VB-FIX Required