


Ford 10R60, 10R80, 10R90, 10R140

Some parts also fit GM Gen. 1 & 2 10L60, 10L80, 10L90 and Allison® 10L1000.

sonnax®

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

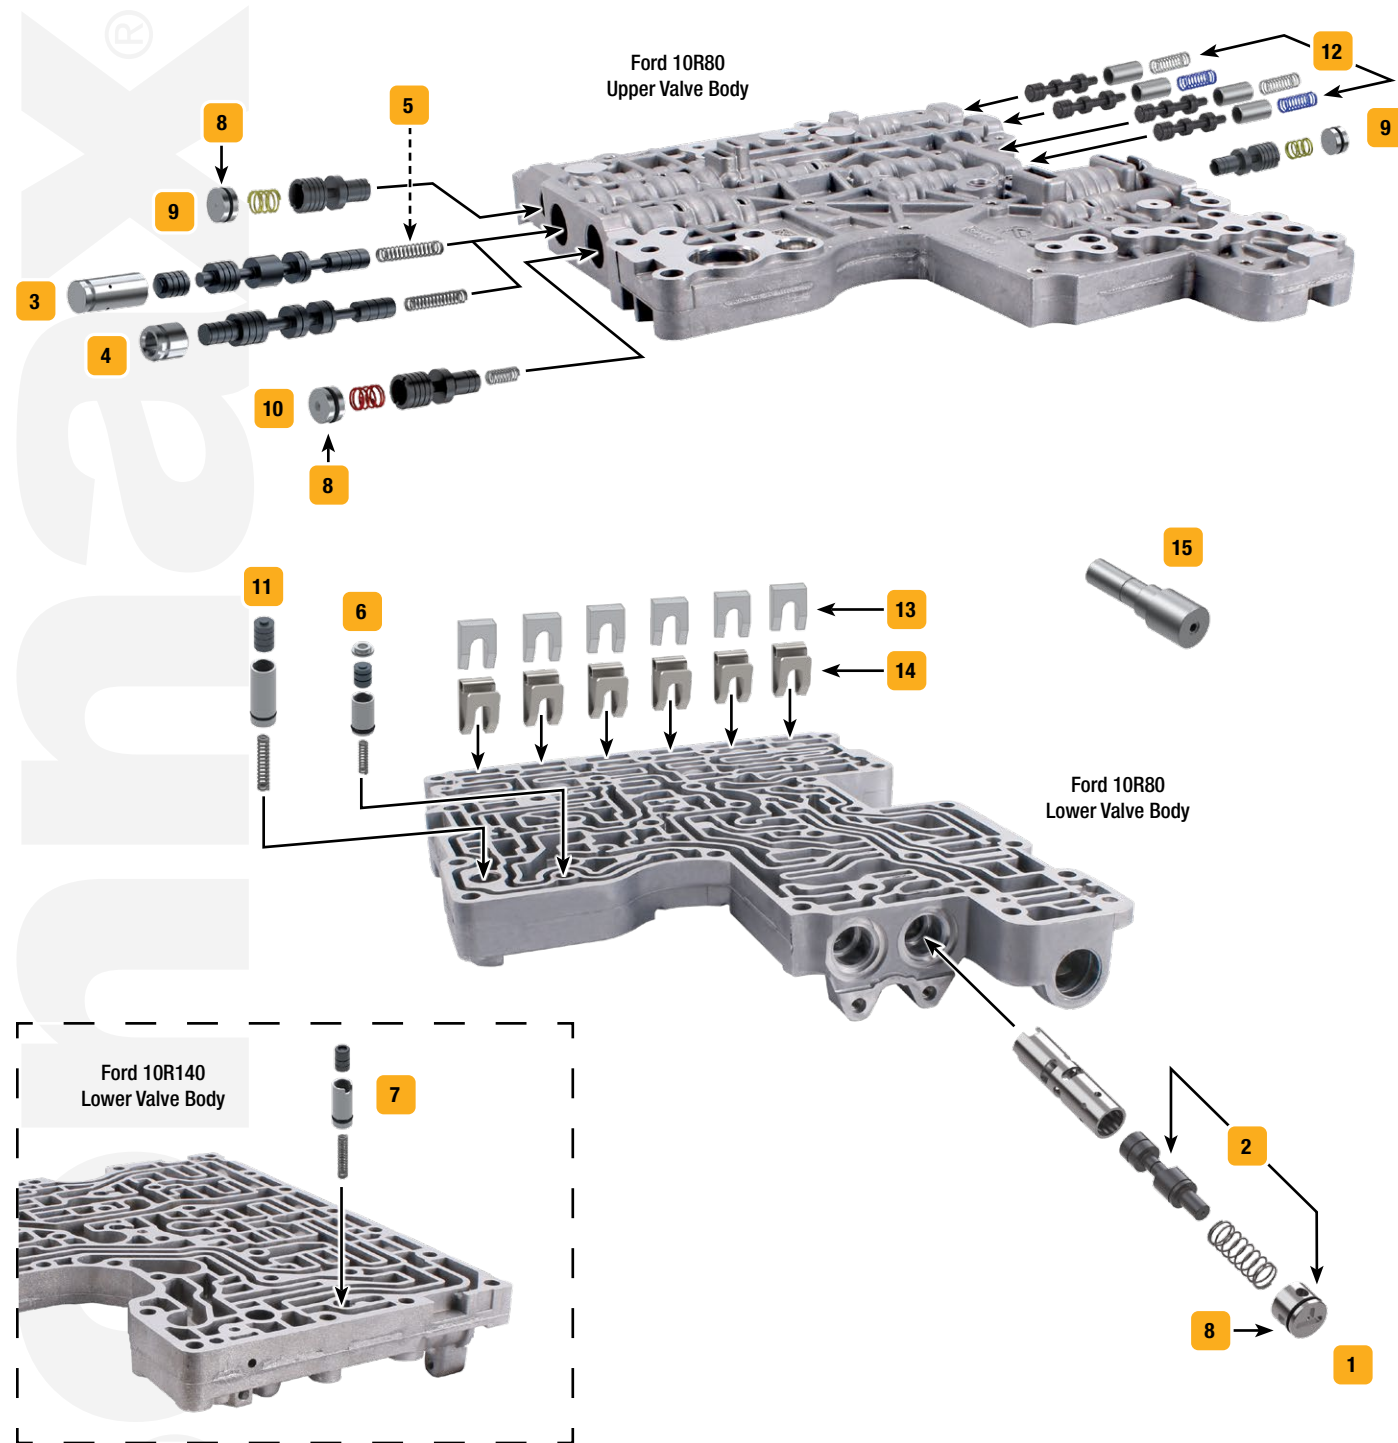

See kit components at www.sonnax.com.

Symptoms/Benefits	Product Name	Part No.	Details	Drop-In Zip Valve™ Parts	Tooling
Multiple Symptoms					
The first step in correcting common shift problems	Zip Kit®	10L80-G1-10R80-ZIP	ZIP 10R60/80/90, Gen. 1 10L60/80/90 only		
TCC/Lockup Symptoms					
TCC apply & release concerns, Overheated fluid, TCC slip codes	TCC Priority Valve Kit	1 105740-03K	ZIP 10R60/80/90, Gen. 1 & 2 10L60/80/90 only		
	Oversized TCC Priority Valve Kit	2 105740-22K	10R60/80/90, Gen. 1 & 2 10L60/80/90 only		F-105740-TL22*
TCC apply & release concerns, Low TCC apply pressure in full lockup	Oversized TCC Regulator & Boost Valve Kit	3 105740-17K	10L1000, Gen. 2 10L60/80/90 only		F-105740-TL16*
	Oversized TCC Regulator Valve Kit	4 105740-15K	10R60/80/90 only		F-105740-TL16*
	Oversized TCC Regulator Valve Kit	4 105740-16K	Gen. 1 10L60/80/90 only		F-105740-TL16*
TCC apply & release concerns, Low cooler flow, Converter shudder & TCC slip	TCC Regulator Valve Spring	5 105740-29	10R60/80/90, 10L1000, Gen. 1 10L60/80/90 only		
Lube failures, TCC apply & release concerns, Overheated fluid, Overheated converter	TCC Signal Damper Piston Kit	6 105740-06K	ZIP 10R60/80, Gen. 1 10L80/90 only		
TCC apply & release concerns, TCC codes & concerns, TCC shudder	TCC Signal Damper Piston Kit	7 105740-07K	ZIP 10R140 only		
Pressure Problems					
Low line pressure, Various shift concerns, TCC apply & release concerns, Overheated fluid	O-Ringed End Plug Kit	8 105740-13K	ZIP 10R60/80/90, Gen. 1 10L60/80/90 only, includes 2 end plugs		
	Main Pressure Regulator Valve Kit	9 105740-12K	ZIP 10R60/80/90/140, Gen. 1 10L60/80/90 only		
Low line pressure, Various shift concerns, Delayed engagement, Poor shift quality	Oversized Main Pressure Regulator Valve Kit	10 105740-20K	10R60/80/90/140, Gen. 1 10L60/80/90 only		F-105740-TL20*
	Oversized Main Pressure Regulator Valve Kit	10 105740-21K	Gen. 2 10L60/80/90 only		F-105740-TL20*
Shift/Engagement Concerns					
Harsh shifts, High line pressure	LPC Signal Damper Piston Kit	11 105740-04K	ZIP 10R60/80/90/140, Gen. 1 10L80/90 only		
	LPC Signal Damper Piston Kit	11 105740-05K	ZIP Gen. 2 10L80/90 only		
Component Damage/Failure					
Burnt clutches, Lost or damaged component	Latch Valve Stem Repair Kit	12 105740-47K	ZIP 10R60/80/90, Gen. 1 10L60/80/90 only		
	Latch Valve Stem Repair Kit	12 105740-50K	ZIP 10R140 only		
Loss of shift solenoid control pressure, Poor shift quality, Various shift concerns	Solenoid Stabilization Clip Insert	13 105740-01K	ZIP 6/Bag		
	Solenoid Stabilization Retainer	14 105740-19K	ZIP 6/Bag		
Tools					
	Clutch Control Valve Bore Sizing Tool	15 105740-BST			

* VB-FIX Required