


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

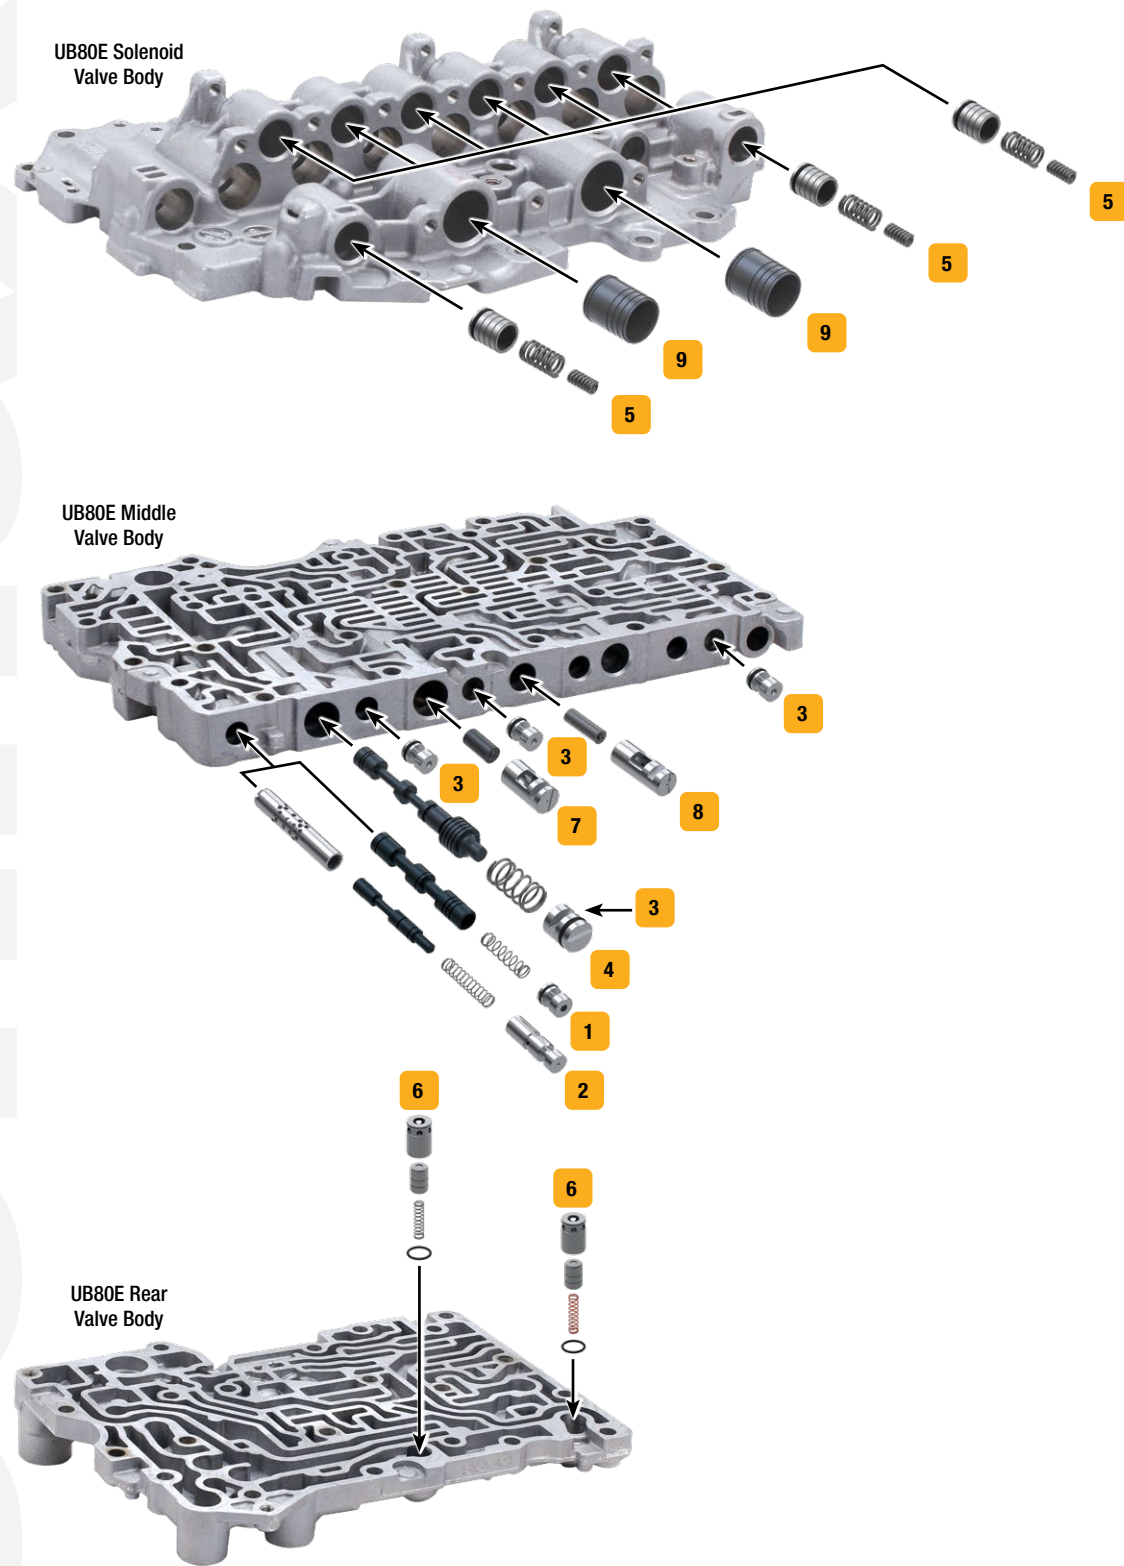

See kit components at www.sonnax.com.

Symptoms/Benefits	Product Name	Part No.	Details ZIP Drop-In Zip Valve™ Parts	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	UA80E-UB80E-ZIP	ZIP End plug for 4-way checkball assembly location only replaces late-style, aluminum plugs	
Pressure Problems				
Inadequate lubrication, Lube failures due to lack of cooler flow, Overheated fluid	Oversized Cooler/Lube Flow Control Valve Kit	1 168740-08K		F-168740-TL8*
Lube failures, Overheated fluid, Inadequate lubrication	Modified Lube Flow Control Valve Kit	2 168740-16K	ZIP	
Poor shift quality, Pressure loss	O-Ringed End Plug Kit	3 168740-10K	ZIP End plug for 4-way checkball assembly location only replaces late-style, aluminum plugs, includes 1 large & 3 small end plugs	
Burnt clutches, Low line pressure, High line pressure, Burnt transmission components	Oversized Pressure Regulator Valve Kit	4 168740-06K		F-168740-TL6*
Poor shift quality, Burnt clutches, Delayed engagement, TCC apply & release concerns	Solenoid Damper Kit	5 168740-12K	ZIP Fits any of 8 locations	
Lube failures, Overheated fluid, Cooler drain back, Overheated converter, Delayed engagement	TCCR & TCCV Damper Kit	6 168740-11K	ZIP	
Shift/Engagement Concerns				
Delayed engagement, C1 Clutch burned, Poor shift quality	C1 Apply Boost Valve Kit	7 168740-01K	ZIP	
C4 Clutch burned, 4th & 6th Gear shift concerns, Poor shift quality	C4 Apply Boost Valve Kit	8 168740-02K	ZIP	
Slips in Forward & Reverse, Delayed engagement, Poor shift quality, Harsh engagement	Forward/Reverse Accumulator Piston Kit	9 168740-05K	ZIP Fits either of 2 locations	

* VB-FIX Required