


# GM 10L60/80/90 (Gen. 2)



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

GM 10L60  
(Gen. 2)  
Upper Valve Body

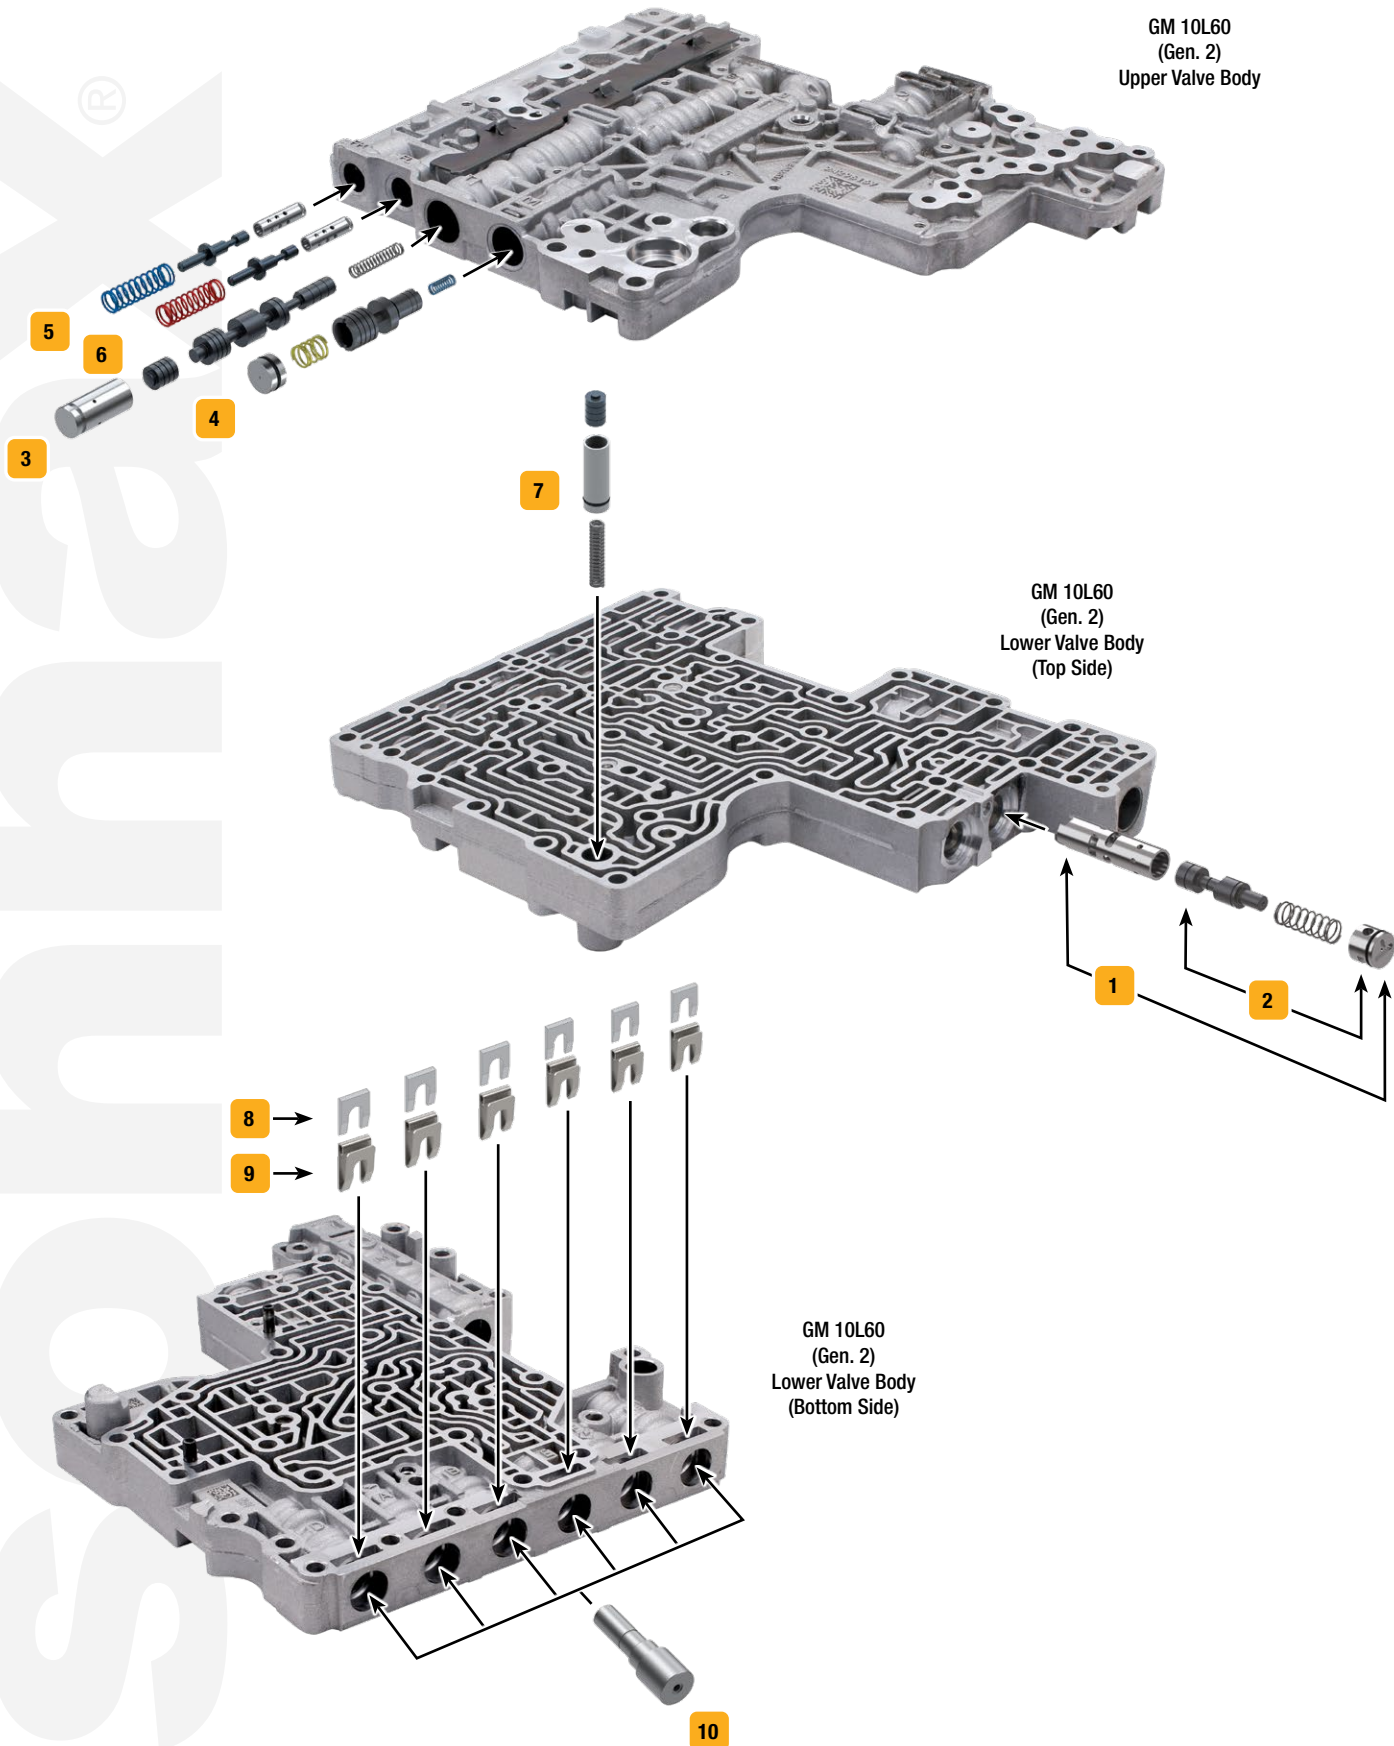

GM 10L60  
(Gen. 2)  
Lower Valve Body  
(Top Side)

GM 10L60  
(Gen. 2)  
Lower Valve Body  
(Bottom Side)

Symptoms/Benefits	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>TCC/Lockup Symptoms</b>					
TCC apply & release concerns, Overheated fluid, TCC slip codes	TCC Priority Valve Kit	1 105740-03K	ZIP		
	Oversized TCC Priority Valve Kit	2 105740-22K			F-105740-TL22*
TCC apply & release concerns, Low TCC apply pressure in full lockup	Oversized TCC Regulator & Boost Valve Kit	3 105740-17K			F-105740-TL16*
<b>Pressure Problems</b>					
Low line pressure, Various shift concerns, Delayed engagement, Poor shift quality	Oversized Main Pressure Regulator Valve Kit	4 105740-21K			F-105740-TL20*
<b>Shift/Engagement Concerns</b>					
No shift, Burnt clutches, Clutch failure	Feed Limit High Valve Kit	5 105740-58K	ZIP		
	Oversized Feed Limit High Valve Kit	5 105740-60K			144740-TL, F-124740-TL48*
Momentary wheel lockup, Code P0747, Downshift to 2nd from high gear, Harsh shifts	Feed Limit Low Valve Kit	6 105740-54K	ZIP		
	Oversized Feed Limit Low Valve Kit	6 105740-59K			144740-TL, F-124740-TL48*
Harsh shifts, High line pressure	LPC Signal Damper Piston Kit	7 105740-05K	ZIP Gen. 2 10L80/90 only		
<b>Component Damage/Failure</b>					
Loss of shift solenoid control pressure, Poor shift quality, Various shift concerns	Solenoid Stabilization Clip Insert	8 105740-01K	ZIP 6/Bag		
	Solenoid Stabilization Retainer	9 105740-19K	ZIP 6/Bag		
<b>Tools</b>					
	Clutch Control Valve Bore Sizing Tool	10 105740-BST			

\* VB-FIX Required