

Hyundai/Kia

A6GF1,

A6LF1/2/3, A6MF1/2

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.


1 102741-11K

Oversized TCC Control Valve Kit

Helps cure:

- TCC apply/release concerns
- Excess TCC slip
- TCC codes

Note: Requires tool kit F-102741-TL11 & the VB-FIX reaming fixture.

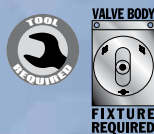

2 102741-01K

TCC Pressure Control Plunger Valve Kit

Helps cure:

- Converter shudder & failure
- TCC codes
- TCC slip

3 102741-08K

Oversized Pressure Regulator Valve Kit

Helps cure:

- Burnt clutches
- Erratic line pressure
- Poor shift quality

Note: Requires tool kit F-102741-TL8* & the VB-FIX reaming fixture.




4 102741-16K

Oversized 2-6 Pressure Control Valve Kit

Helps cure:

- 1-2, 5-6 Flare
- 2-6 Clutch burned
- No/Slipping 2nd, 6th gear

Note: Requires tool kit F-102741-TL16 & the VB-FIX reaming fixture.

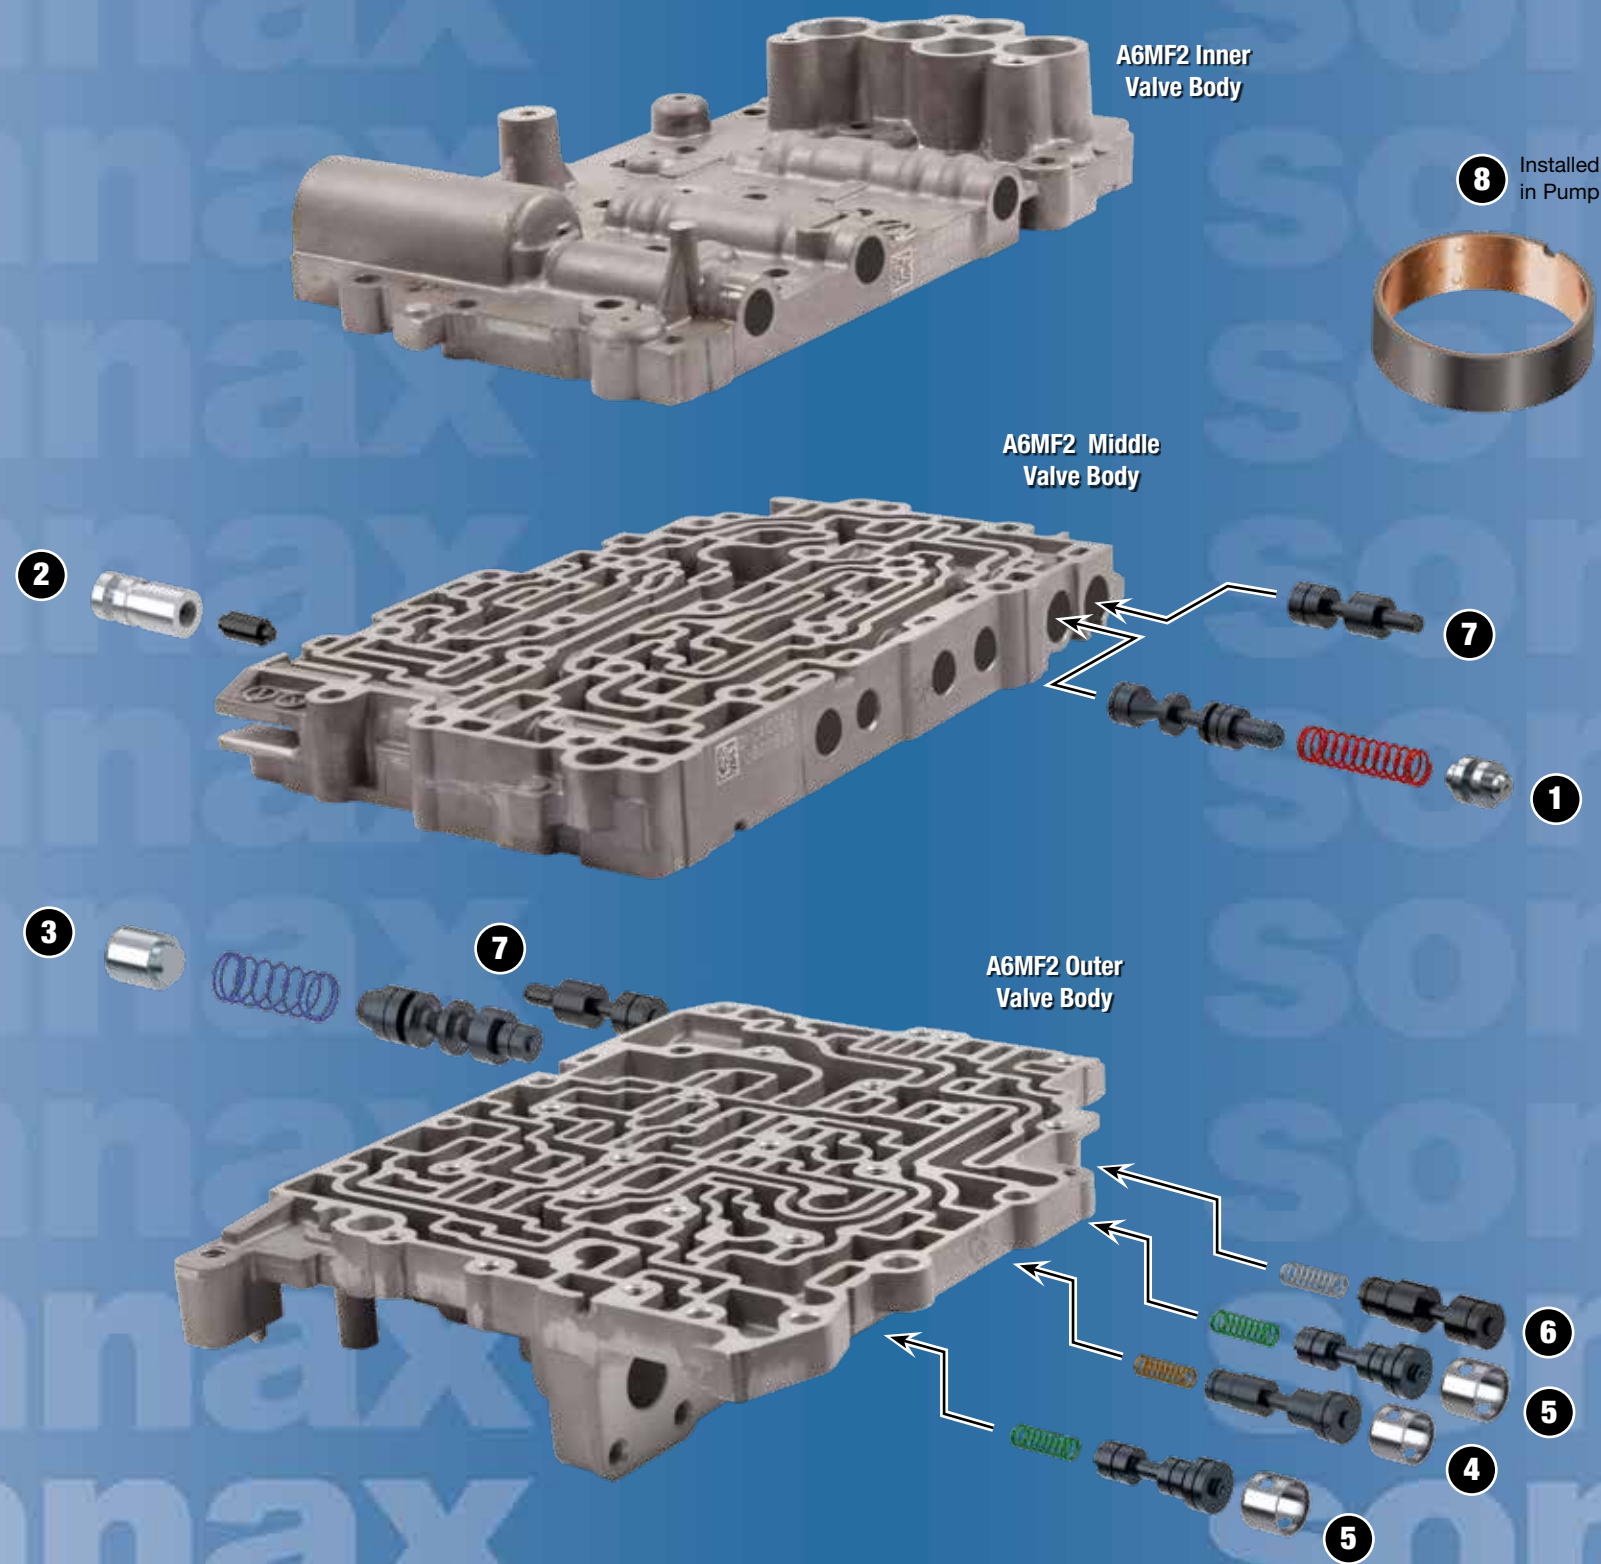


5 102741-13K Fits Either of 2 Locations

Oversized 3/5/Reverse & Underdrive Pressure Control Valve Kit

Helps cure:

- Slips, flares, bind-ups
- Underdrive brake clutch burned
- Erratic shift timing

Note: Requires tool kit F-102741-TL13 & the VB-FIX reaming fixture.

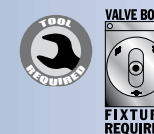


6 102741-18K Oversized Overdrive Pressure Control Valve Kit

Helps cure:

- 3-4 Flare
- 4-5-6 Slip

Note: Requires tool kit F-102741-TL18 & the VB-FIX reaming fixture.

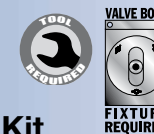

7 102741-07 Fits Either of 2 Locations

Oversized Pressure Reducing Valve

Helps cure:

- Burnt clutches
- Harsh/soft shifts
- Solenoid codes

Note: Requires tool kit F-102741-TL7* & the VB-FIX reaming fixture.



8 102034-01 Fits A6MF1/2 Only

Pump Bushing

Helps cure:

- Pump bushing & mating impeller hub wear prematurely

*Note: Tool kits F-102741-TL8 and F-102741-TL7 are no longer in production. Check with your distributor for availability.