


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

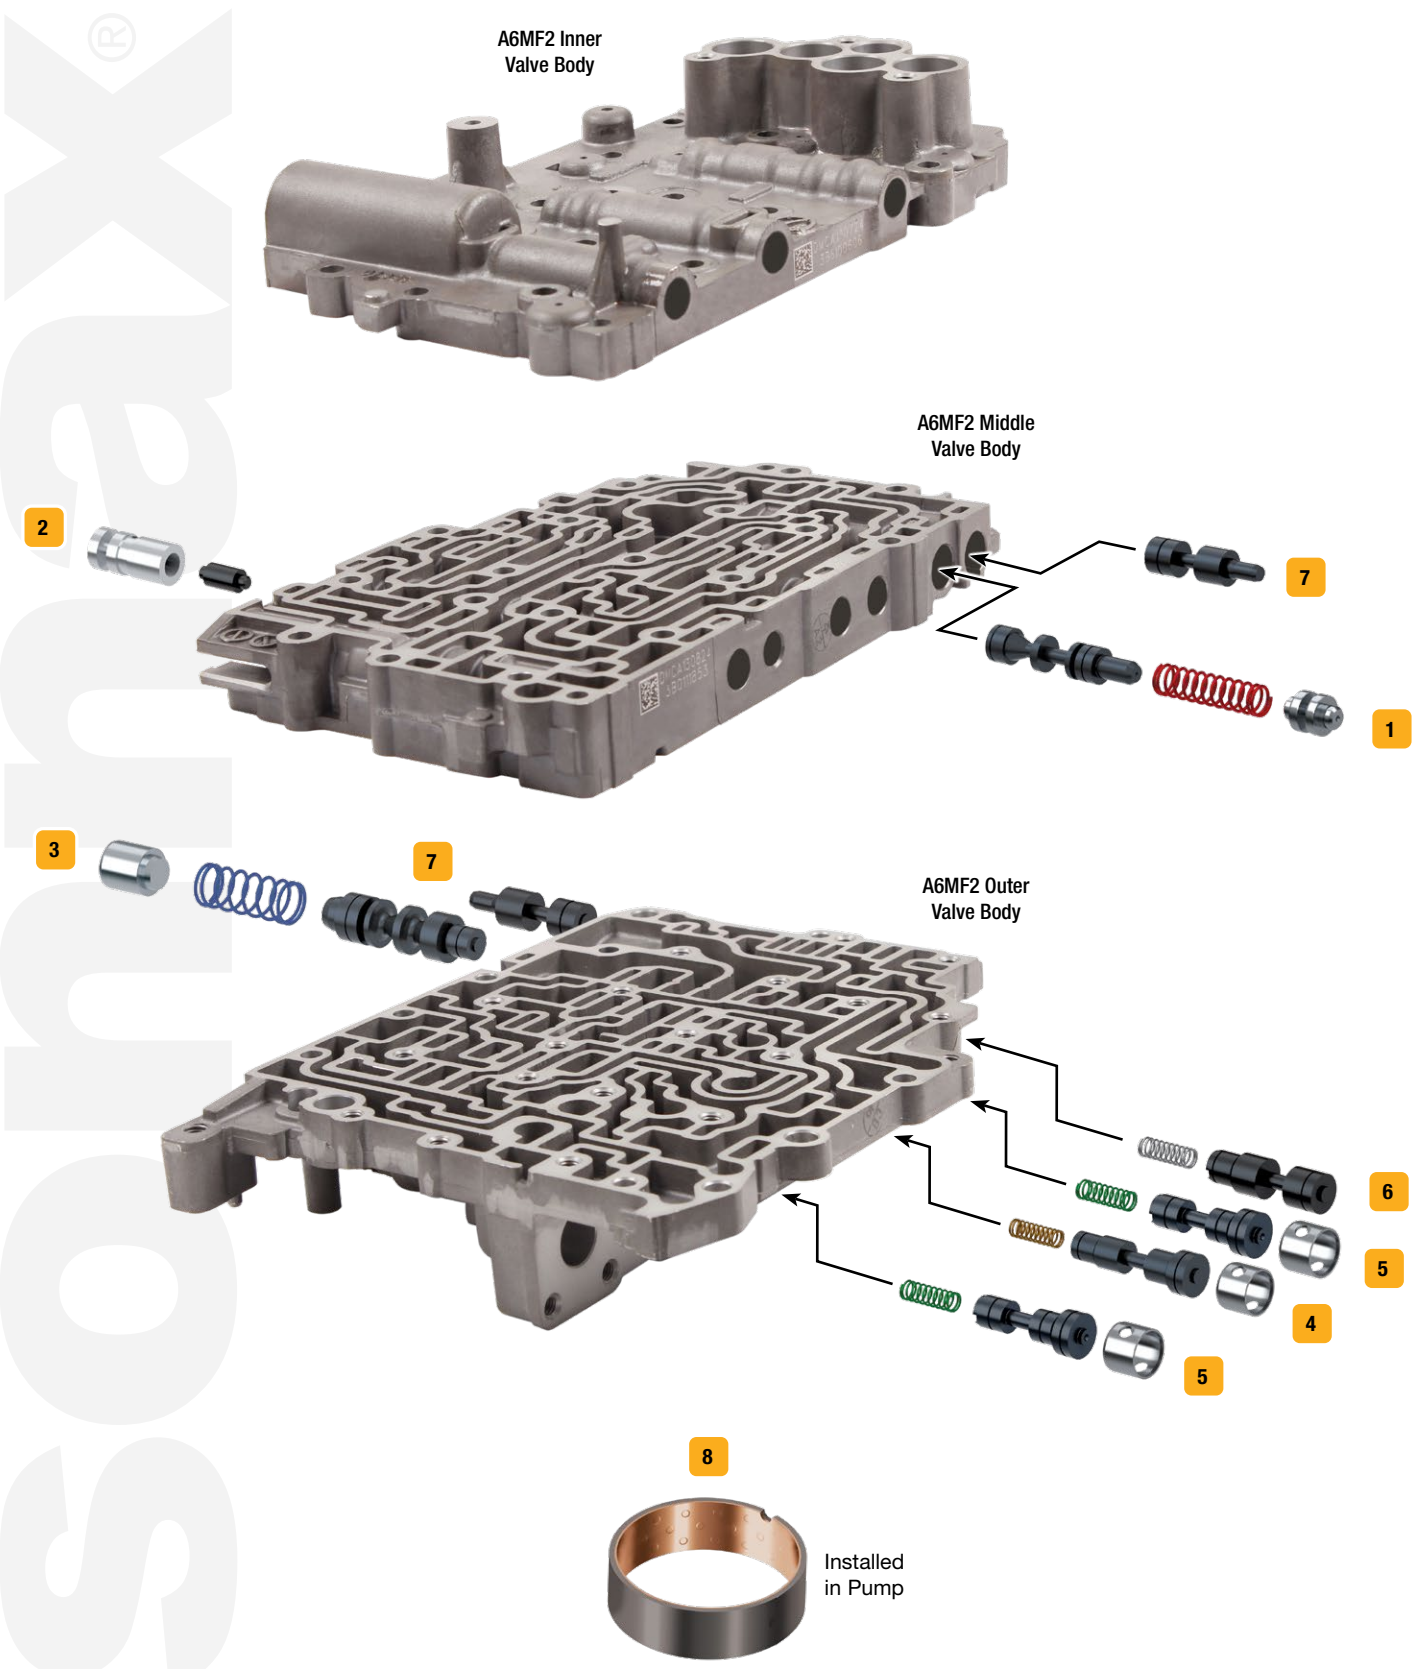

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>TCC/Lockup Symptoms</b>					
TCC codes, Shudder, TCC apply & release concerns, Excess TCC slip, Overheating	Oversized TCC Control Valve Kit	1 102741-11K			F-102741-TL11*‡
TCC codes, Converter shudder & failure, TCC slip, Low TCC apply pressure	TCC Pressure Control Plunger Valve Kit	2 102741-01K	ZIP		
<b>Pressure Problems</b>					
Poor shift quality, Soft & inconsistent shift feel, Burnt clutches, Overheating	Oversized Pressure Regulator Valve Kit	3 102741-08K			F-102741-TL8*‡
<b>Shift/Engagement Concerns</b>					
1-2 Flare, 5-6 Flare, Ratio codes, Erratic shift timing, 2nd Slip, 6th Slip, No 2nd, No 6th	Oversized 2-6 Pressure Control Valve Kit	4 102741-16K			F-102741-TL16*‡
Delayed engagement, Slips, flares & bind-ups, No Forward, No Reverse, Erratic shift timing	Oversized 3/5/Reverse & Underdrive Pressure Control Valve Kit	5 102741-13K		Fits either of two locations	F-102741-TL13*‡
3-4 Flare, 4-5-6 Slip, Gear ratio codes, Pressure control out-of-range codes	Oversized Overdrive Pressure Control Valve Kit	6 102741-18K			F-102741-TL18*‡
Solenoid performance codes, Wrong gear starts, Harsh shifts, Soft shifts, Burnt clutches	Oversized Pressure Reducing Valve	7 102741-07		Fits either of two locations	F-102741-TL7*‡
<b>Component Damage/Failure</b>					
Pump bushing & mating impeller hub wear prematurely	Pump Bushing	8 102034-01		A6MF1/2 only, precision, steel-backed	

\* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.