


ZF6HP19/26/32 (Gen. 1) without 053 Separator Plate

These parts fit both M-shift and E-shift valve bodies as well as Ford 6R60, 6R75 and 6R80.

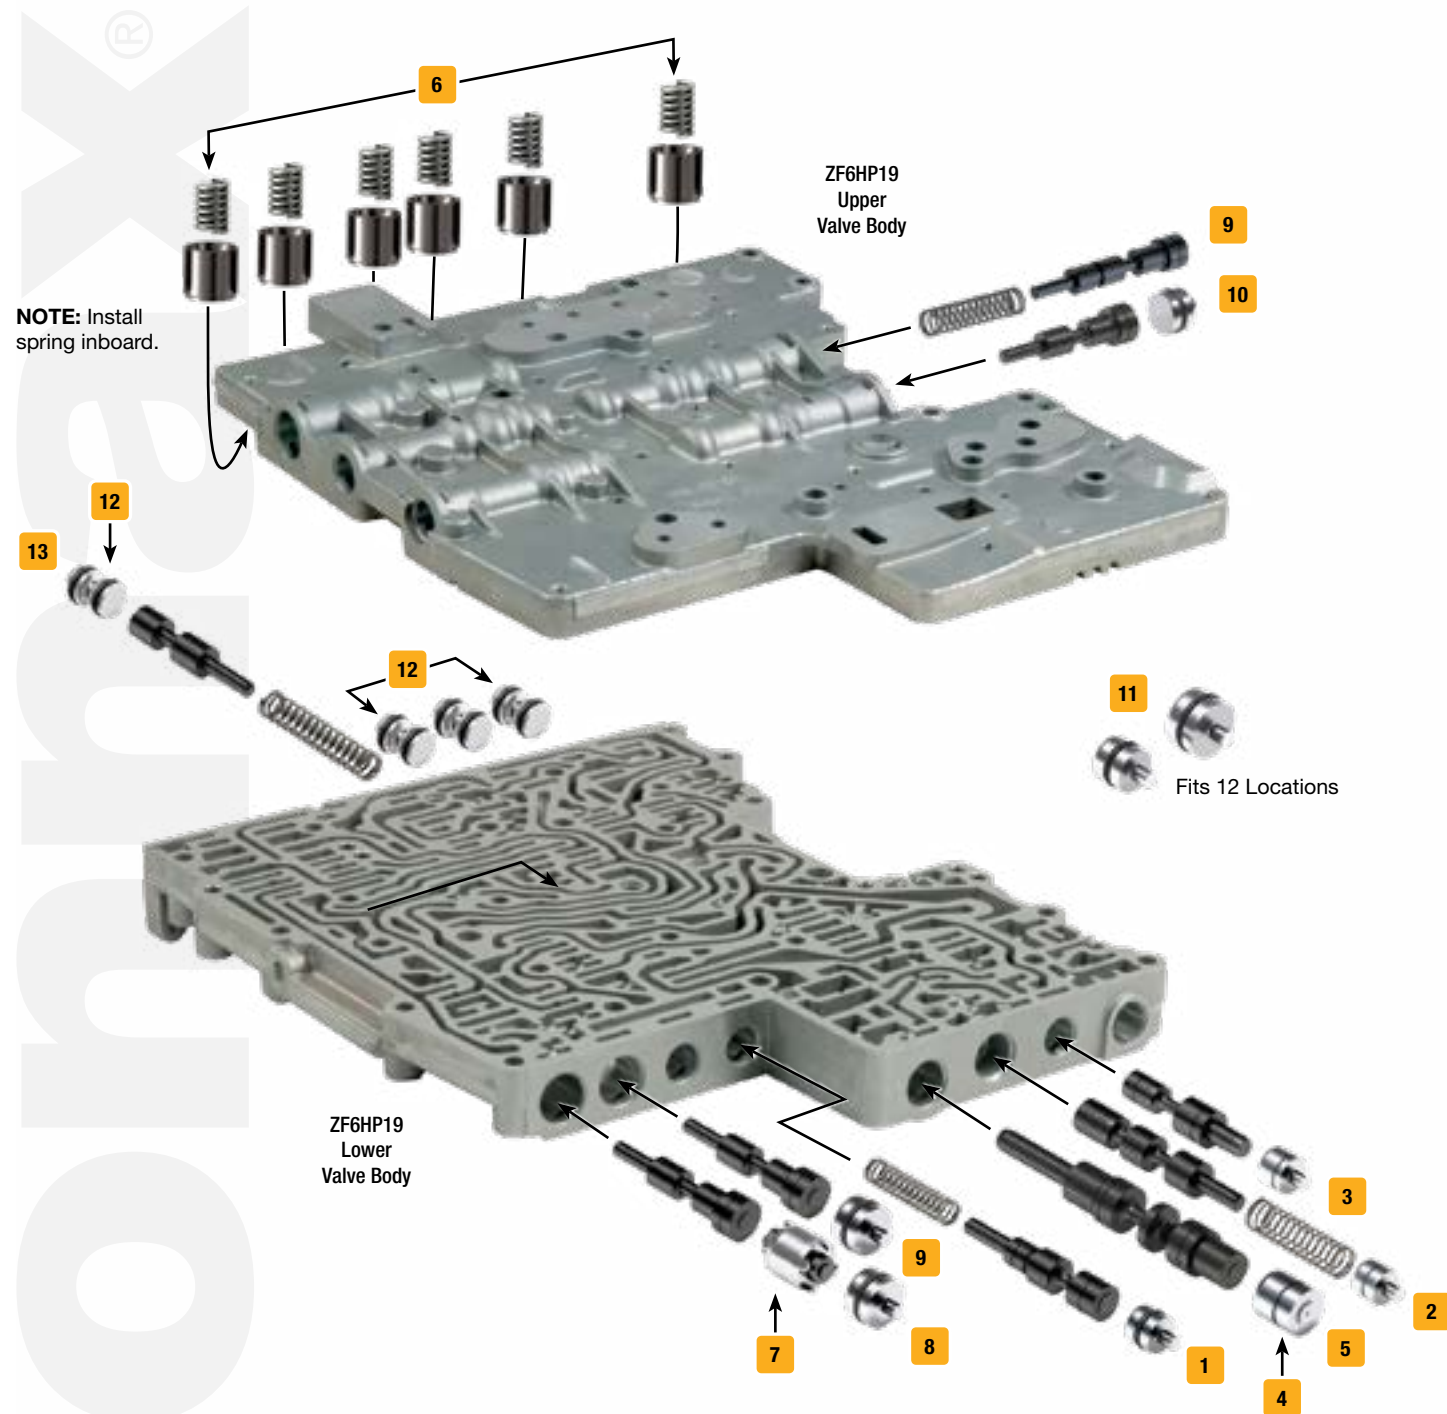

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	ZF6-6R60-ZIP		
TCC/Lockup Symptoms				
TCC codes, Excess TCC slip, Cycling RPM, Low TCC release pressure, Flare shifts, Harsh shifts	Oversized Bypass Clutch Control Valve Kit	1 95740-13K		F-95740-TL13*
Excess TCC slip RPM & related codes, Harsh TCC apply & release, Low TCC release pressure	Oversized Converter Release Regulator Valve Kit	2 95740-05K		F-95740-TL5*
Planetary failure, Bushing failure, Lube failures, Overheating, Low converter pressure	Oversized Lubrication Control Valve Kit	3 95740-11K		F-95740-TL11*
Pressure Problems				
Broken parts due to excessive line pressure, High line pressure, Erratic line pressure	Pressure Regulator Sleeve	4 95740-03	Replaces OE sleeve with .629" outer dia. & .645" length	
Poor shift quality, Flare shifts, Harsh shifts, Erratic line pressure, Delayed Reverse	Oversized Pressure Regulator Valve Kit	5 95740-01K	Replaces OE sleeve with .629" outer dia. & .645" length	F-95740-TL*
Shift/Engagement Concerns				
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	6 95740-15K	Includes 7 pistons & springs	
5-4 Flare, 5-4 Neutral, No 4-5, VFS 1/A solenoid control code, Delayed Forward, Harsh Forward	Clutch A Control Boost Valve Kit	7 95740-21K		
Downshift bind-ups, Flare shifts, Excess clutch overlap & clutch distress	Oversized Clutch A Control Valve Kit	8 95740-09K		F-95740-TL8*
6th Slip, 2nd Slip, Clutch failure, Poor shift quality, Ratio errors	Oversized Clutch C Regulator Valve	9 95740-40K		F-95740-TL40*
Excess clutch overlap & clutch distress, Pressure control out-of-range codes, 3-2 Harsh	Oversized Clutch D1/E Control Valve Kit	10 95740-08K	Fits either of 2 locations	F-95740-TL8*
Inconsistent shift quality	O-Ringed End Plug Kit	11 95740-19K	Includes 6 large & 6 small end plugs	
	O-Ringed Internal End Plug Kit	12 95740-25K	Includes 4 end plugs	
Flare shifts, Neutral shifts, Harsh upshifts, Harsh downshifts, Gear ratio codes, TCC slip	Oversized Solenoid Pressure Regulator Valve Kit	13 95740-17K		F-95740-TL17*
Tools				
	Solenoid Test Manifold Kit	95430-VTK		VACTEST-01K
	Vacuum Test Plate Kit	95740-VTP1		VACTEST-01K

* VB-FIX Required