


Jatco/Nissan RE5R05A

These parts also fit Infinity RE5R05A and Kia A5SR1 and A5SR2.

sonnax®

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

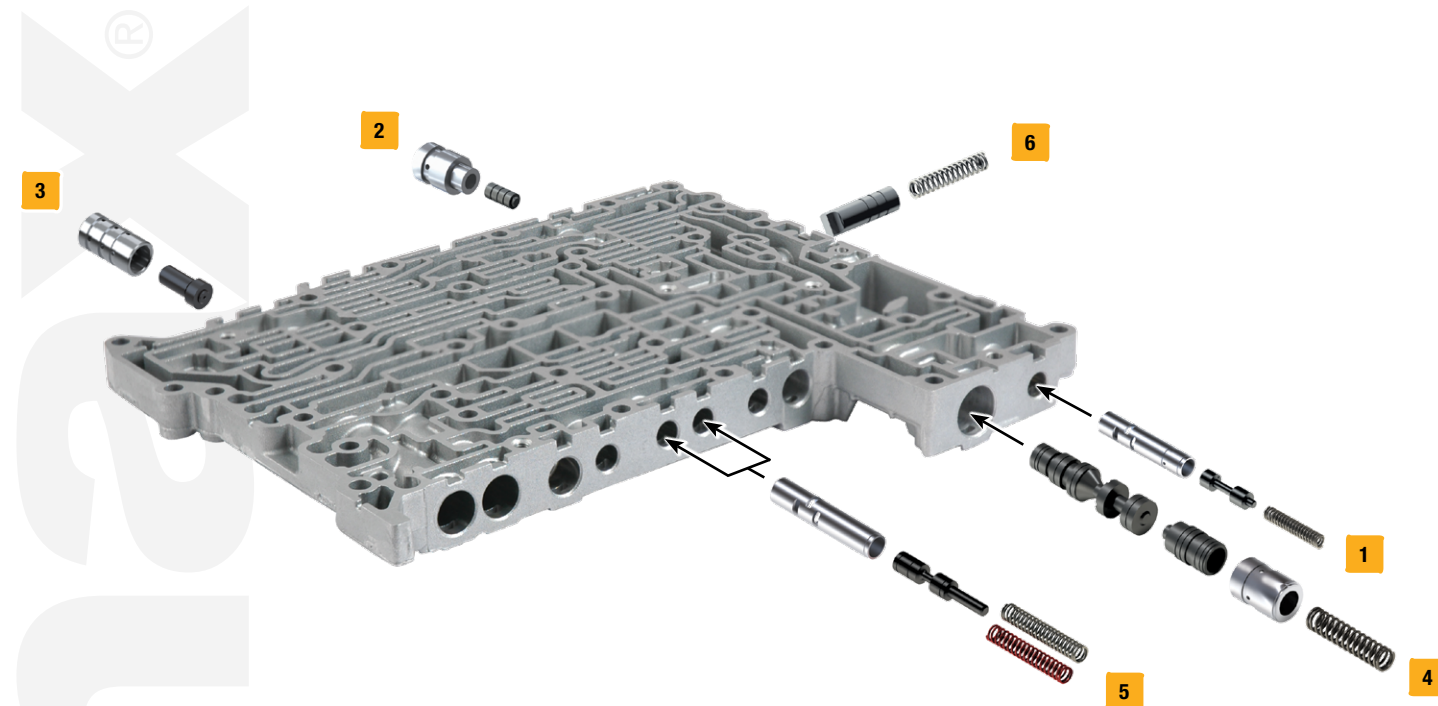

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
TCC codes & concerns, Damaged TCC linings, Lube failures	TC Regulator Valve Kit	1 63741-17K		F-63741-TL13*
Lockup shudder, TCC cycling, TCC codes, Burnt converter, Harsh downshifts, Harsh engagement	TCC Control Valve Kit/Low Brake Switch Boost Valve Kit	2 63741-05K	ZIP 1st & 2nd Design only	
Lockup shudder, TCC cycling, TCC codes, Burnt converter, Overheating, Poor fuel economy	TCC Control Plunger Valve Kit	2 63741-25K	ZIP 3rd & 4th Design only	
Pressure Problems				
Low solenoid feed pressure, Delayed engagement	Reverse Brake Pressure Control Valve Kit	3 63741-27K	ZIP '04-'08	
	Reverse Brake Pressure Control Valve Kit	3 63741-29K	ZIP '09-Later	
Delayed Forward, Harsh Reverse, Erratic line pressure, 2-3 Harsh, Low converter & lube flow	Oversized Pressure Regulator & Boost Valve Kit	4 63741-01K		F-63741-TL*
Shift/Engagement Concerns				
Delayed engagement, Erratic shifts, Flare upshifts & clutch distress, Delayed Forward	"A" or "B" Pilot Valve Kit	5 63741-13K	Fits either of 2 locations	F-63741-TL13*
Component Damage/Failure				
Overheated fluid, Damaged parts & planetaries, Overheated converter, Premature lockup	Oversized Cooler Bypass Valve Kit	6 63741-07K	Not used in all RE5R05A models	F-63741-TL7*

* VB-FIX Required