


# Jatco/Nissan JF011E (RE0F10A)

These parts also fit Mitsubishi F1CJA.

# sonnax®

Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

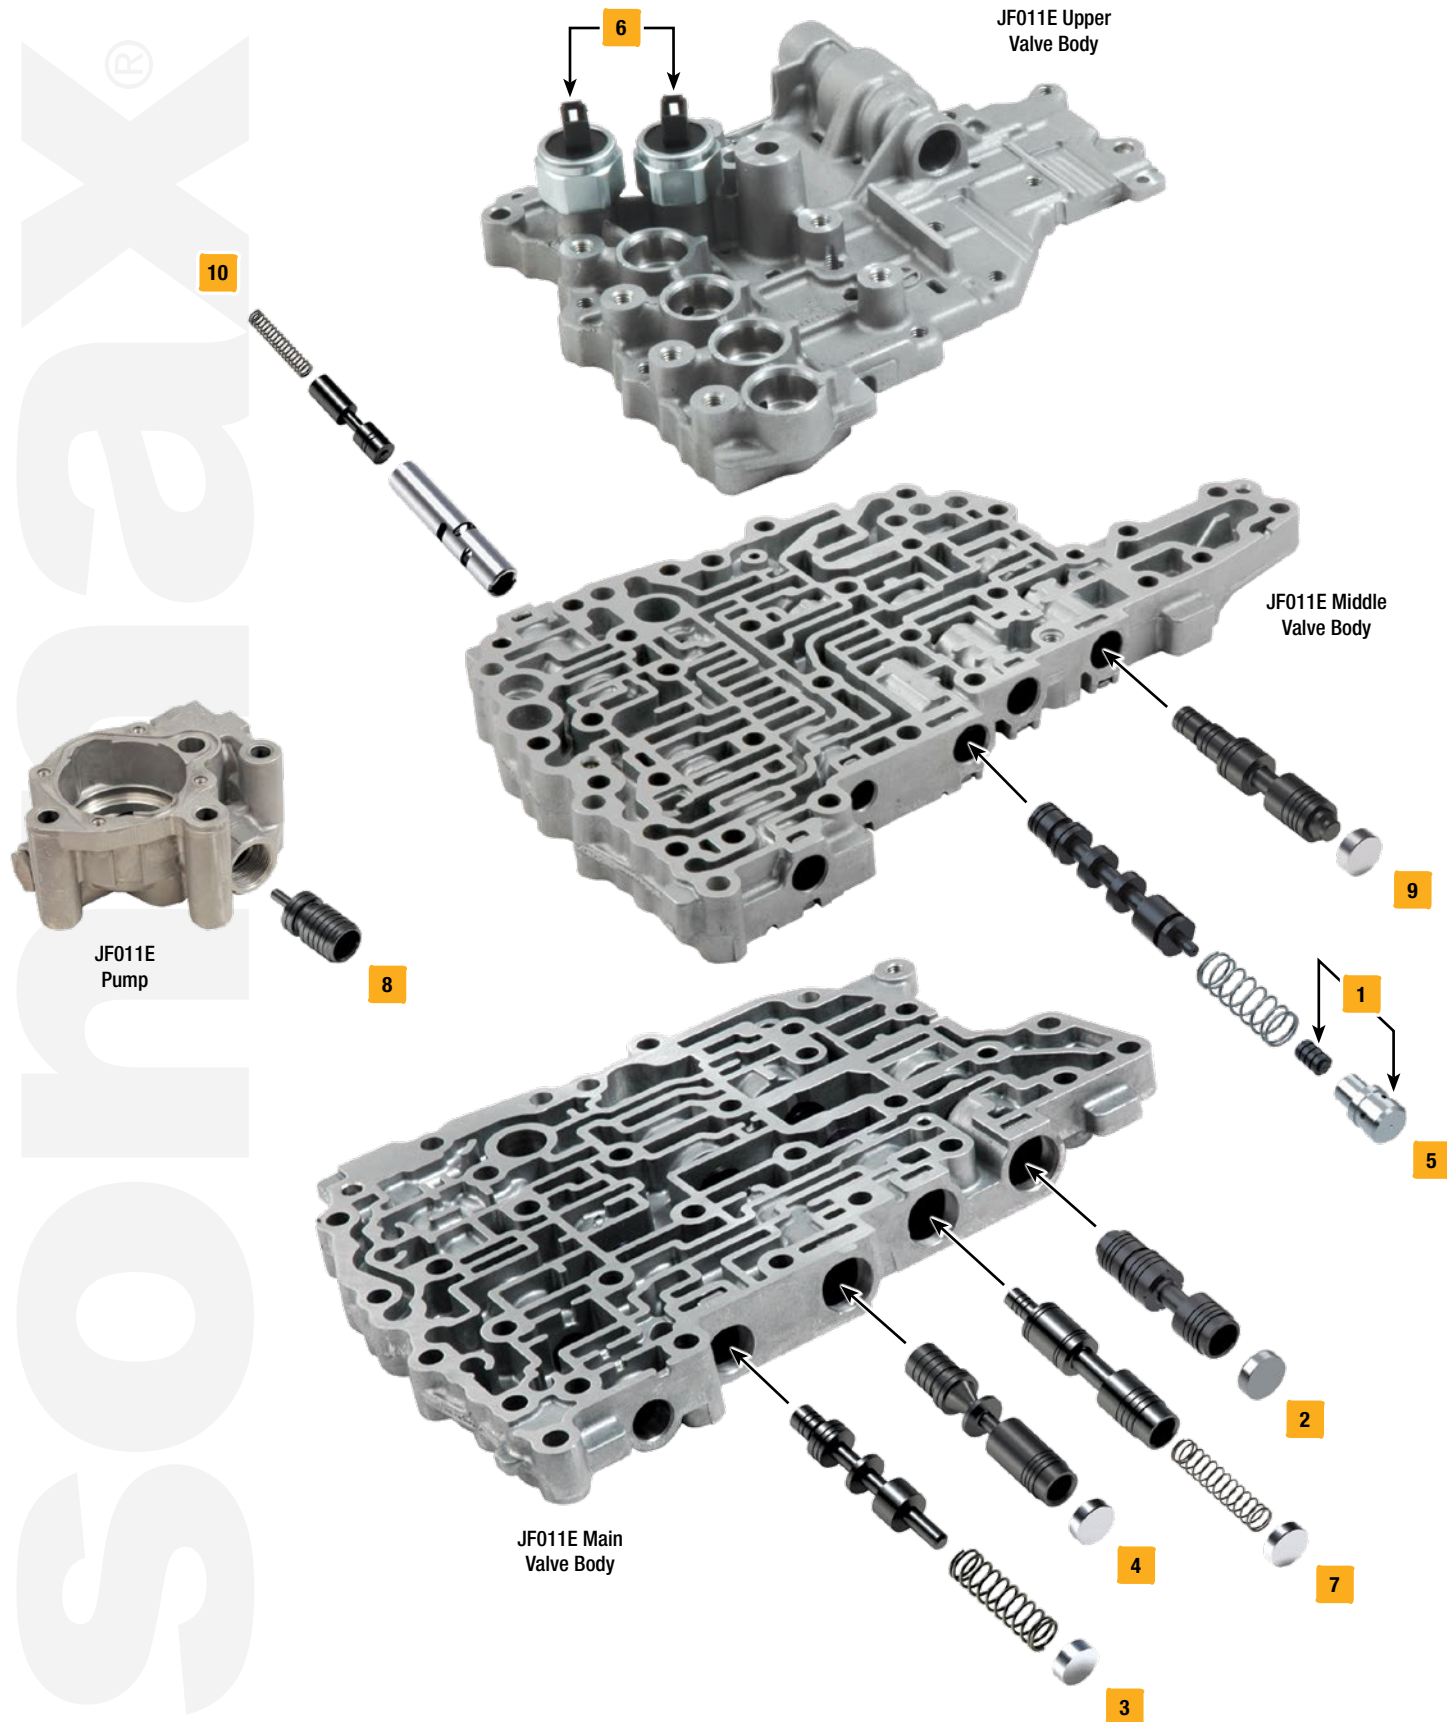

| Symptoms/Part Type   | Product Name  | Part No.      | Details                    | ZIP Drop-In Zip Valve™ Parts | Tooling        |
|--|---|---------------|----------------------------|------------------------------|----------------|
| <b>TCC/Lockup Symptoms</b>   |   |               |                            |                              |                |
| Jerking on coastdown, High engine RPM, Engine stall on engagement, No lockup             | Lockup Control Plunger Valve Kit                        | 1 113741-11K  | ZIP                        |                              |                |
| Push belt slippage & pulley fracture, Chatter on acceleration, RPM surge on acceleration | Oversized Secondary Pressure Regulator Valve Kit        | 2 113741-21K  |                            |                              | F-113741-TL21* |
| Engine stall on engagement, No lockup, Increased RPM during acceleration, Ratio codes    | Oversized TCC Limit & Lube Valve Kit                    | 3 113741-04K  |                            |                              | F-113741-TL4*  |
| Converter shudder & TCC slip, TCC apply & release concerns, TCC codes, Overheating       | Oversized Torque Converter Pressure Regulator Valve Kit | 4 113741-13K  |                            |                              | F-113741-TL13* |
| <b>Shift/Engagement Concerns</b>   |   |               |                            |                              |                |
| Jerking on coastdown, Harsh engagement, High engine RPM, No lockup                       | Oversized Lockup Control Valve Kit                      | 5 113741-22K  |                            |                              | F-113741-TL22* |
| Shift concerns   | Primary & Secondary Pressure Sensor                     | 6 33417N      | Fits either of 2 locations |                              |                |
| Chatter on acceleration, Damaged valve body casting, Slips in Forward & Reverse          | Oversized Primary Pressure Regulator Valve Kit          | 7 113741-09K  |                            |                              | F-113741-TL9*  |
| Push belt slippage, Delayed engagement, Low pump volume                                  | Pump Flow Control Valve                                 | 8 33510N-02   | ZIP '07-Later              |                              |                |
|  | Oversized Pump Flow Control Valve                       | 8 33510N-01   | '07-Later                  |                              | F-33510N-TL*   |
| RPM surge or chatter on acceleration, Push belt slippage & pulley fracture               | Oversized Secondary Pulley Control Valve Kit            | 9 113741-19K  |                            |                              | F-113741-TL17* |
| Chatter on acceleration, No ratio change, Noise on acceleration, Push belt slippage      | Solenoid Regulator Valve Kit                            | 10 113741-01K | ZIP                        |                              |                |

\* VB-FIX Required