


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

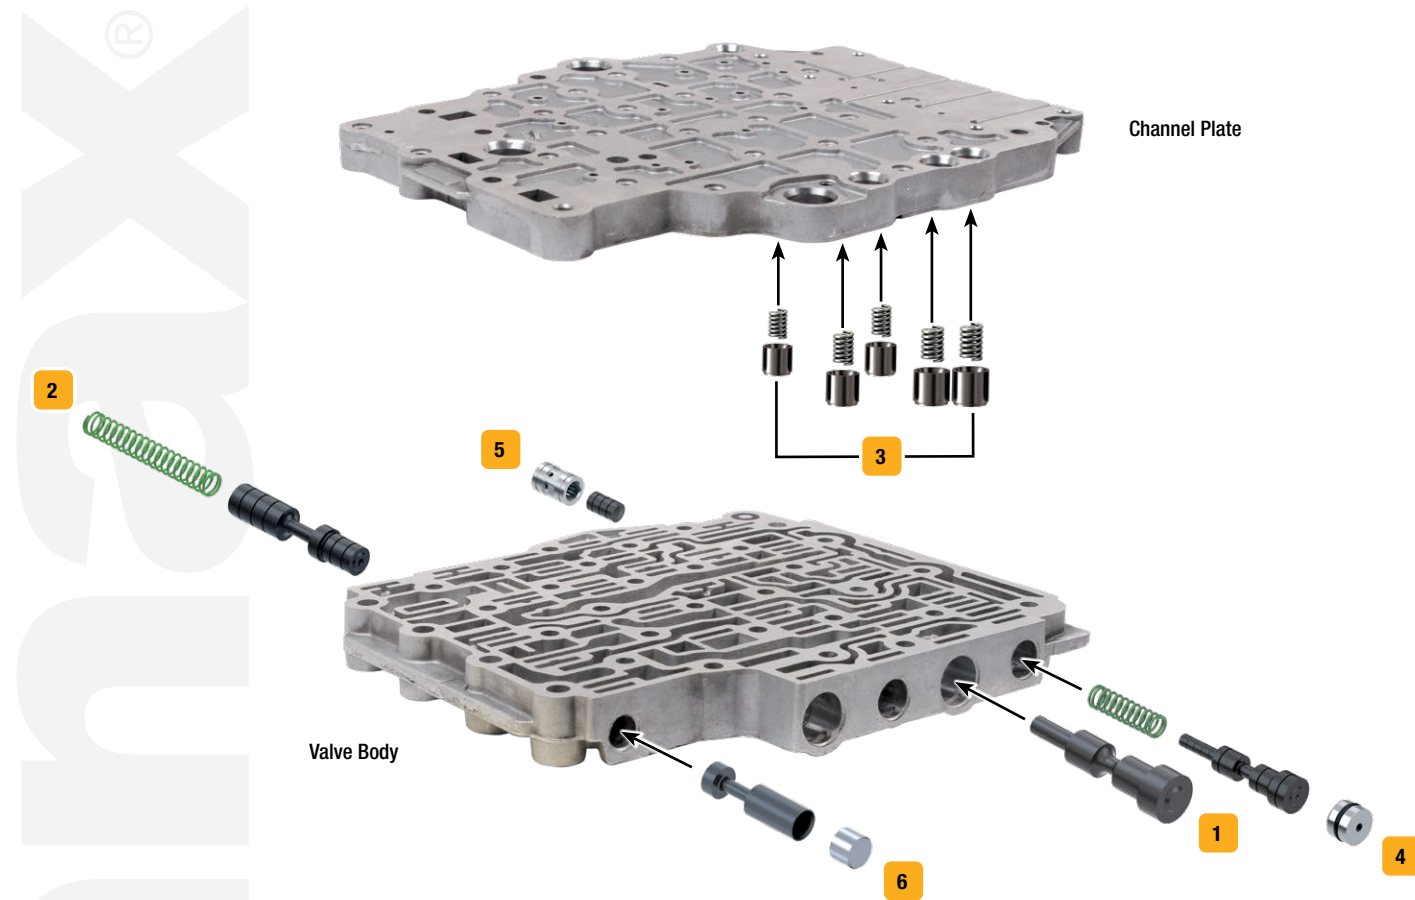

Symptoms/Benefits	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>TCC/Lockup Symptoms</b>					
TCC codes, Converter shudder & TCC slip, TCC apply concerns, Overheated fluid & TCC lining	Oversized TCC Apply Valve	1 33740-06			F-33740-TL6*
Converter shudder & TCC slip, TCC codes, No lockup, Overheated fluid & TCC lining	Oversized TCC Regulator Valve Kit	2 33740-03K			F-33740-TL3*‡
<b>Shift/Engagement Concerns</b>					
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	3 95740-15K	ZIP Includes 7 pistons & springs		
Code P0811, Delayed engagement, Forward slip, Reverse slip, Burnt Forward clutch, Overheating	Oversized Forward & Reverse Engagement Latch Valve Kit	4 33740-07K			F-33740-TL7*
No ratio change, Ratio codes, Ratio errors, No high ratios, Poor fuel economy	Primary Pulley Boost Valve Kit	5 33740-01K	ZIP		
<b>Component Damage/Failure</b>					
Bearing failure, Overheated fluid, Planetary failure, Poor lube oil control	Oversized Lube Regulator Valve Kit	6 33740-04K			F-33740-TL4*

\* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.