


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

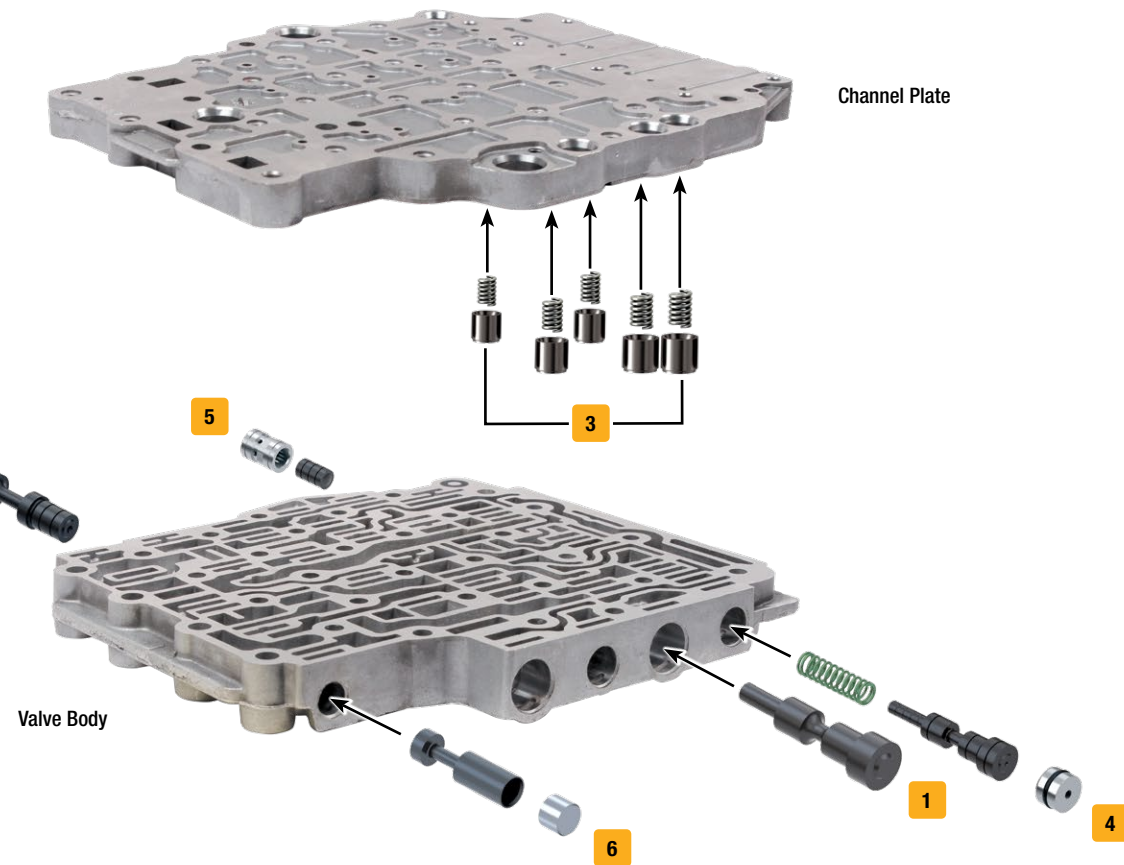

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
TCC codes, Converter shudder & TCC slip, TCC apply concerns, Overheated fluid & TCC lining	Oversized TCC Apply Valve	1 33740-06		F-33740-TL6*
Converter shudder & TCC slip, TCC codes, No lockup, Overheated fluid & TCC lining	Oversized TCC Regulator Valve Kit	2 33740-03K		F-33740-TL3*
Shift/Engagement Concerns				
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	3 95740-15K	Includes 7 pistons & springs	
Code P0811, Delayed engagement, Forward slip, Reverse slip, Burnt Forward clutch, Overheating	Oversized Forward & Reverse Engagement Latch Valve Kit	4 33740-07K		F-33740-TL7*
No ratio change, Ratio codes, Ratio errors, No high ratios, Poor fuel economy	Primary Pulley Boost Valve Kit	5 33740-01K		
Component Damage/Failure				
Bearing failure, Overheated fluid, Planetary failure, Poor lube oil control	Oversized Lube Regulator Valve Kit	6 33740-04K		F-33740-TL4*

*VB-FIX Required