


Mitsubishi F4A, F5A

These parts fit '96-later Mitsubishi F4A41/42/51, F5A51 as well as Hyundai/Kia A5HF1 and A5GF1. Several parts also fit R4/V4A51, R5/V5A51. Verify applications at www.sonnax.com.

sonnax®

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

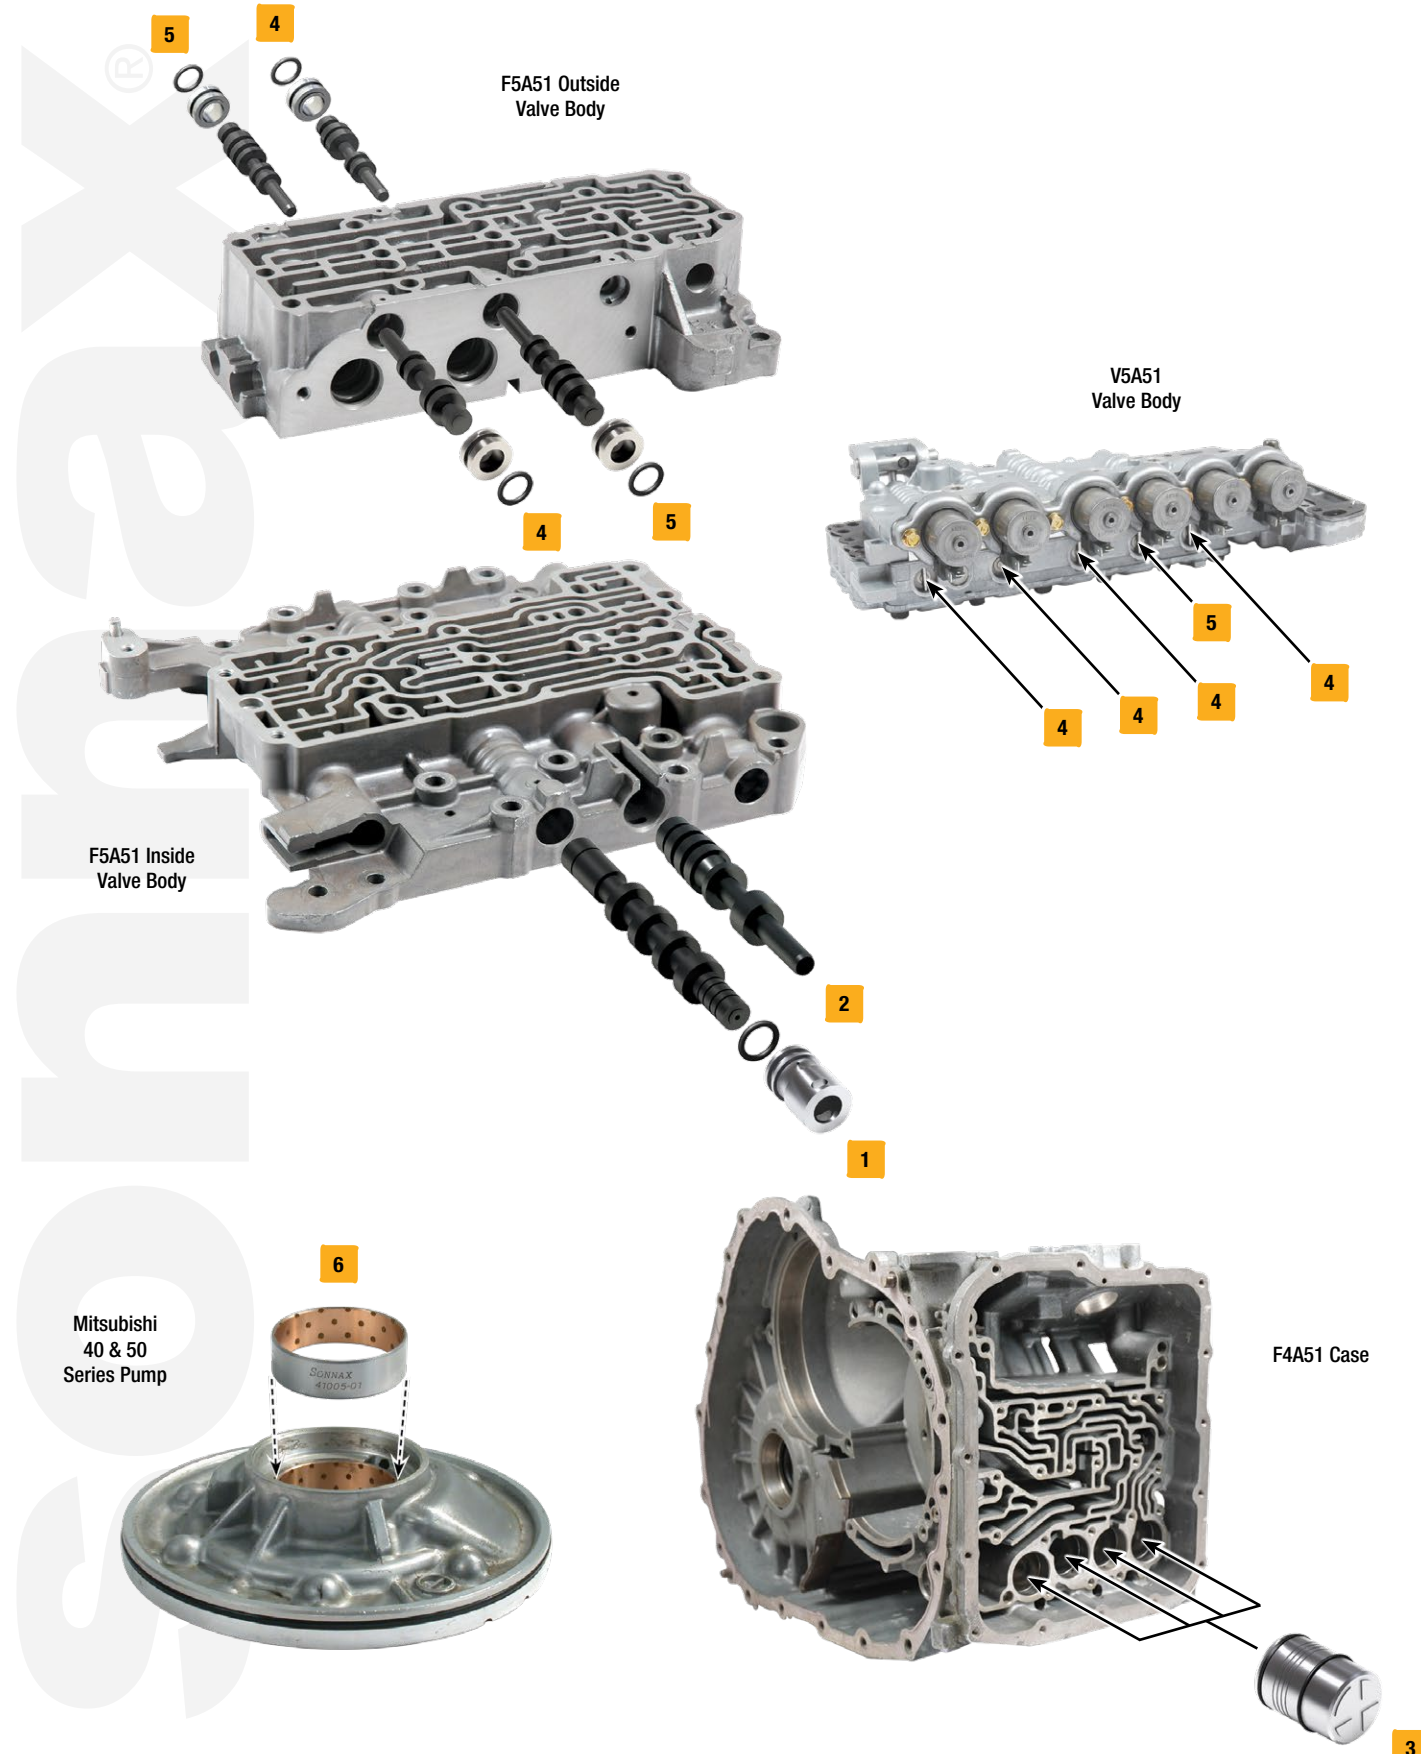

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
Excess TCC slip, TCC apply & release concerns, TCC cycling, High TCC release pressure	TCC Control Valve Kit	1 41954-03K	ZIP Replaces OE valves with .405", .531" & .344" spool dia.	
Pressure Problems				
Flare shifts, Soft shifts, Harsh shifts, Low line pressure, High line pressure	Oversized Pressure Regulator Valve	2 41954-01K	FWD only, replaces OE valves with .540", .616" & .645" spool dia.	F-41954-TL*‡
Shift/Engagement Concerns				
Worn accumulator bores, Soft shifts, Harsh shifts, Delayed engagement, Shudder on engagement	Accumulator Piston Kit	3 41954-02K	Fits any of 4 locations, dual-seal design	
Burnt clutches, Flare shifts, Shuttle shifts, Cycling RPM during shift, Delayed engagement	Pressure Control Valve Kit	4 41954-06K	ZIP No orifice, replaces OE valves with .382", .472" & .354" spool dia., fits either of 2 locations	
	Pressure Control Valve Kit	5 41954-07K	ZIP With orifice, replaces OE valves with .382", .472" & .354" spool dia., fits either of 2 locations	
Component Damage/Failure				
Bushing wear, Bushing failure	Pump Bushing	6 41005-01	Mitsubishi 40 & 50 series only, precision	41005-TL

* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.