


# Ford 6F35 (Gen. 1 & 2)



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

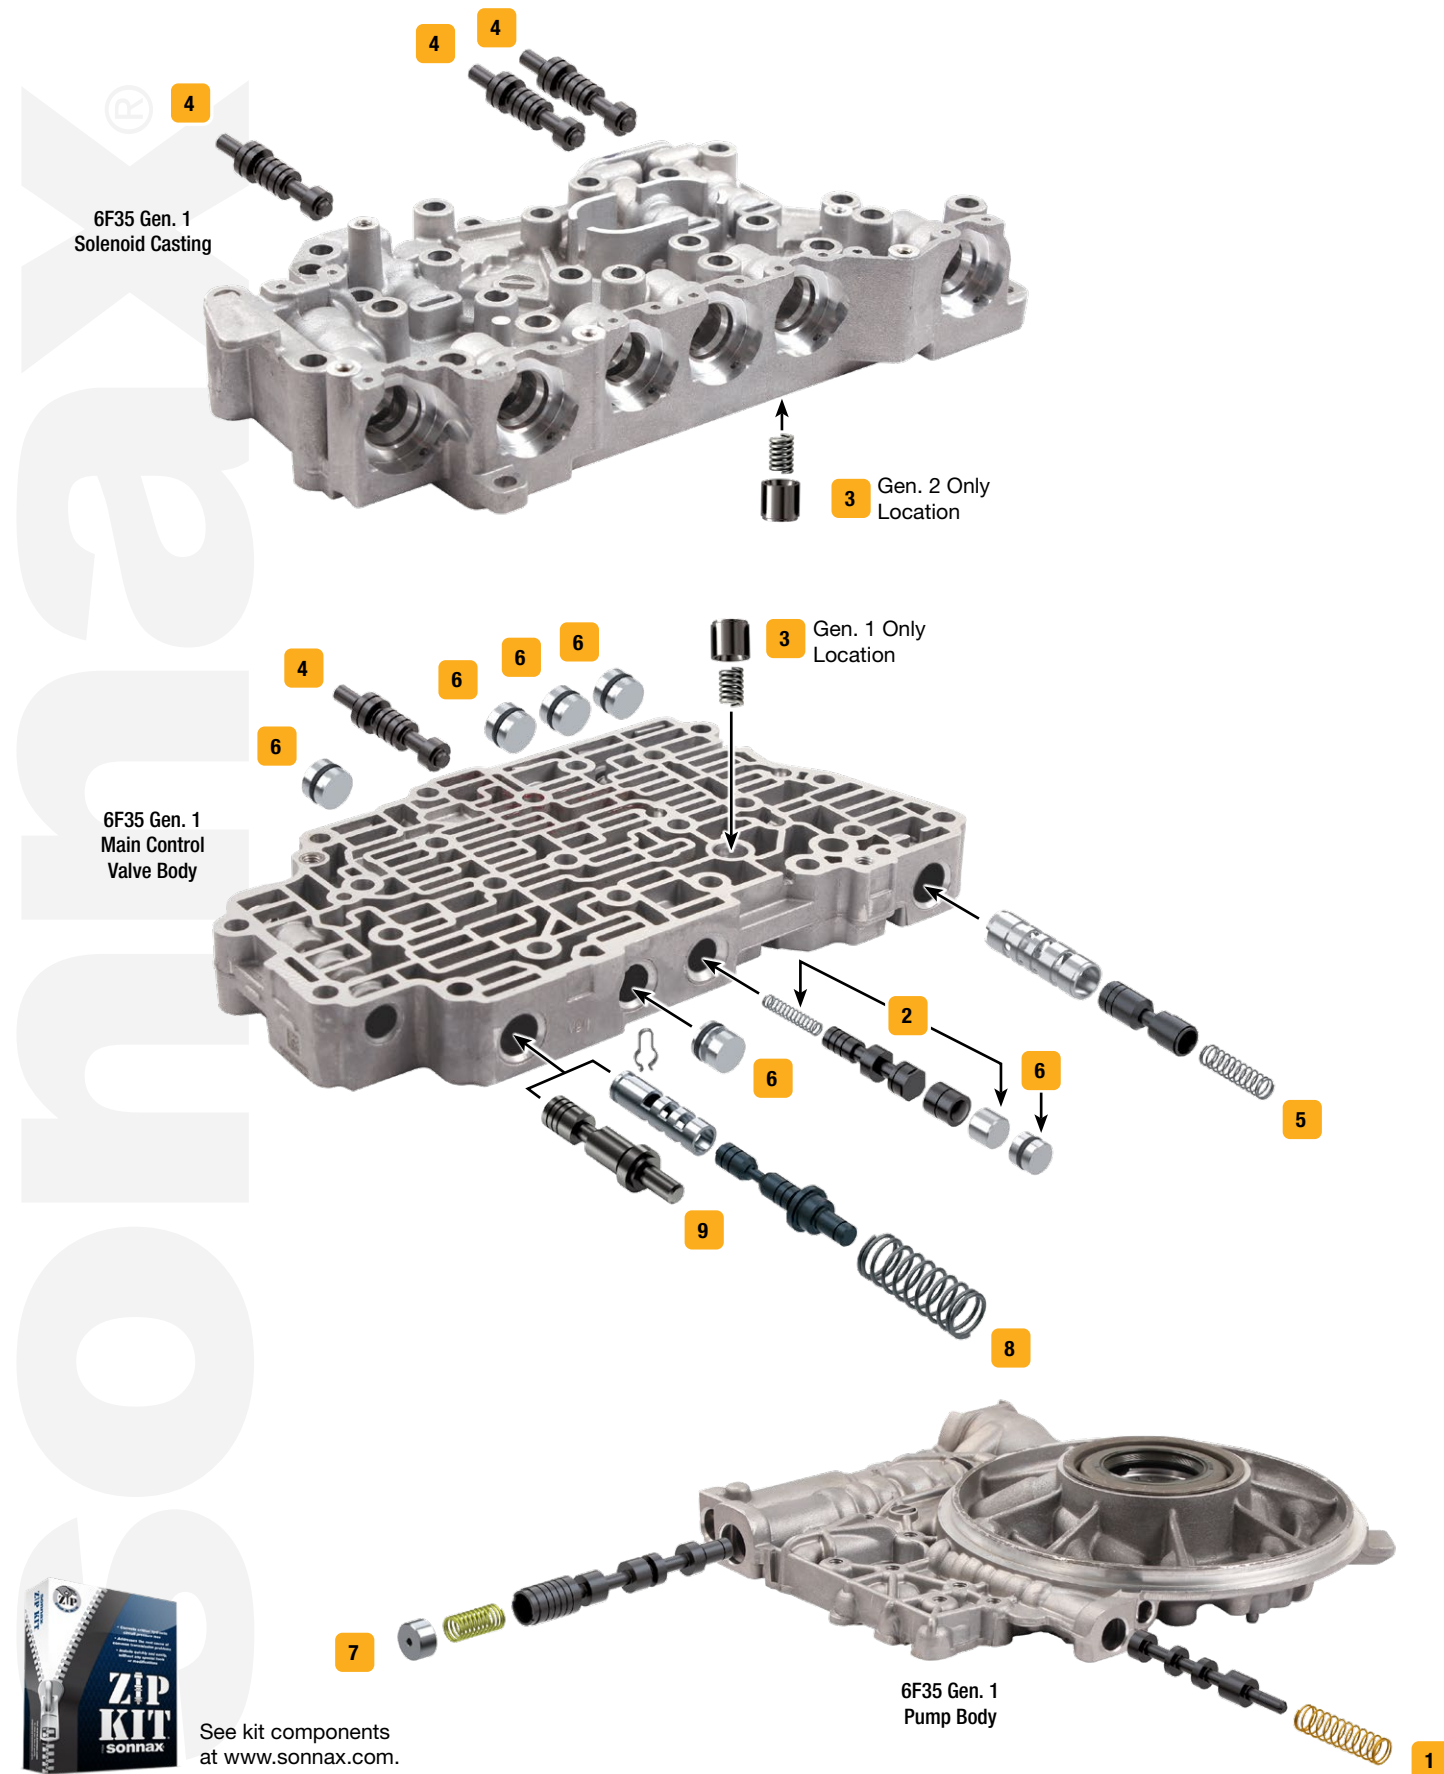

See kit components at [www.sonnax.com](http://www.sonnax.com).

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>Multiple Symptoms</b>					
The first step in correcting common shift problems	Zip Kit®	6F35-ZIP	ZIP		
<b>TCC/Lockup Symptoms</b>					
Excess TCC slip, TCC codes, Shudder, TCC apply & release concerns, Low cooler flow	Oversized TCC Control Valve Kit	1 144510-07K			F-144510-TL7C*
Code P0741, P0742, No lockup, TCC slip, Harsh TCC apply, Loss of fuel economy	TCC Regulator Valve Kit	2 144740-36K	ZIP		
Code P0741, Code 742, No lockup, TCC slip, Harsh TCC apply, Loss of fuel economy	Oversized TCC Regulator Valve Kit	2 144740-19K			F-144740-TL19*
<b>Shift/Engagement Concerns</b>					
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	3 95740-15K	ZIP	Includes 7 pistons & springs	
Slips & flares, Delayed engagement, Shift quality is not load sensitive, Harsh shifts	Oversized Clutch Latch Valve	4 144740-21		Fits any of 4 locations	F-144740-TL21*
Bump shifts, Flare shifts, Harsh shifts, Erratic shifts, Burnt clutches, Overheated fluid	Control Pressure Regulator Valve Kit	5 144740-04K	ZIP		
Shift concerns, Burnt clutches, Pressure loss, TCC apply concerns	O-Ringed End Plug Kit	6 144740-03K	ZIP	Includes 6 end plugs	
Poor shift quality, TCC apply & release concerns, Erratic line pressure, Burnt clutches	Oversized Pressure Regulator Valve Kit	7 144510-03K			F-144510-TL3C*
Harsh shifts, Flare shifts, No 4th, No 5th, No 6th, Low clutch oil pressure	Solenoid Pressure Regulator Valve Kit	8 144740-37K	ZIP		
	Oversized Solenoid Pressure Regulator Valve	9 144740A-01			144740-TL
<b>Tools</b>					
	Vacuum Test Plate Kit	144740-VTP			

\* VB-FIX Required