

ZF8HP55

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.



This Sonnax kit also is available, see www.sonnax.com for details.

Zip Kit®
ZF8-ZIP

1 35740-18K
Oversized TC Pressure Valve Kit




Helps cure:

- Coastdown clunk
- Harsh TCC apply
- Excess TCC slip

Note: Requires tool kit **F-35740-TL5** & the **VB-FIX** reaming fixture.

2 35740-05
Oversized TC Switch Valve

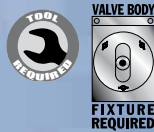

Helps cure:

- No lockup/TCC release
- Engine stall
- TCC codes

Note: Requires tool kit **F-35740-TL5** & the **VB-FIX** reaming fixture.

3 35740-13K
Oversized TCC Valve Kit



Helps cure:

- Converter shudder & TCC slip
- Damaged TCC linings
- TCC codes


Note: Requires tool kit **F-35740-TL13** & the **VB-FIX** reaming fixture.

4 35740-03
Pressure Regulator Sleeve

Helps cure:

- Harsh shifts
- Erratic/High line pressure
- Restricted converter/lub flow


5 35740-01K
Oversized Pressure Regulator Valve Kit

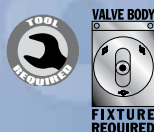

Helps cure:

- Harsh/Soft shifts
- Erratic line pressure
- High line pressure

Note: Requires tool kit **F-35740-TL** & the **VB-FIX** reaming fixture.

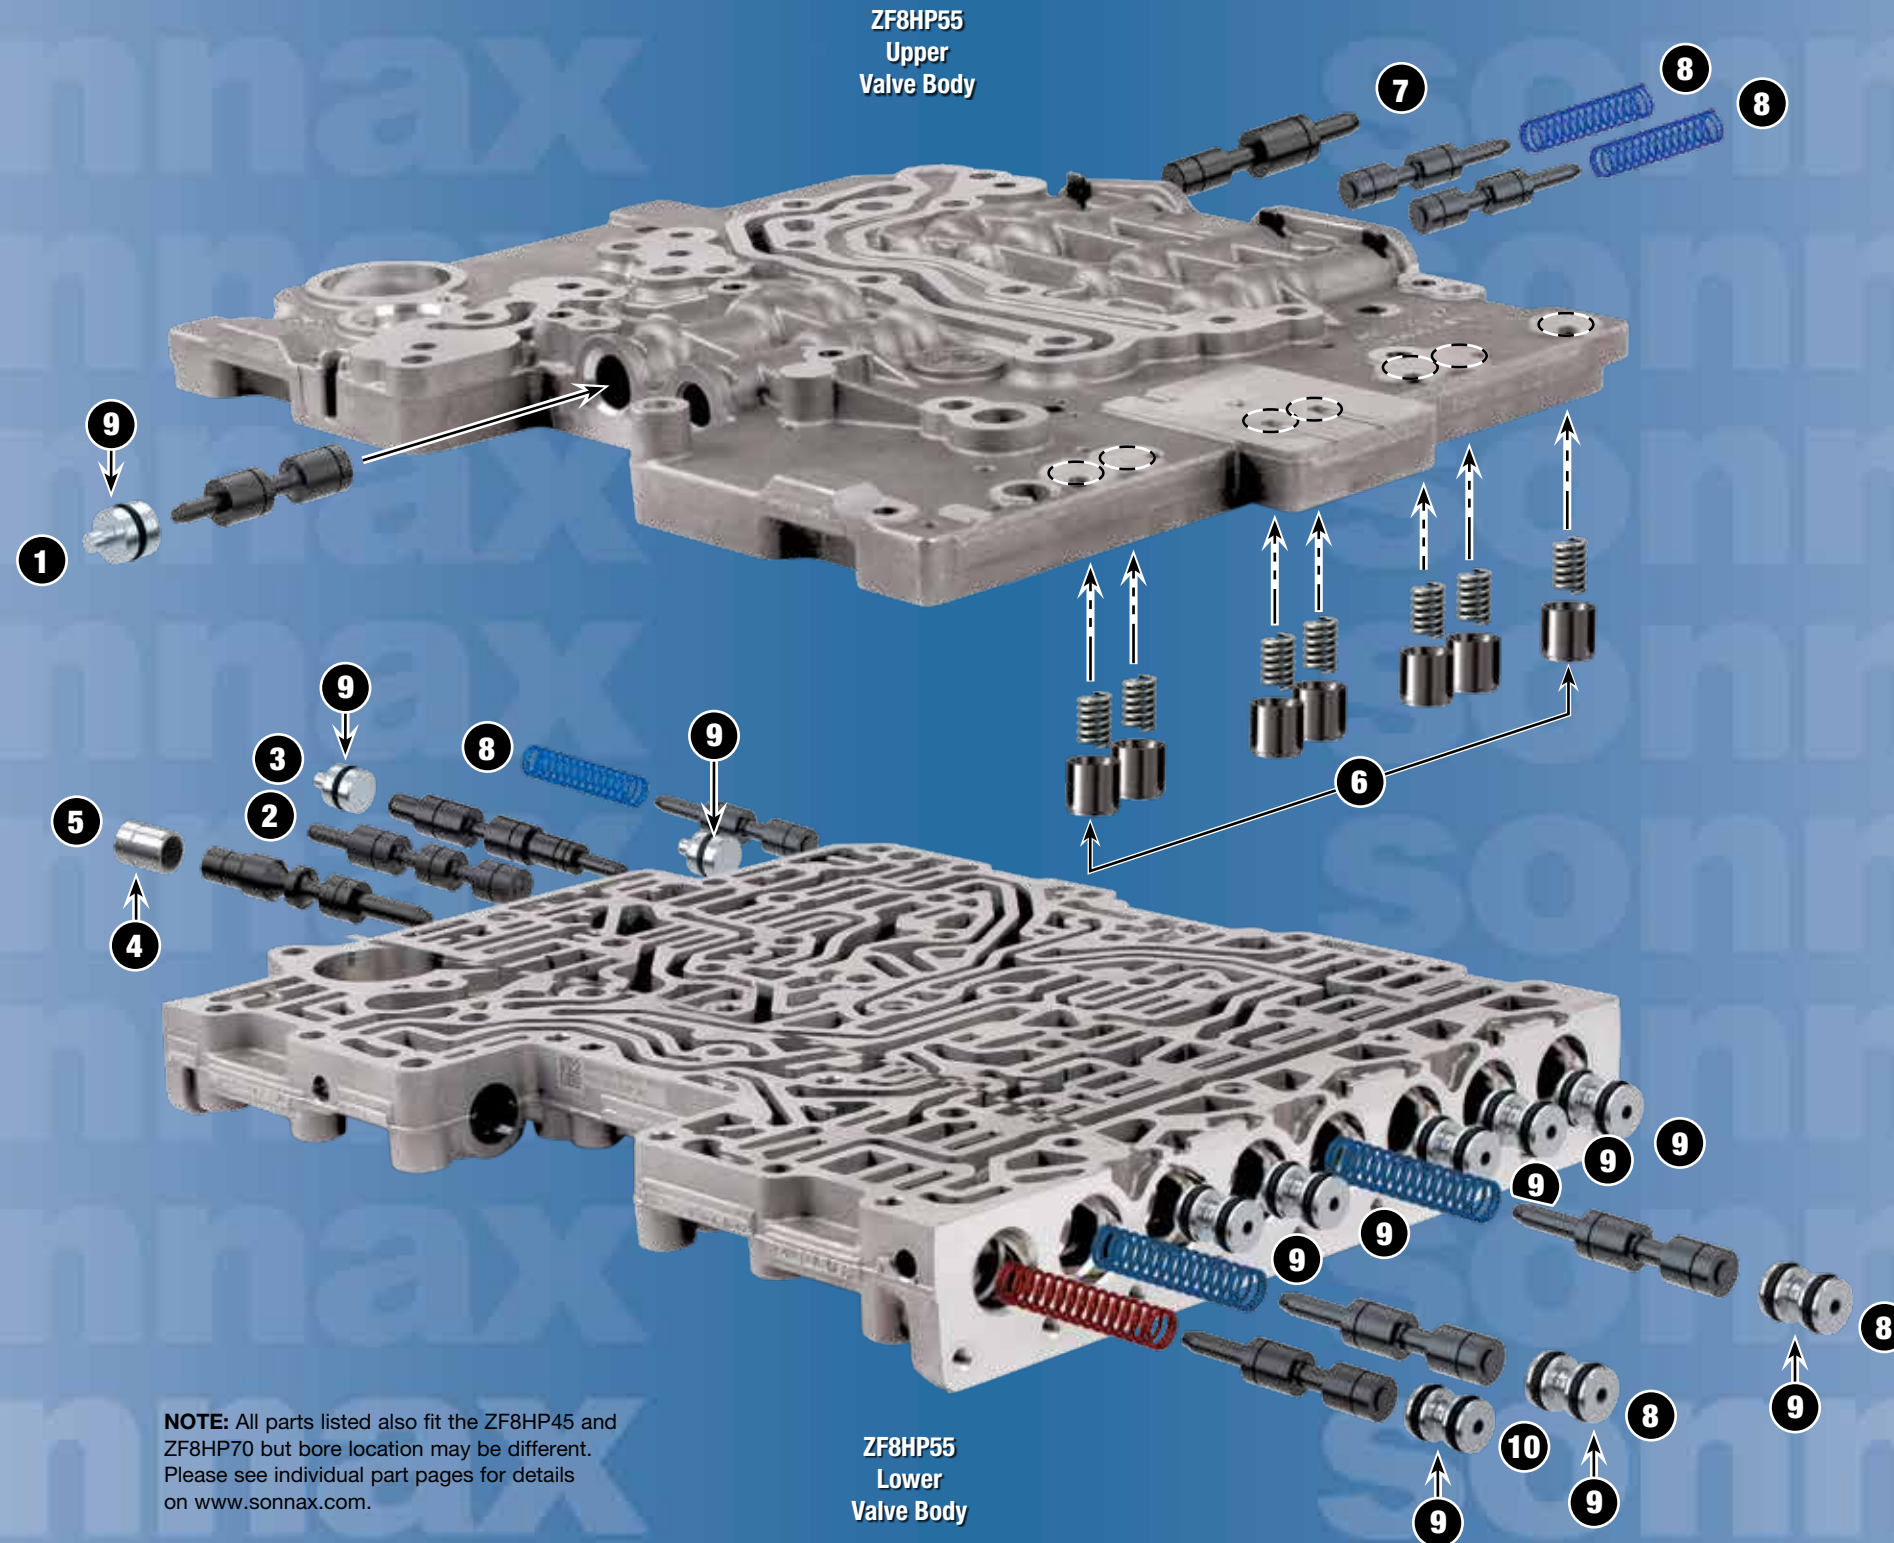

ZF8HP55
Upper
Valve Body

ZF8HP55
Lower
Valve Body

NOTE: All parts listed also fit the ZF8HP45 and ZF8HP70 but bore location may be different. Please see individual part pages for details on www.sonnax.com.


6 95740-15K
Accumulator Piston Kit

Includes 7 pistons & springs

Helps cure:

- Downshift clunk
- Firm shifts
- Erratic EDS solenoid control/EDS codes

7 35740-22
Oversized B2 Clutch NIC Valve

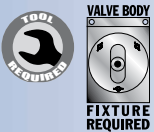


Helps cure:

- Delayed engagement
- No Forward/Reverse
- NIC concerns

Note: Requires tool kit **F-35740-TL22** & the **VB-FIX** reaming fixture.

8 35740-20K
Oversized Clutch Holding Valve Kit

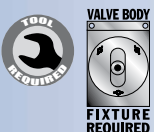

Fits 5 Locations

Helps cure:

- Bump/Flare shifts
- Burnt clutch
- Gear loss
- Gear ratio & solenoid codes

Note: Requires tool kit **F-35740-TL20** & the **VB-FIX** reaming fixture.

9 35740-30K Includes 3 End Plugs & 8 Internal End Plugs
O-Ringed End Plug Kit

Helps cure:

- Soft/Flare/Harsh shifts
- Burnt clutches
- Pressure loss

10 35740-21K
Oversized Priming Valve Kit



Helps cure:

- Delayed engagement
- Wrong gear starts
- Flare shifts
- Gear ratio & solenoid codes

Note: Requires tool kit **F-35740-TL20** & the **VB-FIX** reaming fixture.