


ZF6HP21/28/34 (Gen. 2)

These parts fit both M-shift and E-shift valve bodies unless otherwise noted.



Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

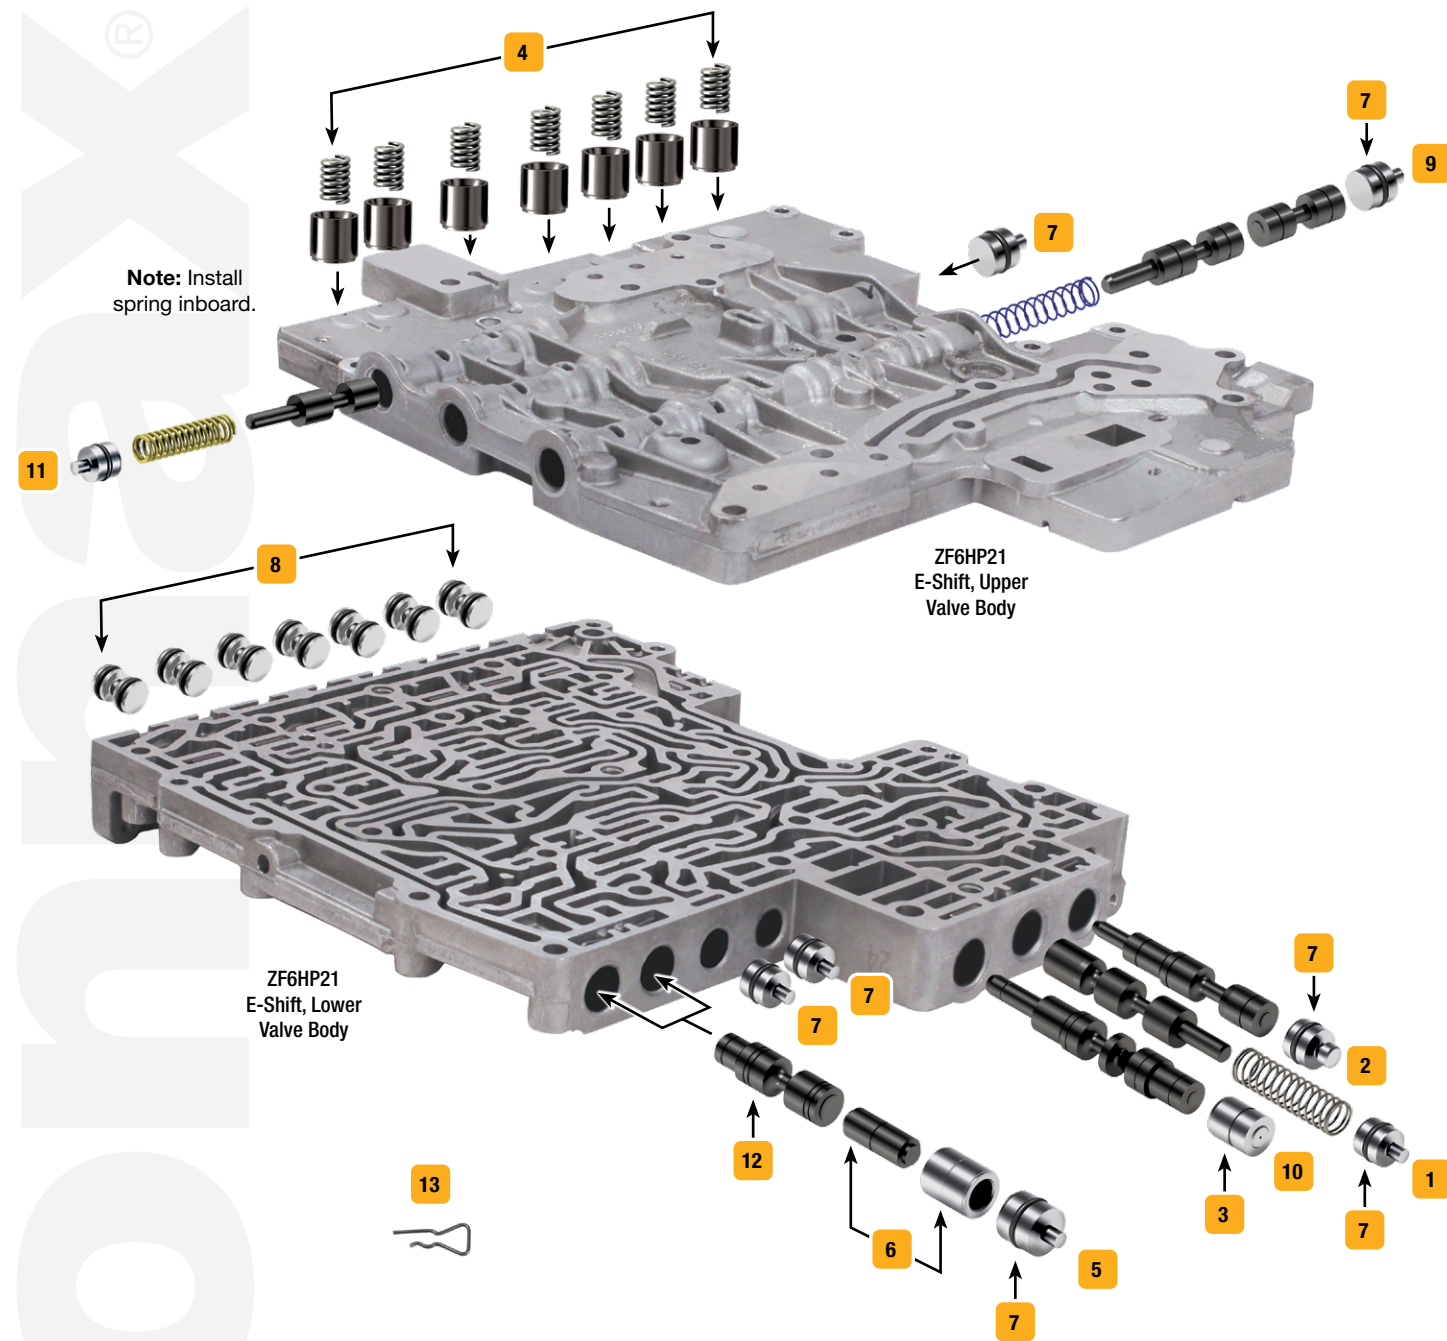

Symptoms/Benefits	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	ZF6-GEN2-ZIP	ZIP	
TCC/Lockup Symptoms				
Excess TCC slip RPM & related codes, Harsh TCC apply & release, Low TCC release pressure	Oversized Converter Release Regulator Valve Kit	1 95740-05K		F-95740-TL5*
Bearing failure, Bushing failure, Planetary failure, Lube failures, Low converter pressure	Oversized Lubrication Control Valve Kit	2 95740-71K		F-95740-TL71*
Pressure Problems				
Erratic line pressure, Broken parts due to excessive line pressure, High line pressure	Pressure Regulator Sleeve	3 95740-29K	ZIP Replaces OE sleeve with .629" outer dia. & .804" length	
Shift/Engagement Concerns				
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	4 95740-15K	ZIP Includes 7 pistons & springs	
Coastdown Neutral, Downshift bind-ups, Harsh downshifts, Flare shifts	Oversized Clutch A & Clutch E Control Valve Kit	5 95740-72K	E-shift only, fits either of 2 locations	F-95740-TL72*
5-4 Flare, 5-4 Neutral, No 4-5, VFS 1/A solenoid control code, Delayed Forward, Harsh Forward	Clutch A & E Control Boost Valve Kit	6 95740-28K	ZIP Fits 2 locations	
Inconsistent shift quality	O-Ringed End Plug Kit	7 95740-27K	ZIP Includes 2 large & 6 small end plugs	
	O-Ringed Internal End Plug Kit	8 95740-30K	ZIP Includes 7 end plugs	
Shift concerns, "A" Clutch burned, B Clutch burned, E Clutch burned	Oversized Position Valve Kit	9 95740-75K	E-shift only	F-95740-TL75*
Poor shift quality, Low line pressure, Flare shifts, High line pressure, Harsh shifts	Oversized Pressure Regulator Valve Kit	10 95740-69K	Replaces OE sleeve with .629" outer dia. & .804" length	F-95740-TL69*
Delayed engagement, Flare shifts, Harsh downshifts, Neutral shifts, High line pressure	Oversized Solenoid Pressure Regulator Valve Kit	11 95740-64K		F-95740-TL17*
Component Damage/Failure				
Lost or damaged component	Converter Release Regulator Valve	12 95740-05A	ZIP	
	"Y" Shaped Valve Retainer	13 95740-04K	10/Bag	

* VB-FIX Required



See kit components at www.sonnax.com.