

Ford 5R55S, 5R55W

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 56947J-61K
Oversized Solenoid & Converter Feed Limit Valve Kit

Helps cure:

- No lockup • Delayed engagement
- Codes 731 & 741 • Overheating

Note: Requires tool kit F-56947J-TL61 & the VB-FIX reaming fixture.

2 56947J-05K
Oversized TCC Control Valve Kit

Helps cure:

- Code P0741 • Excess TCC slip
- TCC lining failure • Low cooler flow

Note: Requires tool kit F-56947J-TL2 & the VB-FIX reaming fixture.

3 56947J-S3
TCC Control Valve Spring

Helps cure:

- Engine stall • No TCC release
- TCC cycling • Burnt converter

4 56947J-03K Increased Ratio
56947J-01K OE Ratio
TCC Modulator Plunger Valve Kits

Helps cure:

- Slip codes • Overheated fluid
- High TCC slip RPM at increasing load


5 56947J-80K OE Ratio
56947J-81K Increase Ratio
56947J-82K OE Ratio, Fits 4.6L Engines
Oversized TCC Modulator Plunger Valve Kits

Helps cure:

- Damaged valve body casting • Slip Codes
- High TCC slip RPM at increasing load

Note: Requires tool kit F-56947J-TL80 & the VB-FIX reaming fixture.

- 10** Single O-Ringed End Plugs Fits 5 Locations
Double O-Ringed End Plugs Fits 4 Locations

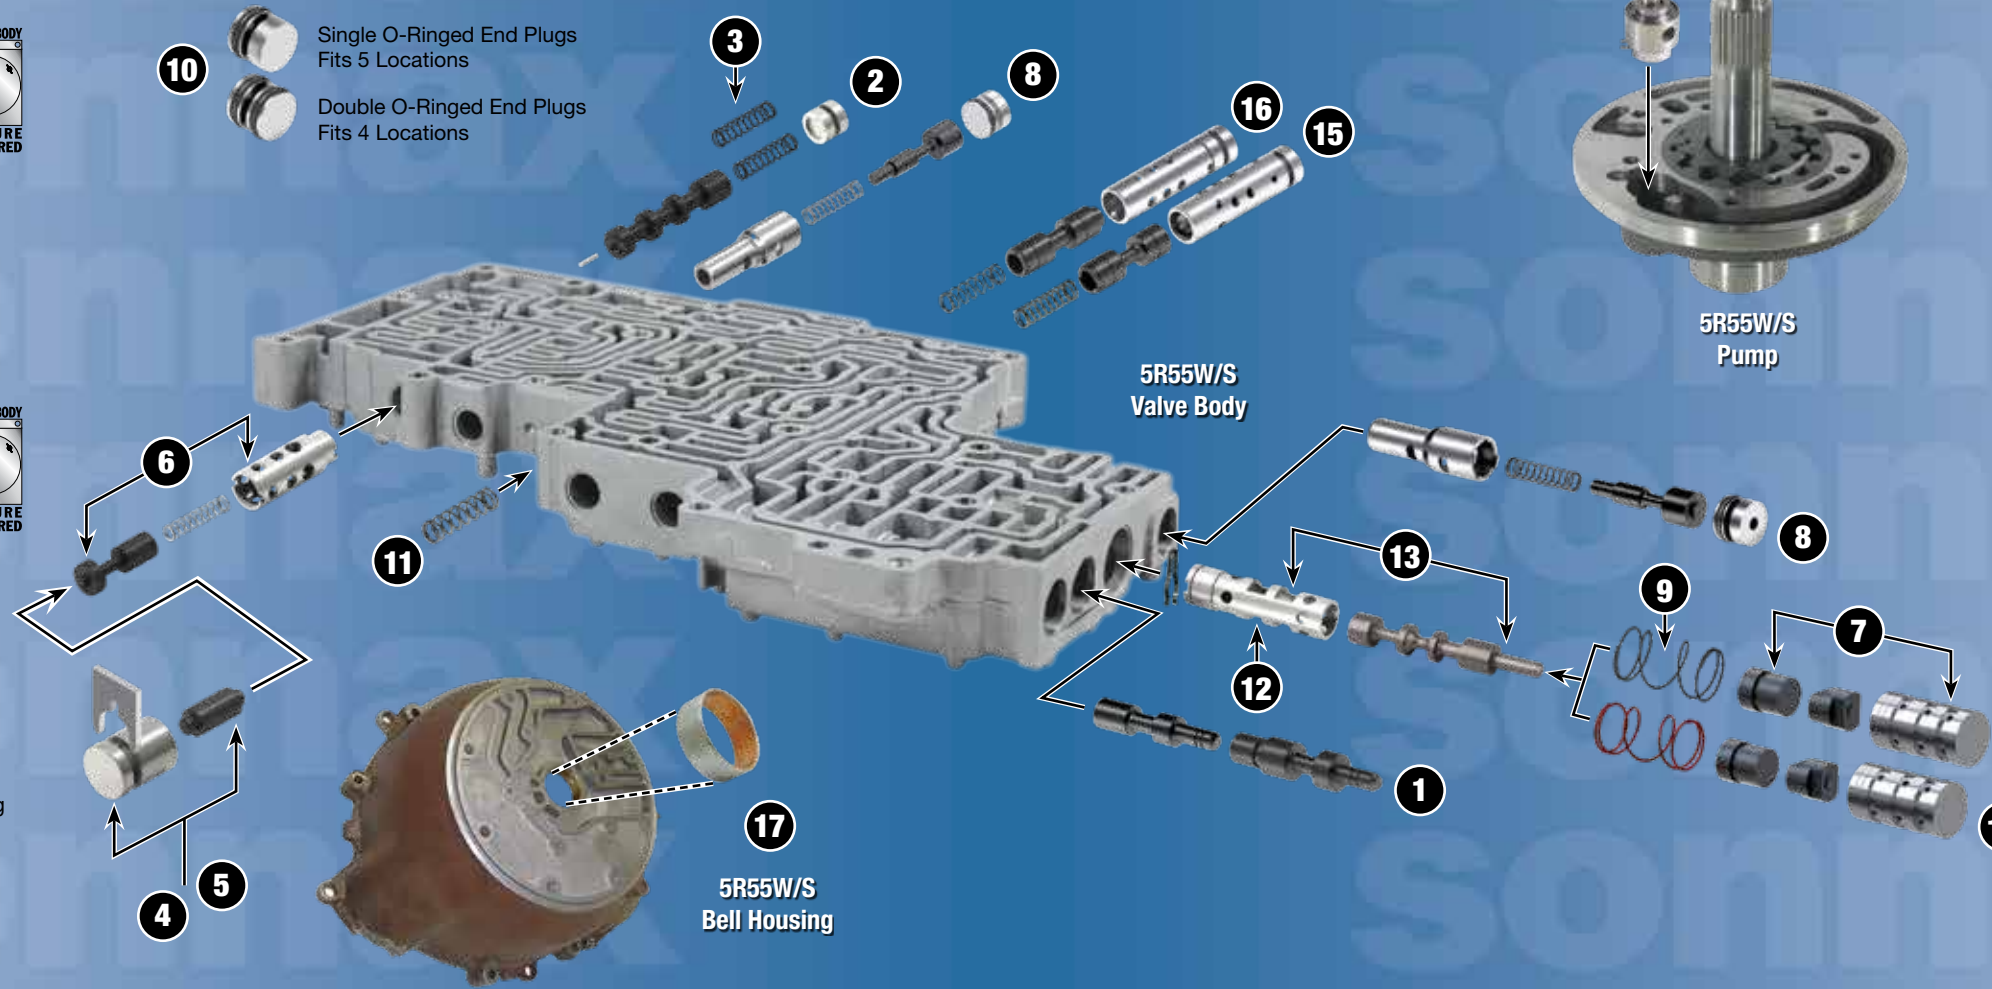

6 56947J-15K
TCC Modulator Valve Kit

Helps cure:

- Code P0741 • Excess TCC slip
- Code 1783 • High line pressure

Note: Requires tool kit F-56947J-TL15 & the VB-FIX reaming fixture.

7 56947J-74K
Boost Valve Kit

Helps cure:

- No Reverse • Reverse slip
- Soft shifts • Low Reverse

8 56947J-19K
Oversized VFS Modulator Control Valve Kit Fits Either of 2 Locations

Helps cure:

- Flare shifts • Low line pressure
- Pressure control out-of-range codes

Note: Requires tool kit F-56947J-TL19 & the VB-FIX reaming fixture.

9 56947J-S7 5/Bag
Elevated Pressure Pressure Regulator Spring

Helps cure:

- Soft shifts • Poor shift quality
- Delayed engagement

10 56947J-66K Includes 9 End Plugs
O-Ringed End Plug Kit

Helps cure:

- Soft & inconsistent shift feel

11 56947J-S6 5/Bag
Forward Engagement Control Spring

Helps cure:

- Delayed engagement
- Burnt Forward clutc



12 56947J-09K
Pressure Regulator Sleeve Kit

Helps cure:

- Delayed engagement • Soft shifts
- Low line rise • Erratic buzz

Note: Requires tool kit 56947J-TL9.

13 56947J-77
Pressure Regulator Valve

Helps cure:

- Delayed engagement • Erratic buzz
- Soft shifts & poor line rise

14 56200-03K
Pump Flow Control Valve Kit

Helps cure:

- Delayed engagement • Pump noise
- No movement until RPM increased

15 56947J-29K
Reverse Engagement Valve Kit

Helps cure:

- Delayed Reverse • No Reverse
- Slipping gears • Direct clutch burned

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

16 56947J-23K
Oversized Reverse Modulator Valve Kit

Helps cure:

- Delayed reverse • No 4th • No 5th
- Direct clutch burned

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

17 56001X Finish-in-Place, 5/Bag
Bell Housing/Pump Cover Bushing

Helps cure:

- Repeat front seal leakage
- Worn pump bushing/converter hub

18  This Sonnax kit is also available, see www.sonnax.com for details.
Line Pressure Booster Kit 5R55WS-LB1