

Ford 5R55N

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 **56947J-S5** 5/Bag
TCC Back Pressure Spring
Helps cure:
• Harsh TCC apply • Excess TCC slip
• Low line pressure • TCC lining overheat

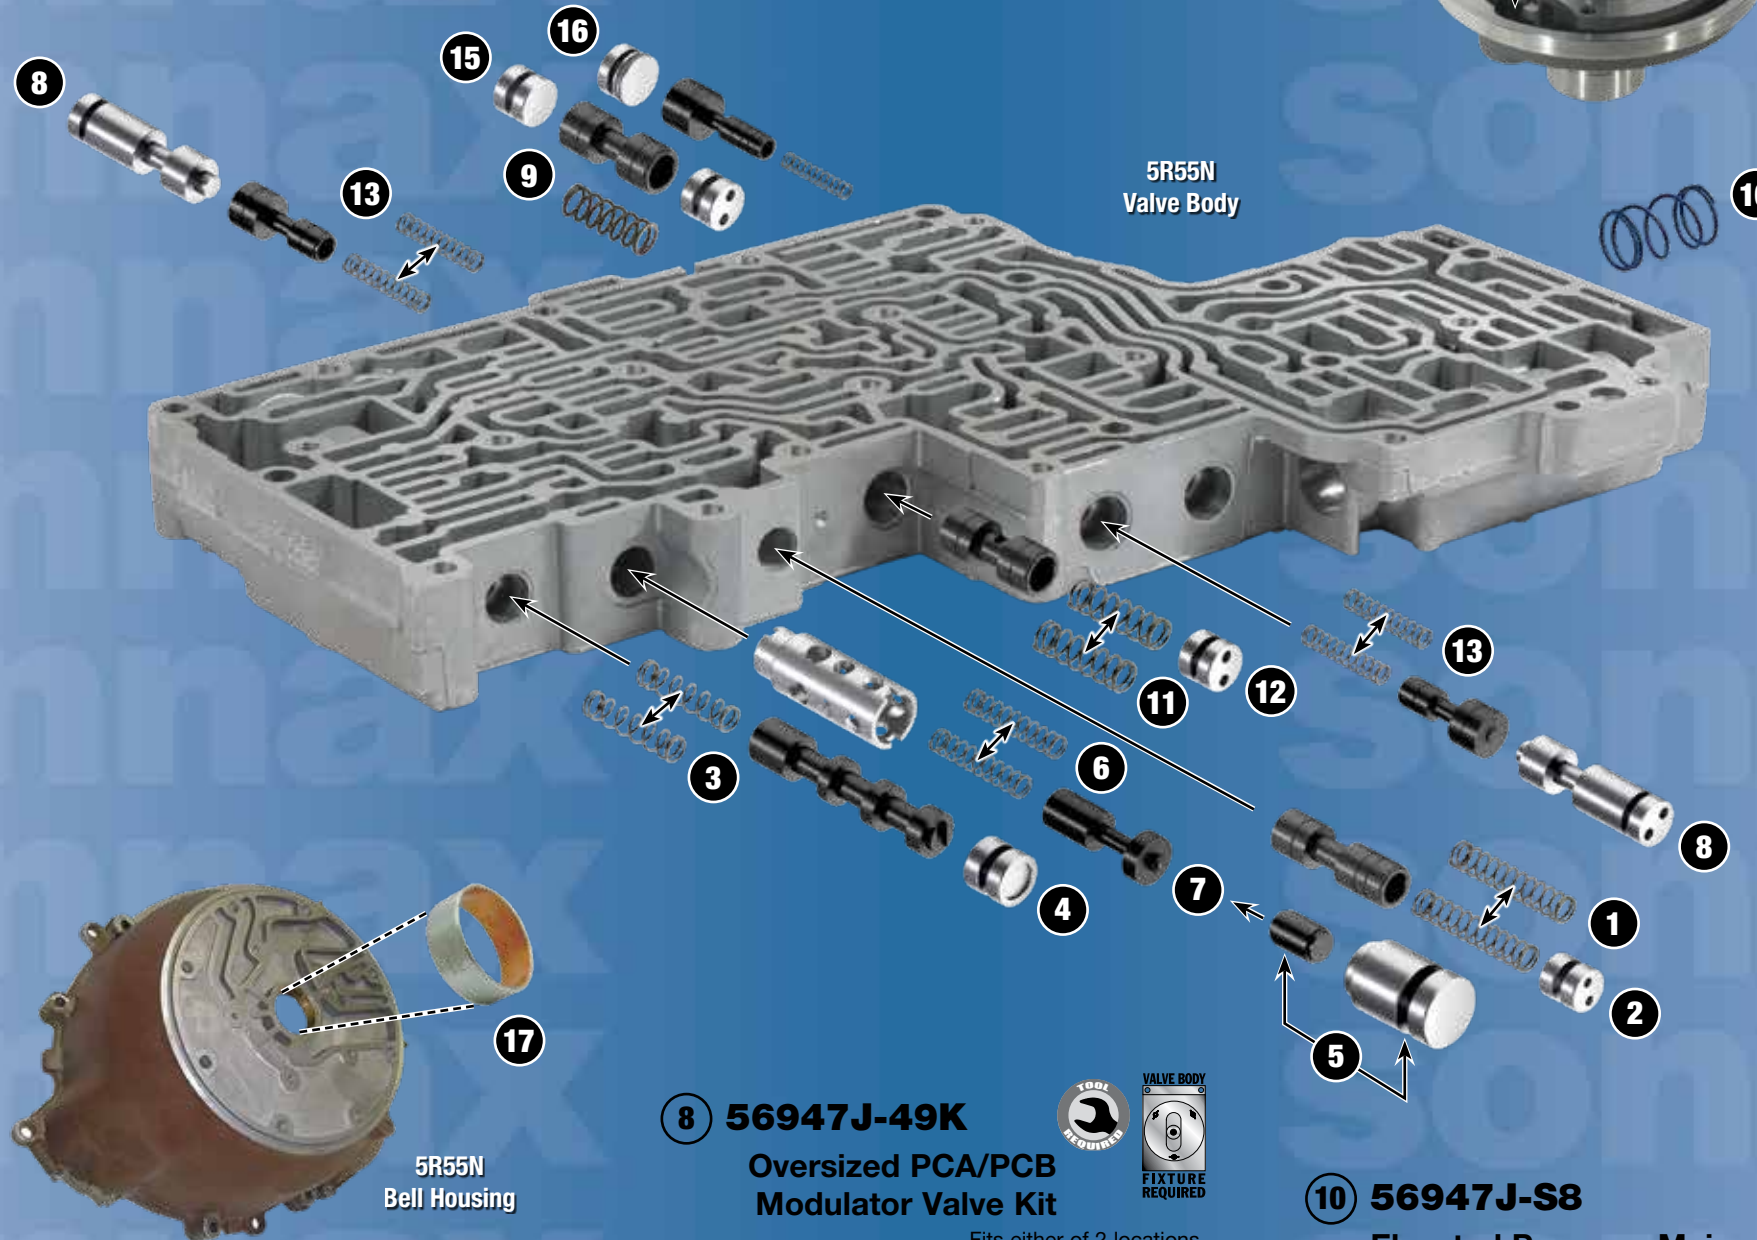
2 **56947J-63K**  
Oversized TCC Back Pressure Valve Kit
Helps cure:
• TCC apply concerns • TCC codes
• Delayed engagement • Burnt converter
Note: Requires tool kit **F-56947J-TL63** & the **VB-FIX** reaming fixture.



3 **56947J-S3** 5/Bag
TCC Control Valve Spring
Helps cure:
• Engine stall • No TCC release
• TCC cycling • Burnt converter



4 **56947J-05K**  
Oversized TCC Control Valve Kit
Helps cure:
• Code P0741 • TCC lining failure
• Excess TCC slip • Overheated converter
Note: Requires tool kit **F-56947J-TL2**, & the **VB-FIX** reaming fixture.

5 **56947J-32K**
TCC Modulator Plunger Valve Kit
Helps cure:
• Slip codes • Overhated fluid
• High TCC slip in RPM at increasing load

6 **56947J-S4** 5/Bag
TCC Modulator Spring
Helps cure:
• Harsh TCC apply
• TCC slip



7 **56947J-15K**  
TCC Modulator Valve Kit
Helps cure:
• Code P0741 • Excess TCC slip
• Code 1783 • High line pressure
Note: Requires tool kit **F-56947J-TL15** & the **VB-FIX** reaming fixture.

8 **56947J-49K**  
Oversized PCA/PCB Modulator Valve Kit
Fits either of 2 locations.
Helps cure:
• Delayed Forward • Delayed Reverse
• Low line pressure • High line pressure
Note: Requires tool kit **F-56947J-TL49** & the **VB-FIX** reaming fixture.

9 **56947J-S1**
4-3 Pre-Stroke Valve Spring
Helps cure:
• Code 734 • Code 735
• Solenoid C Code • No 4th • No 5th

10 **56947J-S8** 5/Bag
Elevated Pressure Main Pressure Regulator Spring
Helps cure:
• Soft shifts • Poor shift quality
• Delayed engagement • Low base line pressure

11 **56947J-S6** 5/Bag
Forward Engagement Control Spring
Helps cure:
• Delayed engagement • Burnt Forward clutch

12 **56947J-56K**  
Oversized Forward Engagement Valve Kit
Helps cure:
• Delayed Forward • Loss of Forward
• Slipping gears • Burnt Forward clutch
Note: Requires tool kit **F-27741-TL13** & the **VB-FIX** reaming fixture.

13 **56947J-S2** 5/Bag
PCA Modulator Valve Spring
Helps cure:
• Low line rise • 2-3 Quality poor
• Low intermediate clutch apply pressure

14 **56200-03K**
Pump Flow Control Valve Kit
Helps cure:
• Delayed engagement • Pump noise
• No movement until RPM increased

15 **56947J-59K**  
Oversized Reverse Engagement Valve Kit
Helps cure:
• Delay Reverse • No Reverse
• Direct clutch burned
Note: Requires tool kit **F-27741-TL13** & the **VB-FIX** reaming fixture.

16 **56947J-53K**  
Oversized Reverse Modulator Valve Kit
Helps cure:
• Delayed Reverse • No 4th
• No 5th • Direct clutch burned
Note: Requires tool kit **F-56947J-TL53** & the **VB-FIX** reaming fixture.

17 **56001X** Finish-in-Place, 5/Bag
Bell Housing/Pump Cover Bushing
Helps cure:
• Repeat front seal leakage
• Worn pump bushing • Worn converter hub
Note: Requires tool kit **F-27741-TL13** & the **VB-FIX** reaming fixture.