


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

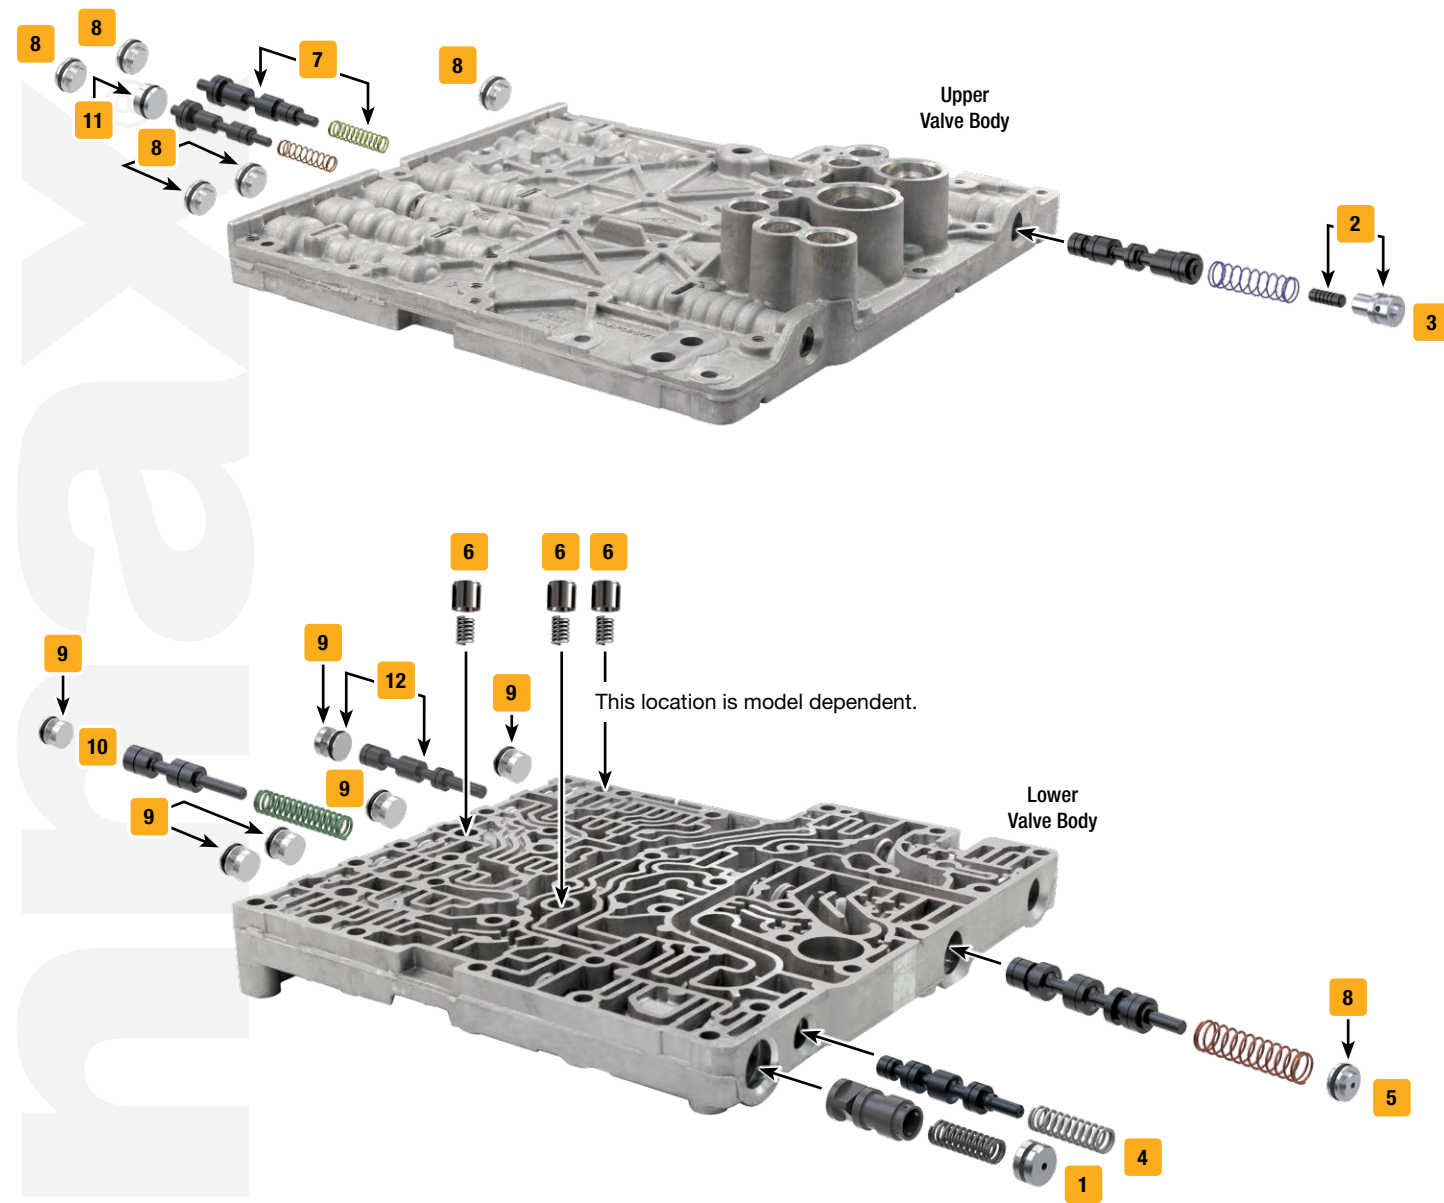

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	6R140-ZIP		
TCC/Lockup Symptoms				
Excess TCC slip, TCC codes, TCC apply & release concerns, Lube failures, Reduced clutch life	Oversized Converter Limit Valve Kit	1 126740-19K	'11-'16	F-126740-TL19*
TCC codes, TCC slip, No lockup, TCC cycling, Overheated fluid, Low cooler & lube pressure	TCC Apply Boost Valve Kit	2 126740-03K		
	Oversized TCC Apply Regulator & Boost Valve Kit	3 126740-15K		F-126740-TL15*
Engine stall, TCC codes, No TCC release, Overheated fluid, Low TCC release pressure	Oversized TCC Charge Limit Valve Kit	4 126740-01K		F-126740-TL*
Pressure Problems				
Poor shift quality, TCC apply & release concerns, Erratic line pressure, Burnt clutches	Oversized Line Pressure Control Valve Kit	5 126740-08K		F-126740-TL8*
Shift/Engagement Concerns				
Downshift clunk, Firm shifts, Erratic EDS solenoid control and/or EDS codes	Accumulator Piston Kit	6 95740-15K	Includes 7 pistons & springs	
Delayed Reverse, 2-3 Flare, 4-5 Flare, Ratio codes, 3rd Slip, 5th Slip, Direct clutch burned	Oversized Direct Clutch Regulator Valve Kit	7 126740-11K		F-126740-TL11*
Flare shifts, Harsh shifts, Soft shifts, Pressure loss, Burnt clutches	O-Ringed End Plug Kit	8 126740-09K	Includes 6 end plugs	
	Internal O-Ringed End Plug Kit	9 126740-05K	Includes 6 end plugs	
Shift quality is not load sensitive, Delayed engagement, Gear ratio & solenoid codes	Oversized Forward Clutch Latch Valve Kit	10 126740-06K		F-126740-TL6*
Delayed Forward, No Forward, Gear ratio & solenoid codes, Failsafe mode, Slipping gears	Oversized Forward Clutch Regulator Valve Kit	11 126740-13K		F-126740-TL13*
Delayed Reverse, Flare shifts, Harsh shifts, Delayed Forward	Oversized Solenoid Feed Pressure Regulator Valve Kit	12 126740-24K		F-126740-TL6*

* VB-FIX Required