


GM Gen. 1 6T70, 6T75

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 124740-14K Oversized TCC Control Valve Kit

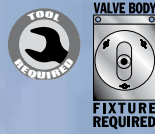


Helps cure:

- TCC apply/release concerns
- Low cooler flow

Note: Requires tool kit F-124740-TL14 & the VB-FIX reaming fixture.

2 124740-24K Oversized TCC Regulator Valve Kit

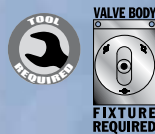

Helps cure:

- Harsh/No TCC apply
- Codes 741, 742

Note: Requires tool kit F-124740-TL24 & the VB-FIX reaming fixture.

3 124740-03K Isolator Valve Kit

Helps cure:

- No/Low line pressure
- Line pressure instability


4 124740-16 Isolator Valve Spring

5/Bag

Helps cure:

- No/Low line pressure
- Line pressure instability

5 124740-17K Oversized 2-6 Clutch Regulator Valve Kit

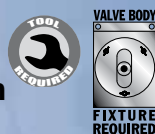


Helps cure:

- 2nd & 6th Gear shift concerns
- Burnt 2-6 clutch

Note: Requires tool kit F-124740-TL17 & the VB-FIX reaming fixture.

6 124740-26K 1.35 Ratio 124740-21K 1.83 Ratio Oversized 3-5-R Clutch Regulator Valve Kits

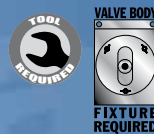

Helps cure:

- 3rd & 5th Gear shift concerns
- Burnt 3-5-R Clutch

Note: 124740-21K requires tool kit F-124740-TL21, 124740-26K requires tool kit F-124740-TL26 & they both require the VB-FIX reaming fixture.

7 124740-04K 4-5-6 Accumulator Piston Kit

Helps cure:

- 3-4 Flare/Harsh
- Ratio codes


8 124740-01 Oversized AFL/Solenoid Pressure Regulator Valve



Helps cure:

- Solenoid codes
- Wrong gear starts

Note: Requires tool kit F-104740-TL12 & the VB-FIX reaming fixture.

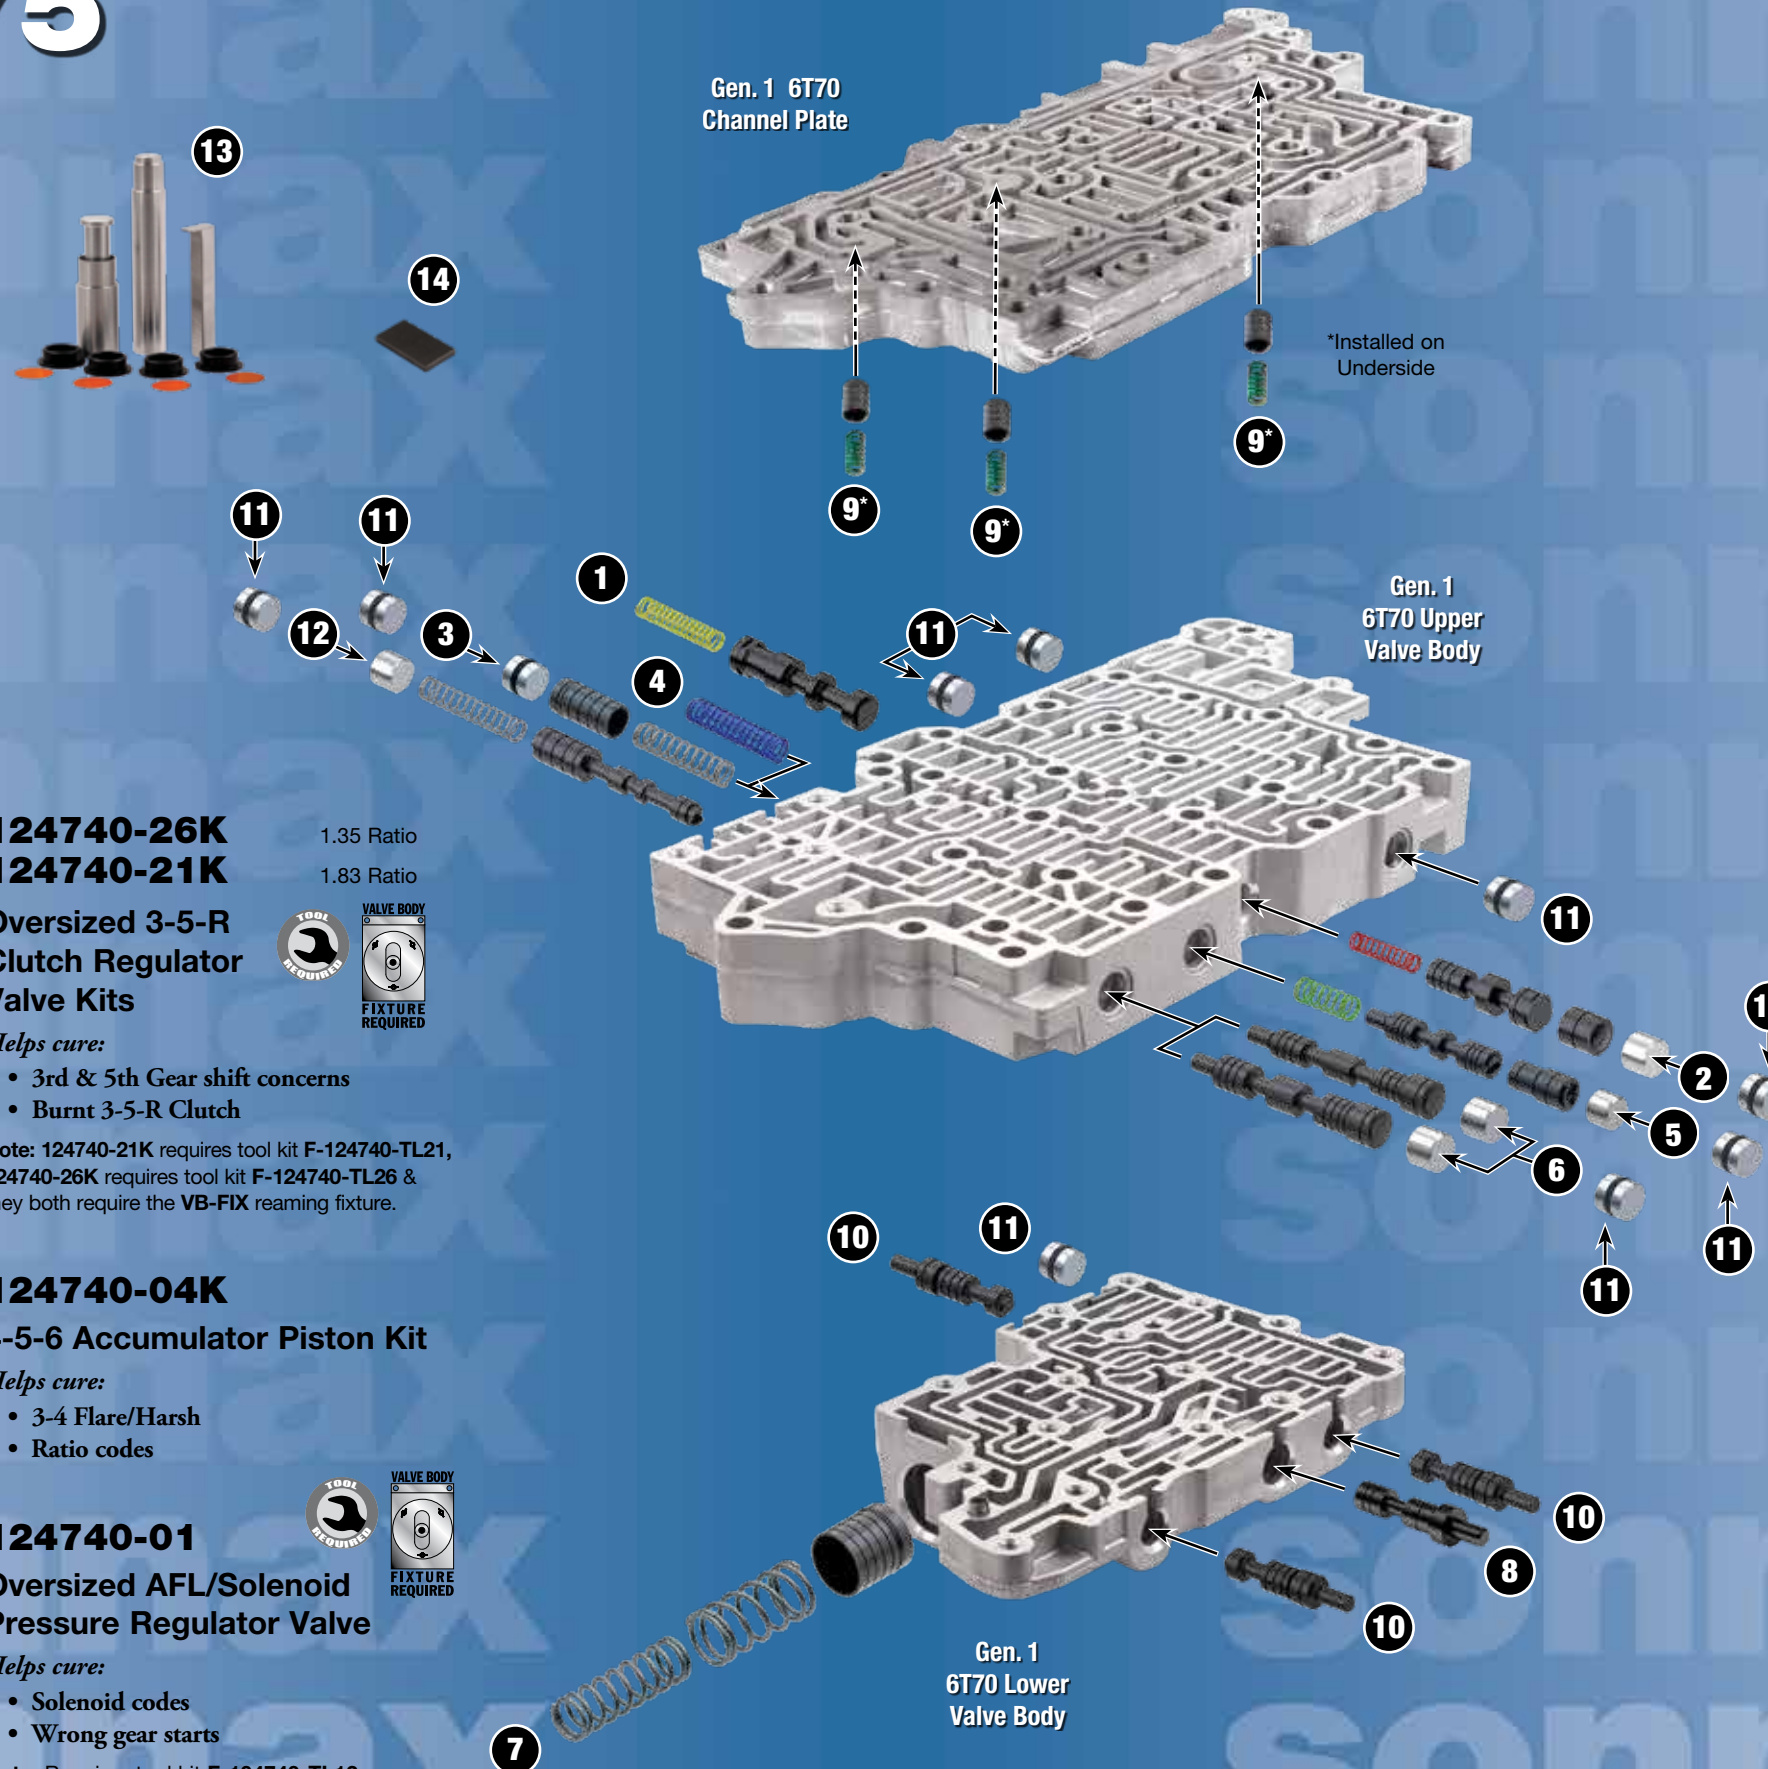

9 124740-40K Oversized Actuator Feed Accumulator Piston Kit



Helps cure:

- Harsh/Soft shifts
- Solenoid performance codes

Note: Requires tool kit 124740-TL40.

10 144740-23 Oversized Clutch Boost/Latch Valve



Helps cure:

- Slips & flares
- Burnt clutches


Note: Requires tool kit F-144740-TL22 & the VB-FIX reaming fixture.

11 124740-02K O-Ringed End Plug Kit

Helps cure:

- Shift concerns
- Burnt clutches

12 124740-12K Oversized Pressure Regulator Valve Kit

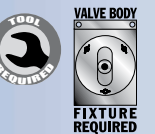

Helps cure:

- Harsh/Soft shifts
- Burnt clutches

Note: Requires tool kit F-124740-TL12 & the VB-FIX reaming fixture.

13 Pressure Switch Repair Kits

Helps cure:

- Codes 0752, 0872, 0877, 098
- Shift concerns

124740-30K

Repairs 4 switches & requires installation tool kit 124740-TL30.

124740-28K

Master Pack: Repairs 40 switches & includes install tools.

14 124533 Pump Valve

Located in Pump

Helps cure:

- Lost or damaged component.



Zip Kit®
6T70-ZIP

This Sonnax kit is also available, see www.sonnax.com for details.