


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

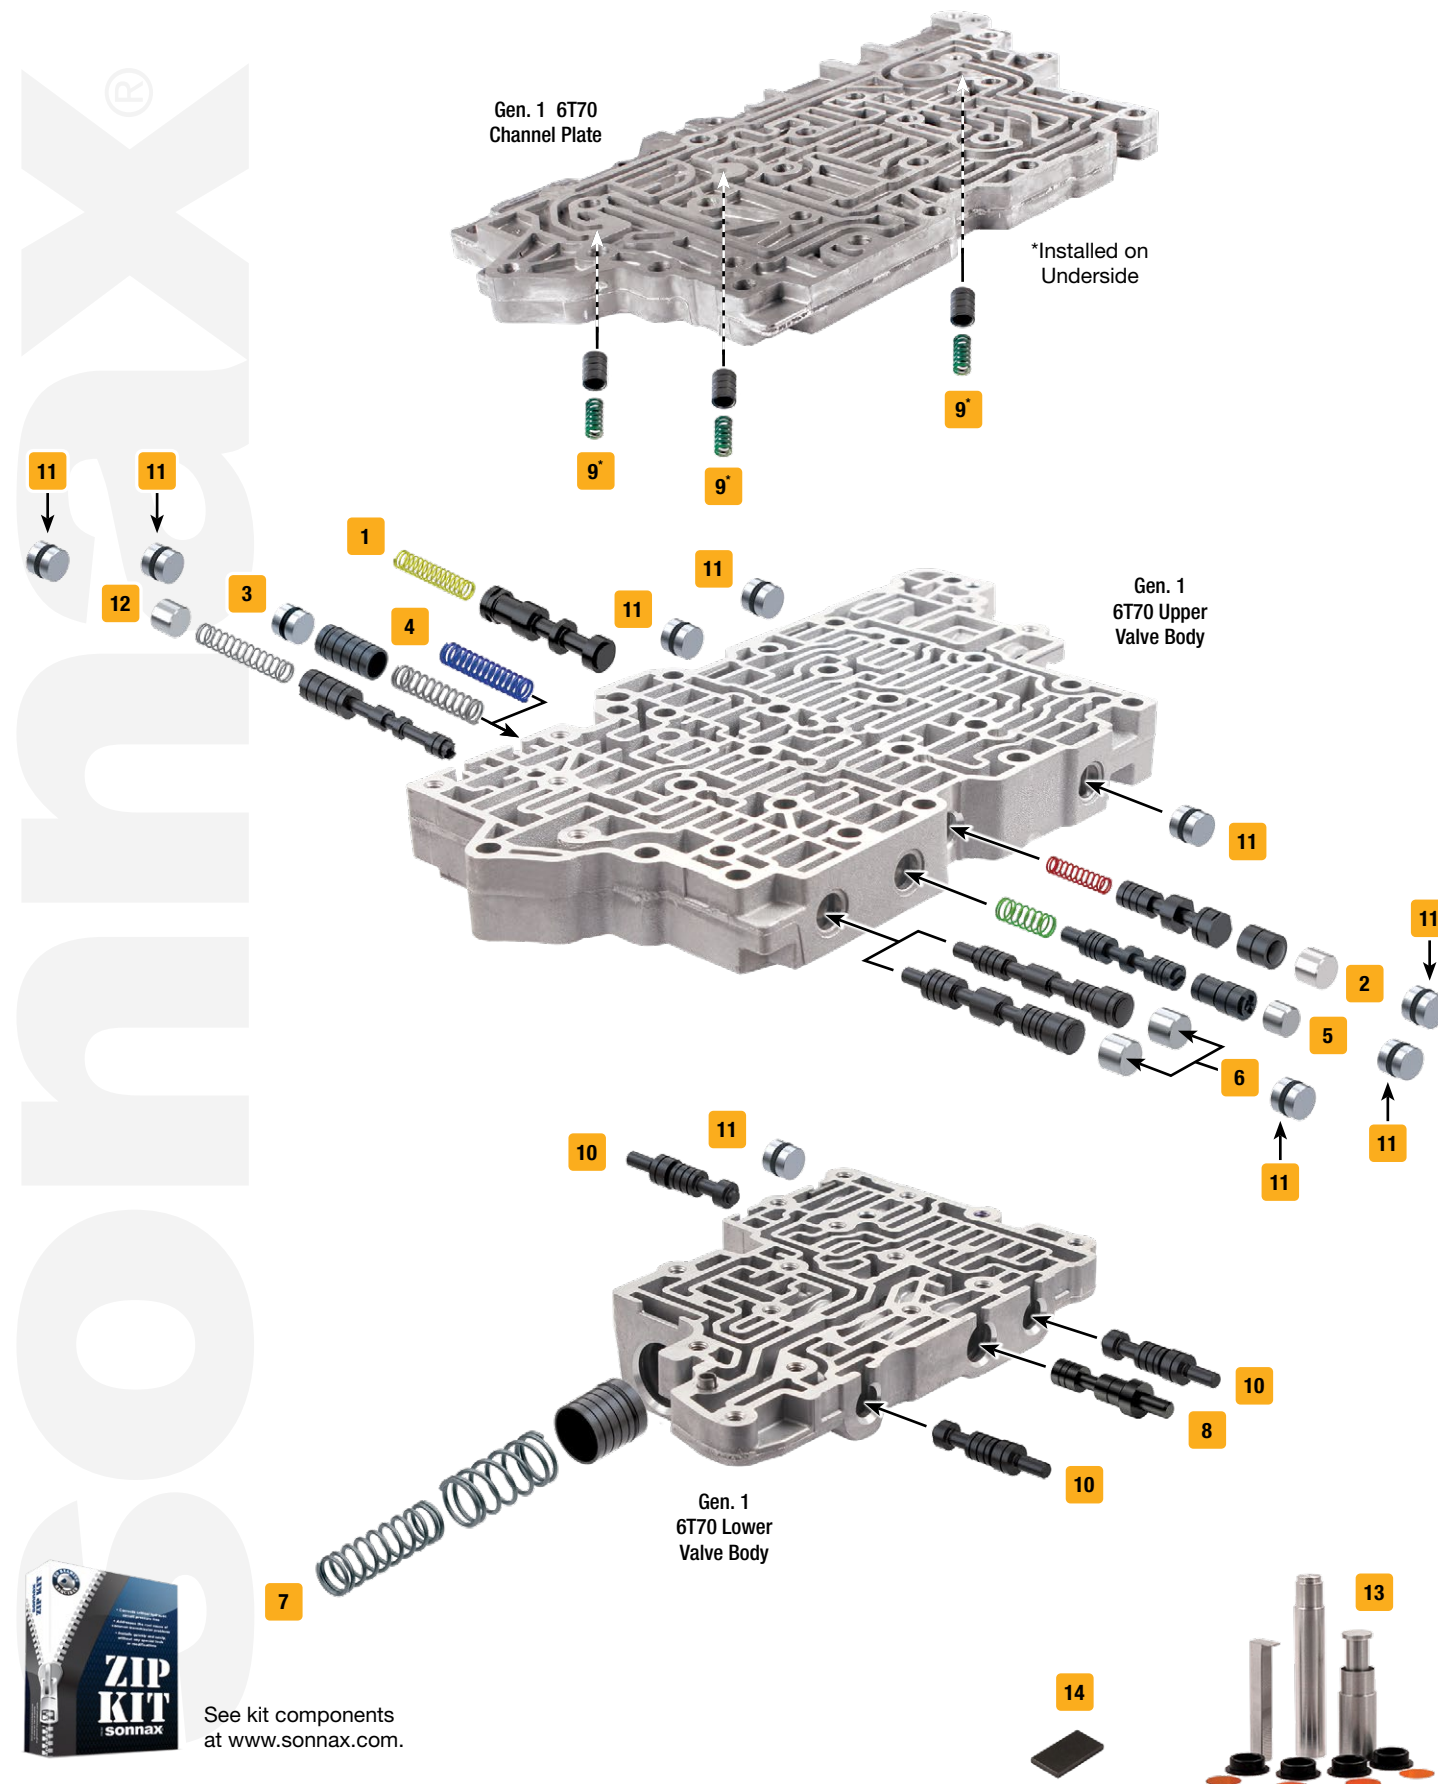

| Symptoms/Part Type | Product Name | Part No. | Details | Tooling |
|---|---|---------------|--|----------------|
| Multiple Symptoms | | | | |
| The first step in correcting common shift problems. | Zip Kit® | 6T70-ZIP | | |
| TCC/Lockup Symptoms | | | | |
| Excess TCC slip, Low cooler flow, Overheating, TCC apply & release concerns, TCC apply codes | Oversized TCC Control Valve Kit | 1 124740-14K | | F-124740-TL14* |
| Code P0741, Code 742, Harsh TCC apply, TCC slip, Loss of fuel economy, Low TCC apply pressure | Oversized TCC Regulator Valve Kit | 2 124740-24K | | F-124740-TL24* |
| Pressure Problems | | | | |
| Low line pressure, Line pressure instability, No line rise, Burnt clutches, Harsh shifts | Isolator Valve Kit | 3 124740-03K | | |
| No line rise, Line pressure instability | Isolator Valve Spring | 4 124740-16 | 5/Bag | |
| Shift/Engagement Concerns | | | | |
| 1-2 Flare, 5-6 Flare, 2nd Slip, 6th Slip, No 2nd, No 6th, Ratio codes, 2-6 Clutch burned | Oversized 2-6 Clutch Regulator Valve Kit | 5 124740-17K | | F-124740-TL17* |
| 2-3 Flare, 4-5 Flare, Delayed Reverse, Reverse slip, 3-5-Reverse clutch burned, Ratio codes | Oversized 3-5-R Clutch Regulator Valve Kit | 6 124740-26K | 1.35 Ratio | F-124740-TL26* |
| | Oversized 3-5-R Clutch Regulator Valve Kit | 6 124740-21K | 1.83 Ratio | F-124740-TL21* |
| 3-4 Flare, Ratio codes, 4-5-6 Clutch burned, Slipping gears, 3-4 Harsh | 4-5-6 Accumulator Piston Kit | 7 124740-04K | | |
| Solenoid performance codes, Wrong gear starts, Clutch failure | Oversized AFL/Solenoid Pressure Regulator Valve | 8 124740-01 | | F-104740-TL12* |
| Harsh shifts, Soft shifts, Solenoid performance codes | Oversized Actuator Feed Accumulator Piston Kit | 9 124740-40K | Fits 3 locations | 124740-TL40 |
| Shift quality is not load sensitive, Harsh shifts, Slips & flares, Delayed engagement | Oversized Clutch Boost/Latch Valve | 10 144740-23 | Fits any of 3 locations | F-144740-TL22* |
| Pressure loss, Shift concerns, Burnt clutches, TCC apply concerns | O-Ringed End Plug Kit | 11 124740-02K | Includes 9 end plugs | |
| Erratic line pressure, Poor shift quality, Burnt clutches, Low converter & lube flow | Oversized Pressure Regulator Valve Kit | 12 124740-12K | | F-124740-TL12* |
| | Pressure Switch Rebuild Kit | 13 124740-30K | Services one valve body, requires installation tool kit | 124740-TL30 |
| Pressure switch codes, Switch codes, Pressure control out-of-range codes, Failsafe mode | Pressure Switch Rebuild Master Pack | 13 124740-28K | Services 10 valve bodies, includes installation tool kit | |
| | Component Damage/Failure | | | |
| Lost or damaged component | Pump Vane | 14 124533 | | |
| Tools | | | | |
| | Vacuum Test Plate Kit | 124740-VTP | | |

* VB-FIX Required