


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

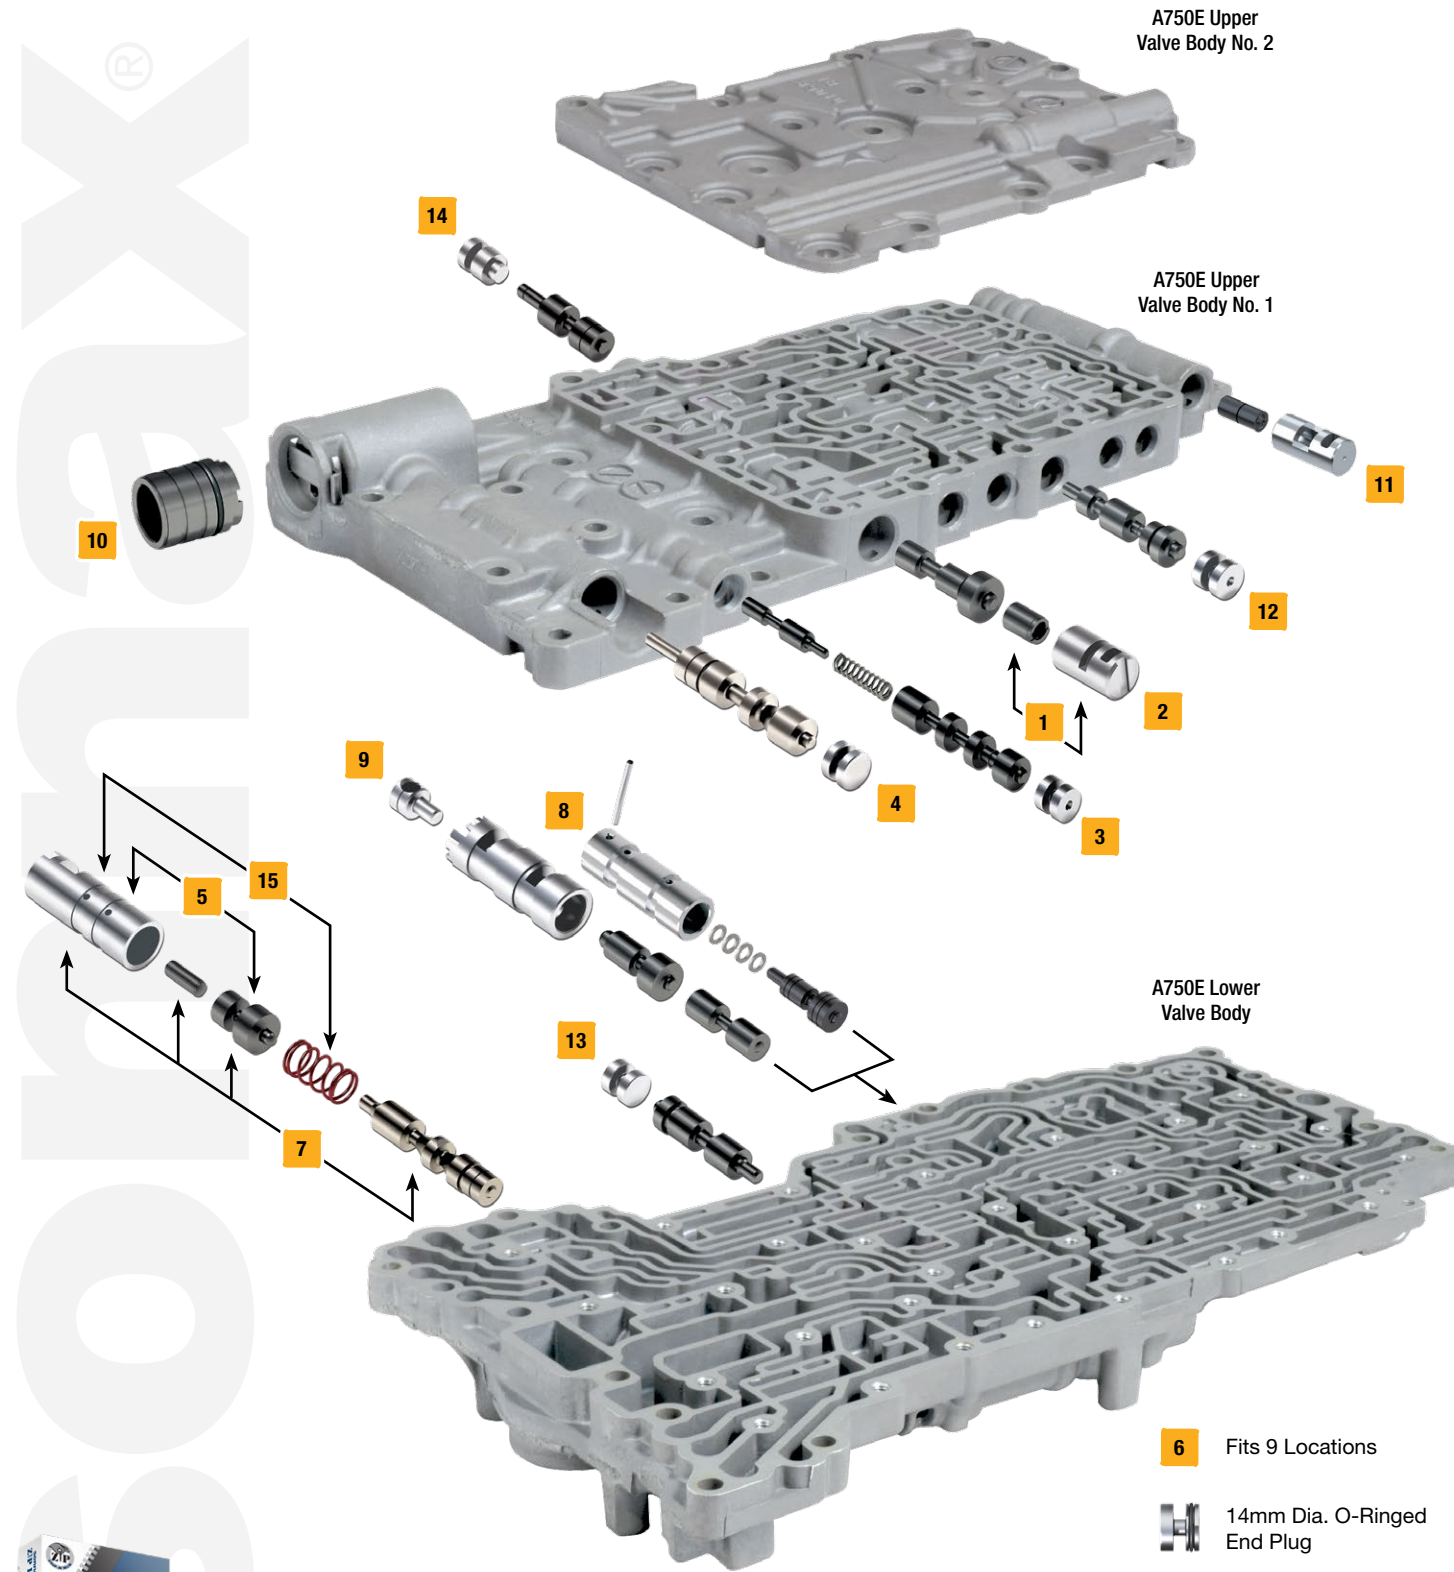


A750E Upper Valve Body No. 2

A750E Upper Valve Body No. 1

A750E Lower Valve Body

6 Fits 9 Locations

 14mm Dia. O-Ringed End Plug

 12mm Dia. O-Ringed End Plug

 11mm Dia. O-Ringed End Plugs (7)



See kit components at www.sonnax.com.



Symptoms/Part Type	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	A750E-A761E-ZIP	ZIP	
TCC/Lockup Symptoms				
Harsh downshifts, TCC apply & release concerns, TCC codes, Cycling TCC RPM, Overheated fluid	Lockup Control Plunger Valve Kit	1 147741-37K	ZIP	
TCC apply & release concerns, Harsh downshifts, RPM fluctuation, TCC codes	Oversized Lockup Control Valve Kit	2 147741-16K		F-147741-TL16*
TCC apply & release concerns, TCC apply codes, Burnt converter, Shudder, Overheating	Oversized Lockup Relay Valve Kit	3 147741-07K		F-147741-TL7*
Harsh lockup, TCC apply & release concerns, Burnt converter, Lube failures	Oversized Secondary Pressure Regulator Valve Kit	4 147741-10K		F-147741-TL4*
Pressure Problems				
Clutch failure, Soft shifts, Harsh shifts, High line pressure in Reverse, High line pressure	Boost Valve Kit	5 147741-01K	ZIP	
Various concerns depending on location of leaking end plug, Pressure loss	O-Ringed End Plug Kit	6 147741-31K	ZIP Includes 9 end plugs	
Clutch failure, Soft shifts, Harsh shifts, Low line pressure, High line pressure, Overheating	Oversized Main Pressure Regulator & Boost Valve Kit	7 147741-04K		F-147741-TL4*
Shift/Engagement Concerns				
Harsh shifts, Shift codes, Shift concerns	Accumulator Control Plunger Valve Kit	8 147741-43K	ZIP	
	Oversized Accumulator Control Valve Kit	9 147741-24K		147741-TL24
Delayed engagement, Flare shifts, Forward slip, Burnt clutches	Accumulator Piston Kit	10 57917E-19K		
5th Slip, Reverse slip, B1 Clutches burned, Poor shift quality, Harsh/No engine braking	B1 Apply Control Plunger Kit	11 147741-55K	ZIP	
Burnt clutches, Harsh shifts, Flare shifts, Shift concerns	Oversized Brake Control Valve Kit	12 147741-28K		F-147741-TL28*‡
Gear ratio codes, Solenoid performance codes, Harsh upshifts, Harsh downshifts, Flare shifts	Oversized Clutch Control Valve Kit	13 147741-22K		F-147741-TL22*
Solenoid performance codes, Bang shifts, TCC cycling, Shift concerns, Bind-up, TCC slip	Oversized Solenoid Modulator Valve Kit	14 147741-05K		F-147741-TL5*
High Performance/Heavy Duty Upgrades				
Classic, large-ratio boost valve for crisp, clean shifts without harshness	Line Pressure Booster Kit	15 A750-LB1		

* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.