





Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.



- 6** Fits 9 Locations
-  14mm Dia. O-Ringed End Plug
-  12mm Dia. O-Ringed End Plug
-  11mm Dia. O-Ringed End Plugs (7)

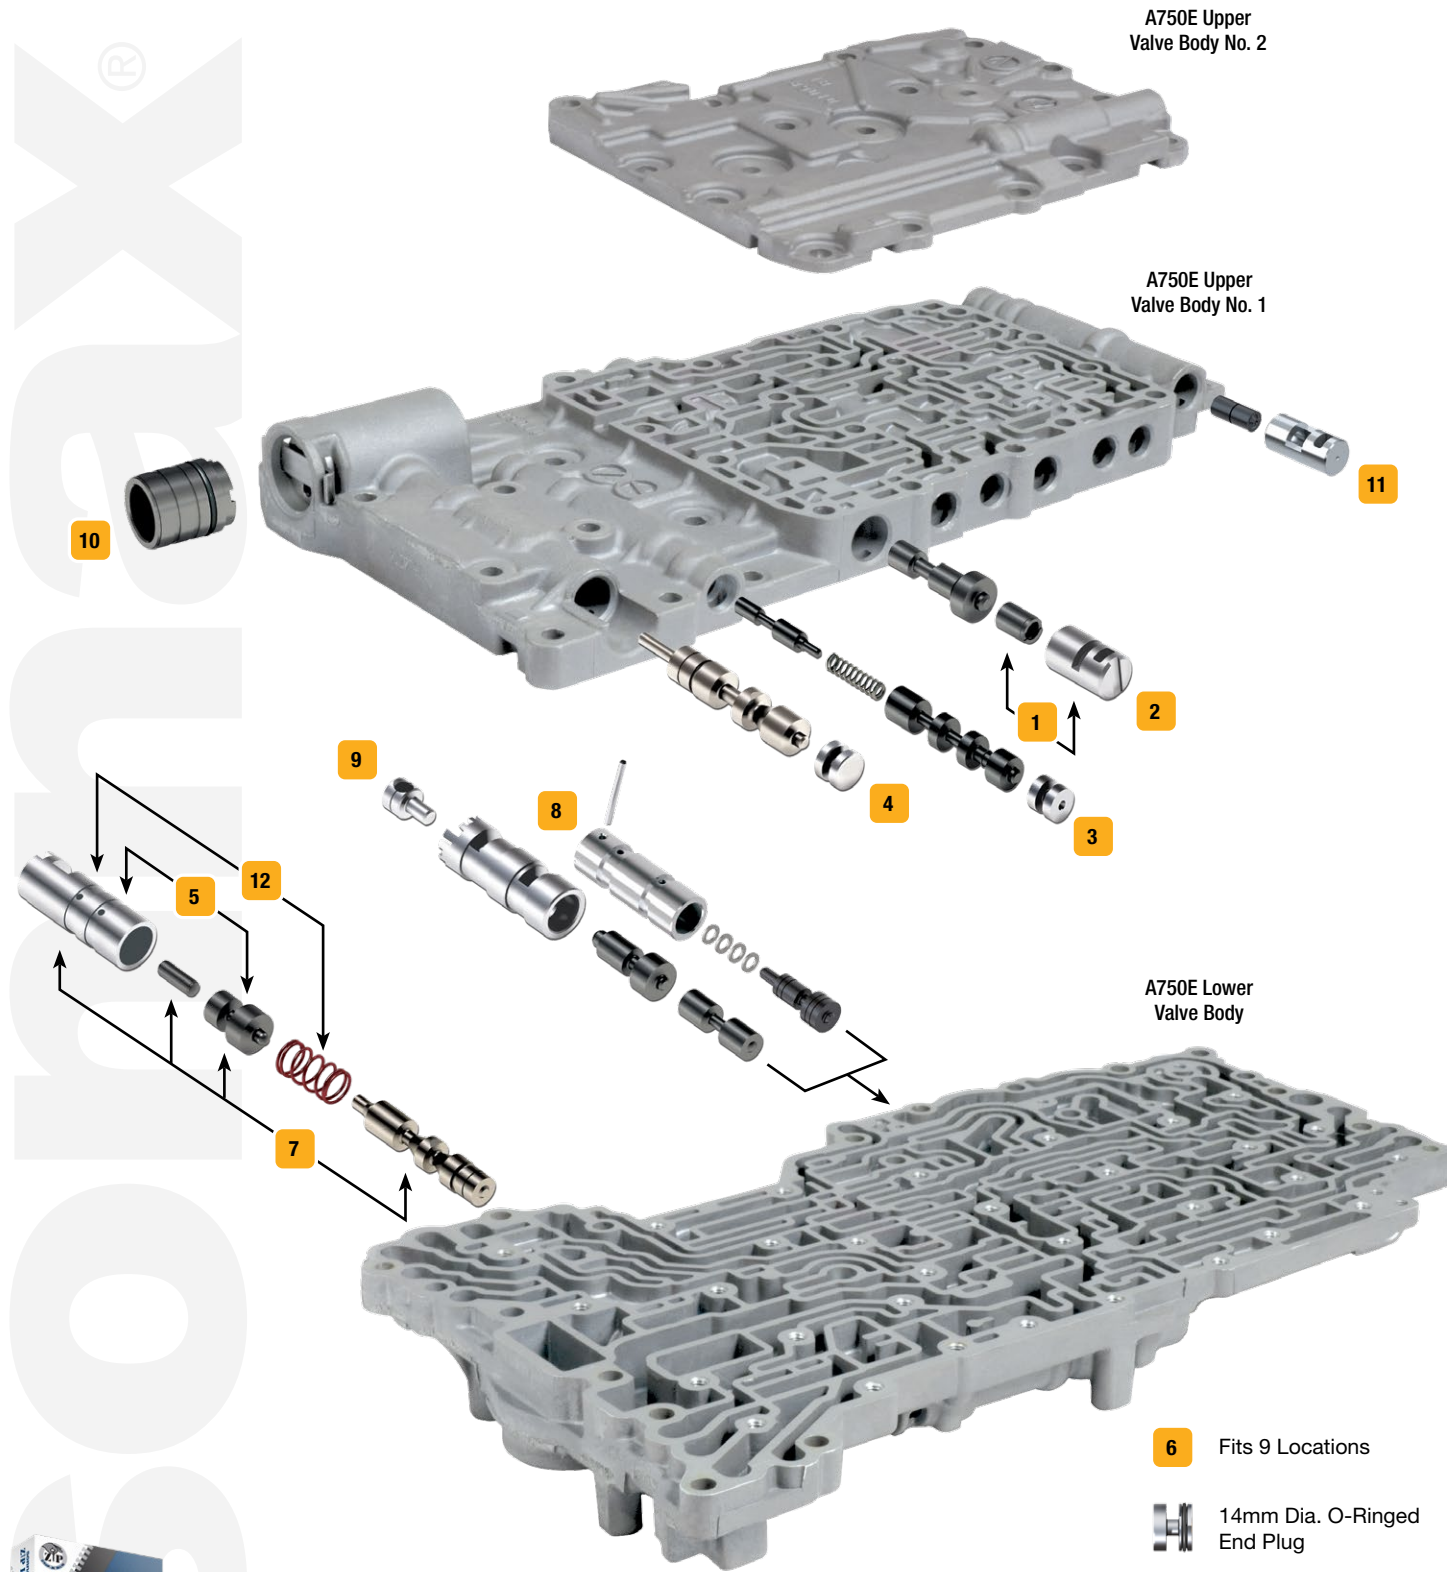

See kit components at [www.sonnax.com](http://www.sonnax.com).



Symptoms/Part Type	Product Name	Part No.	Details	Tooling
<b>Multiple Symptoms</b>				
The first step in correcting common shift problems	Zip Kit®	A750E-A761E-ZIP	ZIP	
<b>TCC/Lockup Symptoms</b>				
Harsh downshifts, TCC apply & release concerns, TCC codes, Cycling TCC RPM, Overheated fluid	Lockup Control Plunger Valve Kit	<b>1</b> 147741-37K	ZIP	
TCC apply & release concerns, Harsh downshifts, RPM fluctuation, TCC codes	Oversized Lockup Control Valve Kit	<b>2</b> 147741-16K		F-147741-TL16*
TCC apply & release concerns, TCC apply codes, Burnt converter, Shudder, Overheating	Oversized Lockup Relay Valve Kit	<b>3</b> 147741-07K		F-147741-TL7*
Harsh lockup, TCC apply & release concerns, Burnt converter, Lube failures	Oversized Secondary Pressure Regulator Valve Kit	<b>4</b> 147741-10K		F-147741-TL4*
<b>Pressure Problems</b>				
Clutch failure, Soft shifts, Harsh shifts, High line pressure in Reverse, High line pressure	Boost Valve Kit	<b>5</b> 147741-01K	ZIP	
Various concerns depending on location of leaking end plug, Pressure loss	O-Ringed End Plug Kit	<b>6</b> 147741-31K	ZIP Includes 9 end plugs	
Clutch failure, Soft shifts, Harsh shifts, Low line pressure, High line pressure, Overheating	Oversized Main Pressure Regulator & Boost Valve Kit	<b>7</b> 147741-04K		F-147741-TL4*
<b>Shift/Engagement Concerns</b>				
Harsh shifts, Shift codes, Shift concerns	Accumulator Control Plunger Valve Kit	<b>8</b> 147741-43K	ZIP	
	Oversized Accumulator Control Valve Kit	<b>9</b> 147741-24K		147741-TL24
Delayed engagement, Flare shifts, Forward slip, Burnt clutches	Accumulator Piston Kit	<b>10</b> 57917E-19K	ZIP	
5th Slip, Reverse slip, B1 Clutches burned, Poor shift quality, Harsh/No engine braking	B1 Apply Control Plunger Kit	<b>11</b> 147741-55K	ZIP	
<b>High Performance/Heavy Duty Upgrades</b>				
Classic, large-ratio boost valve for crisp, clean shifts without harshness	Line Pressure Booster Kit	<b>12</b> A750-LB1	ZIP	

\* VB-FIX Required