


GM 6T30/40/45/50 (Gen. 2), Gen. 3 6T40

Gen. 3 6T40 applications include 6T35, 6T31, 6T41, 6T46 and 6T51.



Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

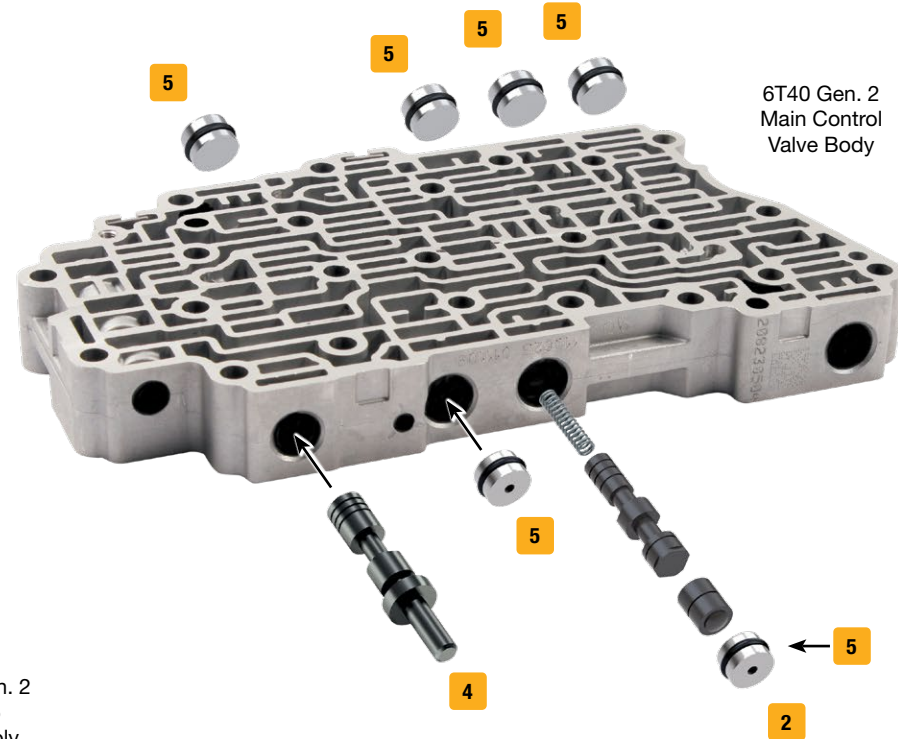

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
Multiple Symptoms				
The first step in correcting common shift problems	Zip Kit®	6T40-GEN2-ZIP		
TCC/Lockup Symptoms				
Excess TCC slip, Low cooler flow, TCC codes Overheating, Low converter & lube flow	Oversized TCC Control Valve Kit	1 144510-05K	Fits 6T30/40/45/50 (Gen. 2) only	F-144510-TL5C*
Code P0741, Code 742, No lockup, TCC slip, Loss of fuel economy, Low TCC apply pressure	Oversized TCC Regulator Valve Kit	2 144740-16K		F-144740-TL16*
Pressure Problems				
Burnt clutches, Erratic line pressure, Low converter & lube flow, Overheating	Oversized Pressure Regulator Valve Kit	3 144510-12K	Fits 6T30/40/45/50 (Gen. 2) only	F-144510-TL12C*
Shift/Engagement Concerns				
No 4th, No 5th, No 6th, Low clutch oil pressure, Harsh shifts, Flare shifts	Oversized Actuator Feed Limit Valve	4 144740-01		144740-TL
Pressure loss, Burnt clutches, Shift concerns, TCC apply concerns	O-Ringed End Plug Kit	5 144510-14K	Includes 6 end plugs	

* VB-FIX Required



See kit components at www.sonnax.com.