


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

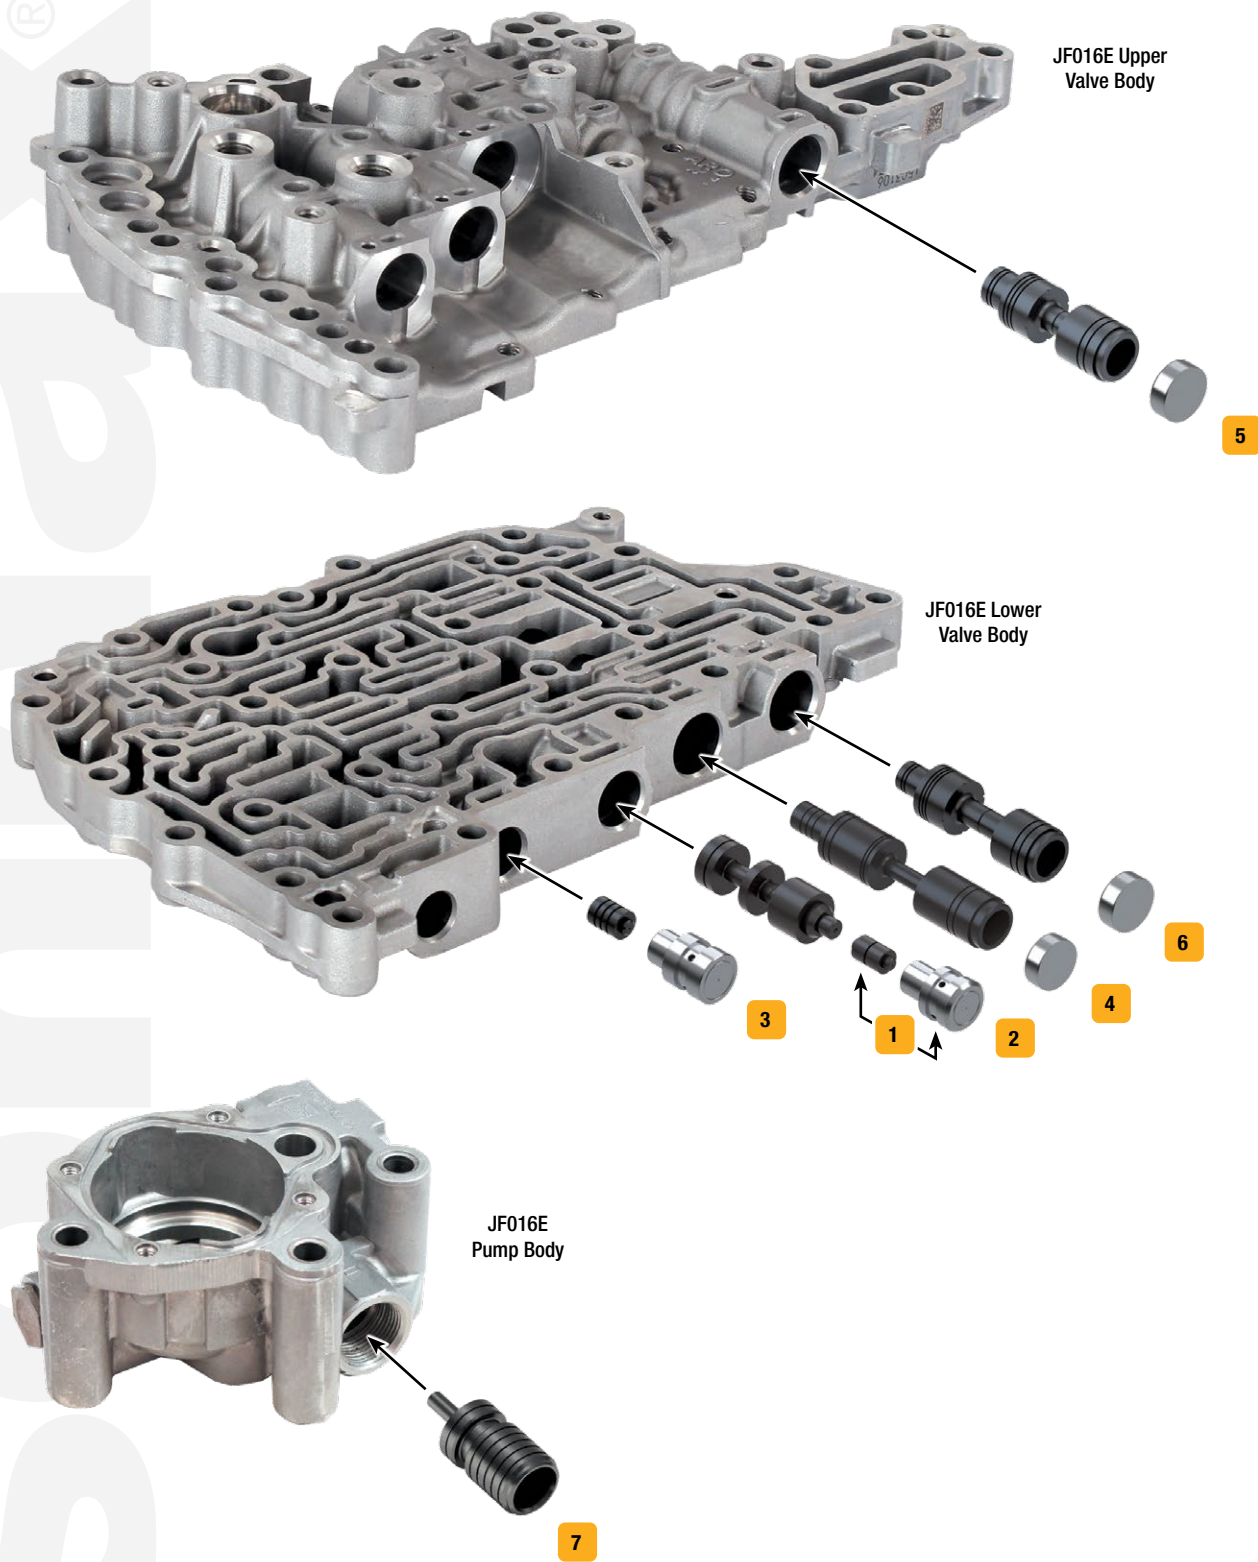

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms					
Jerking on coastdown, Overheated fluid, No lockup, Engine stall on engagement	Torque Converter Lube Regulator Plunger Valve Kit	1 33510N-06K	ZIP		
Jerking on coastdown, No lockup, Engine stall on engagement, Overheated fluid	Oversized Torque Converter Lube Regulator & Plunger Valve Kit	2 33510N-08K			F-33510N-TL8*
TCC apply codes, Burnt converter, Converter shudder	Lockup Control Plunger Valve Kit	3 33510N-11K	ZIP		
Pressure Problems					
Low base line pressure, Push belt slippage, Solenoid performance codes, Delayed engagement	Oversized Main Pressure Regulator Valve Kit	4 33510N-05K			F-33510N-TL5
Chatter on acceleration, High line pressure, Low line pressure, Pulley breakage	Oversized Primary Pulley Reducing Valve Kit	5 33510N-03K	JF016E (RE0F10D) only		F-33510N-TL3*
Chatter on acceleration, High or low primary pulley pressure, Pulley breakage	Oversized Primary Pulley Reducing Valve Kit	5 33510N-04K	JF017E (RE0F10E) only		F-33510N-TL4*
RPM surge on acceleration, Chatter on acceleration, Push belt slippage & pulley fracture	Oversized Secondary Pulley Reducing Valve Kit	6 33510N-16K			F-33510N-TL16*
Shift/Engagement Concerns					
Push belt slippage, Delayed engagement, Low pump volume	Pump Flow Control Valve	7 33510N-02	ZIP '07-Later		
	Oversized Pump Flow Control Valve	7 33510N-01	'07-Later		F-33510N-TL*

* VB-FIX Required