


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

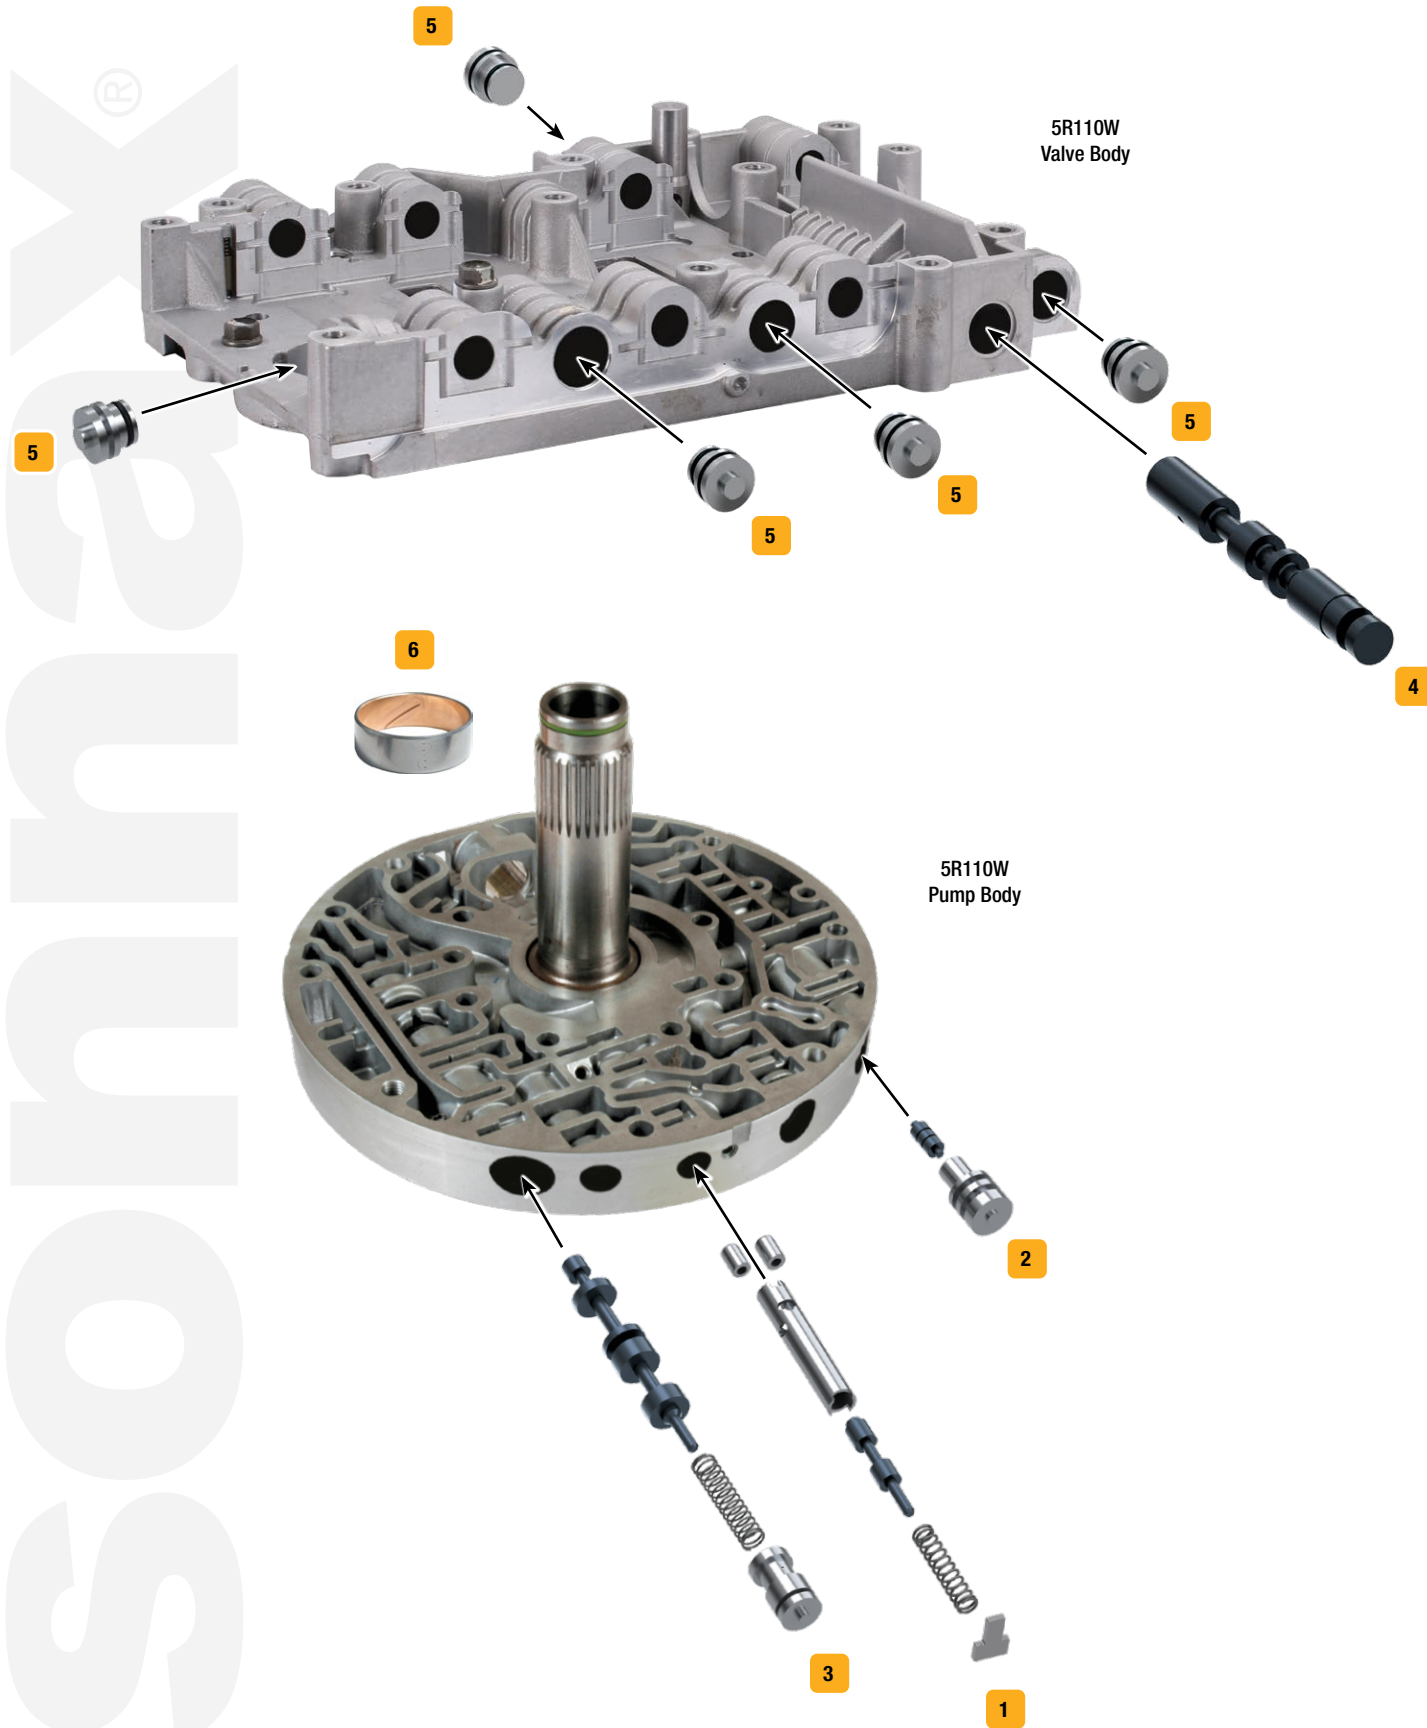

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms					
Harsh TCC apply, Soft TCC apply, TCC codes, TCC slip, TCC lining failure	Converter Pressure Limit Valve Kit	1 36940-06K	ZIP '05-Later, replaces OE valves with 298" or .312" dia. balance spool only		
Overheating, Excess TCC slip, TCC cycling, TCC slip, Code 1783, Code P0741	TCC Control Plunger Valve Kit	2 36940-01K	ZIP		
Pressure Problems					
Code 1744, 1783, Low line pressure & TCC concerns	Oversized Pressure Regulator Valve Kit	3 36940-03K			F-36940-TL3C**, F-36940-RM3C**, F-36940-TL3**‡
Shift/Engagement Concerns					
Delayed Drive, Delayed Reverse, Low line pressure	Manual Valve	4 36940-22	ZIP Replaces OE valves with or without holes in long spool		
Damaged valve body casting, Low line pressure, Delayed Drive, Delayed Reverse	Oversized Manual Valve	4 36940-11	Replaces OE valves with or without holes in long spool		F-36940-TL11*
Loss of shift solenoid control pressure, Shift concerns	Pressure Switch O-Ringed End Plug Kit	5 36940-17K	ZIP Fits any of 5 locations, includes 1 end plug		
Component Damage/Failure					
Leaking front seal, Pump noise, Excess converter hub-to-bushing clearance, Low pump volume	Pump Bushing	6 36002-01	Finish-in-place		

* VB-FIX Required
 ** VB-FIX & VB-06 Required
 ‡ No longer in production. Check with your distributor for availability.