Hyundai/Kia A4CF1, A4CF2

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



TCC Regulator Valve Kit

Helps cure:

- TCC apply/release problems
- Converter codes
- Loss of lube





Helps cure:

- Converter apply/release issues
- Excess slip RPM
- Cycling TCC RPM

Note: Requires tool kit F-84741-TL13 & the VB-FIX reaming fixture.

(3) 84741-01K

Boost Valve Kit

- Insufficient line rise in drive ranges
- Higher-than-normal reverse pressures
- Soft shifts

(4) 84741-03K




Oversized Pressure Regulator Valve Kit

Helps cure:

- High/Low line pressure
- Soft and/or harsh shifts
- Clutch failure

Note: Requires tool kit 84741-TL3.

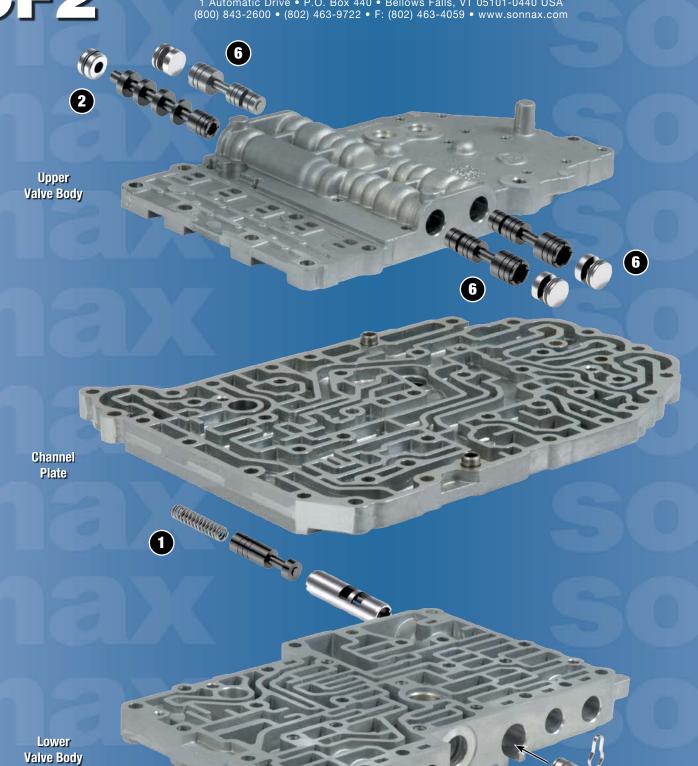

(5) 84741-10K



Pressure Reducing Valve Kit

Helps cure:

- Low line pressure
- No TCC apply
- Delayed forward

Note: Requires tool kit F-84741-TL10 & the VB-FIX reaming fixture.


(6) 84741-16K

Fits any of 3 locations

Oversized Pressure Control Valve Kit







Note: Requires tool kit F-84741-TL16 & the VB-FIX reaming fixture.

