

GM 6L45, 6L50, 6L80, 6L90

sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

These Sonnax kits are also available, see www.sonnax.com for details.




Zip Kit®
6L45-6L90-ZIP



Line Pressure
Booster Kit
6L80-LB1

1 104520-11 Oversized Converter Feed Limit Valve

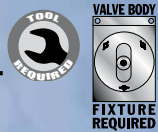


Helps cure:

- High TCC slip RPM
- Overheated converter

Note: Requires tool kit F-104520-TL11C & the VB-FIX & VB-06 reaming fixtures.

2 104740-07K Oversized TCC Regulator Valve Kit

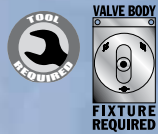

Helps cure:

- Codes 741/742
- Excess TCC slip rate/harsh apply

Note: Requires tool kit F-104740-TL7 & the VB-FIX reaming fixture.

3 104740-45K TCC Regulator Valve Spring

Helps cure:

- Solenoid performance codes
- Clutch failure

4 104740-12 Oversized AFL Valve



Helps cure:

- Wrong gear starts
- Solenoid codes

Note: Requires tool kit F-104740-TL12 & the VB-FIX reaming fixture.


5 104520-01K Boost Valve Kit

6 104520-03K Pressure Regulator Valve Kit

Helps cure:

- High/Low line pressure
- Harsh/Soft shifts

7 104520-07K Oversized Pressure Regulator & Boost Valve Kit

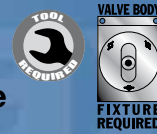

Helps cure:

- High/Low line pressure
- Overheated transmission

Note: Requires tool kit F-104520-TL7 & the VB-FIX & VB-06 reaming fixtures.


8 104740-01 Oversized Clutch Boost Valve



Helps cure:

- Shift quality is not load sensitive
- Clutch pressure solenoid codes

Note: Requires tool kit F-104740-TL & the VB-FIX reaming fixture.

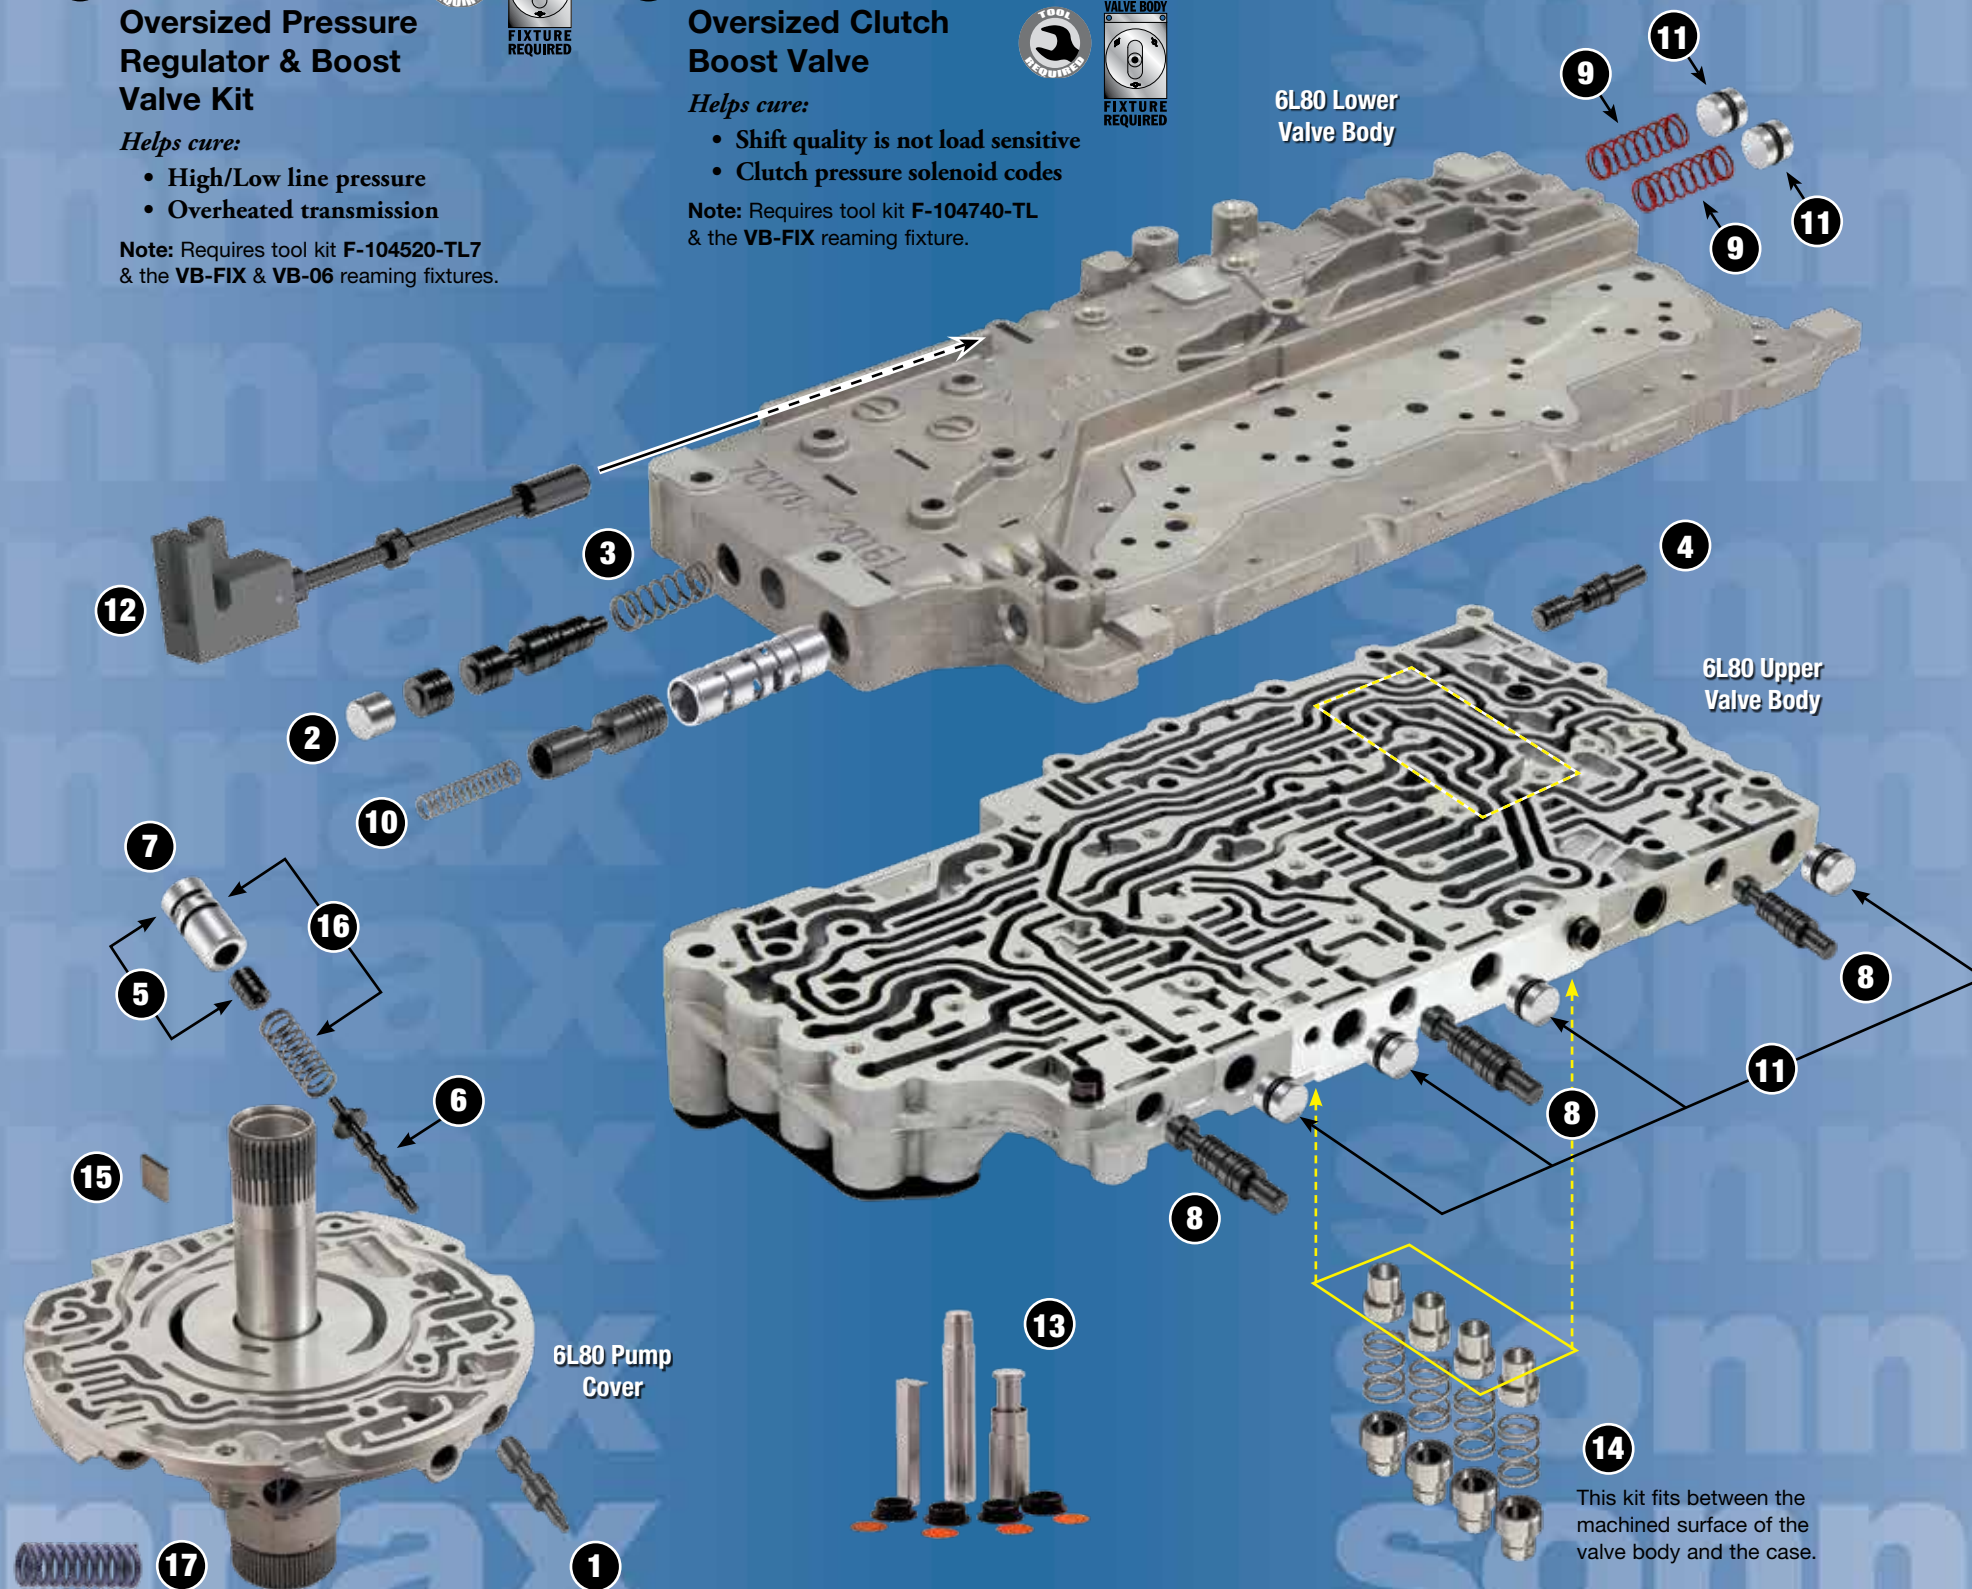

9 104740-02K Clutch Select Valve Spring Kit

Mid 2010-Earlier
Fits 2 Locations

Helps cure:

- Code P0751
- Cruise control disabled

10 104740-09K Compensator Feed Regulator Valve Kit

Helps cure:

- Harsh shifts, CPC codes
- Bump shifts

11 104740-23K O-Ringed End Plug Kit

Fits 6 Locations

Helps cure:

- Shift concerns
- Burnt clutches

12 104740-24K Manual Valve Assembly

Fits 6L45 BMW Only

Helps cure:

- No Forward/Reverse
- Gear ratio codes

13 Pressure Switch Repair Kits

Helps cure:

- Codes 0752, 0872, 0877, 098
- Shift concerns

124740-30K

Repairs 4 switches & requires installation tool kit.

124740-28K

Master Pack: Repairs 40 switches & includes install tools.

124740-TL30

Tool kit repairs 4 switches & includes install tools.

14 104740-14K Center Support Seal Kit

Helps cure:

- Burnt clutches
- Loss of lube oil

15 76742 Pump Vane

Helps cure:

- Lost or damaged component

17 104534-HD Pump Slide Spring

Helps cure:

- Keeps pump in high-volume position at high RPM.