


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

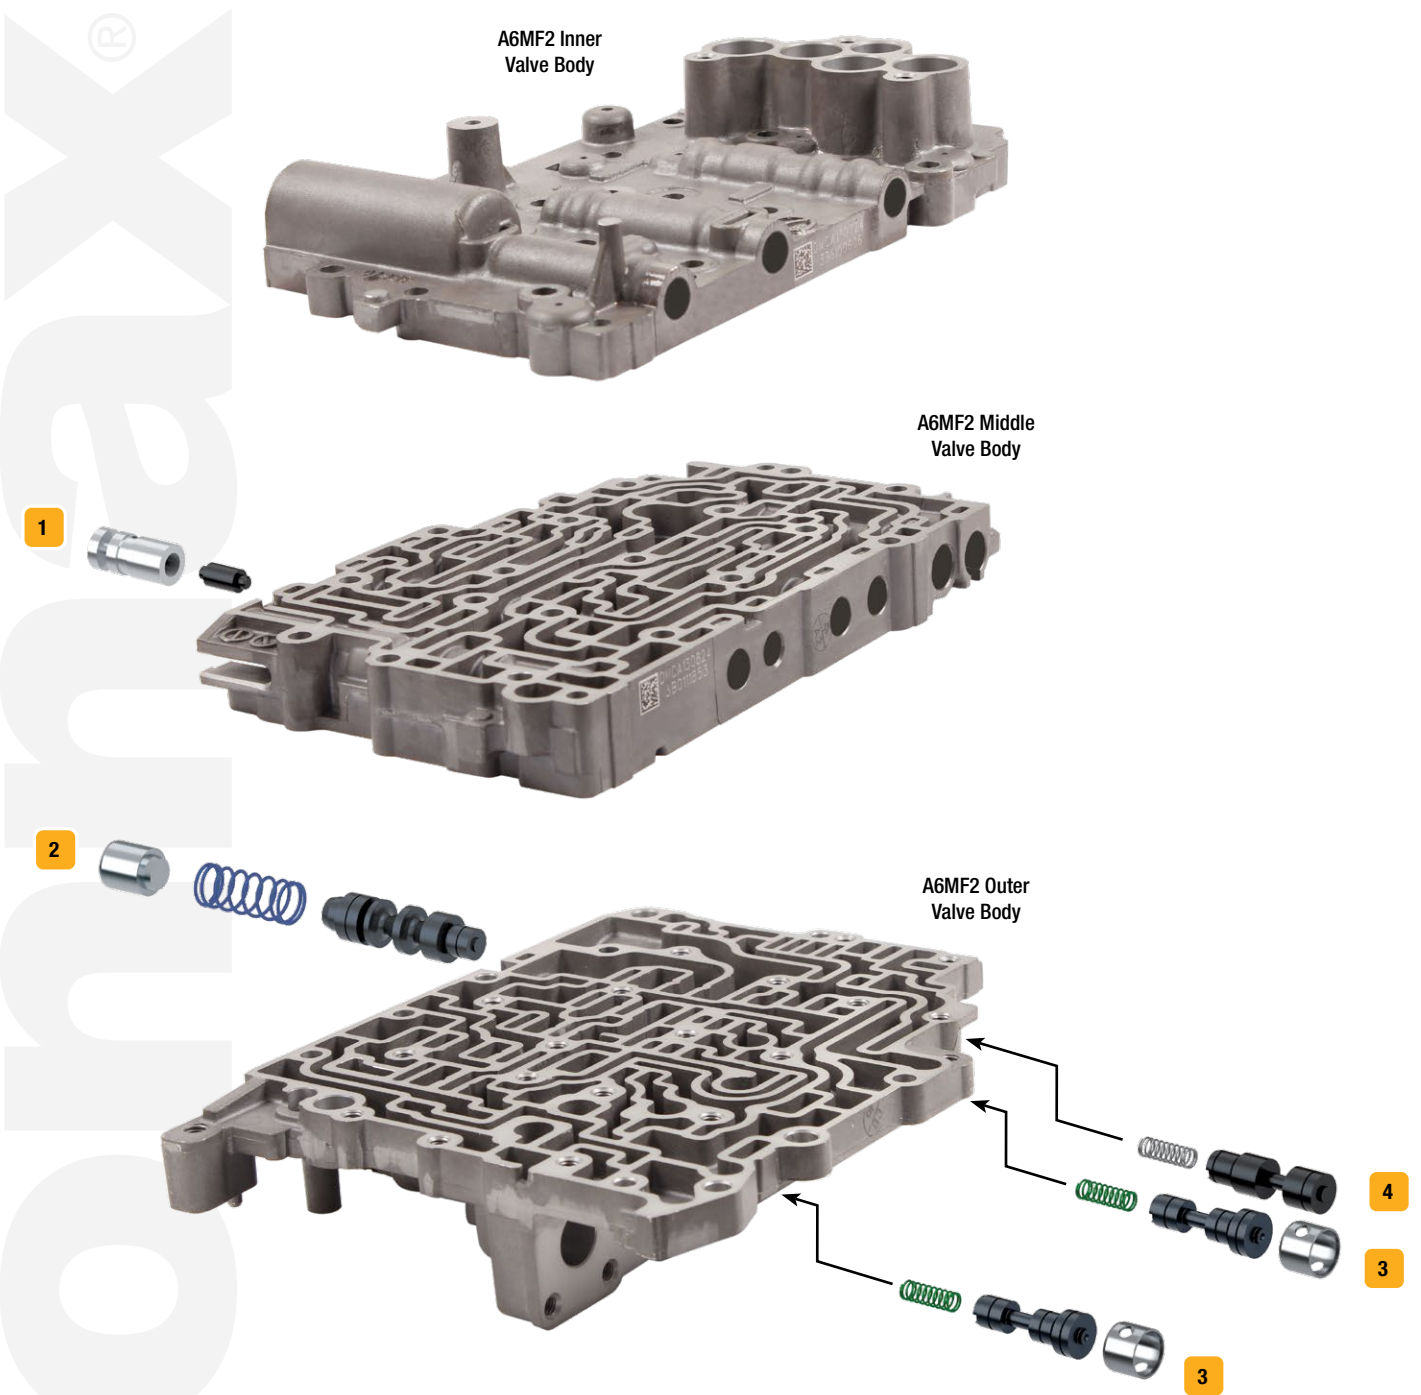

Symptoms/Benefits	Product Name	Part No.	Details ZIP Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms				
TCC codes, Converter shudder & failure, TCC slip, Low TCC apply pressure	TCC Pressure Control Plunger Valve Kit	1 102741-01K	ZIP	
Pressure Problems				
Poor shift quality, Soft & inconsistent shift feel, Burnt clutches, Overheating	Oversized Pressure Regulator Valve Kit	2 102741-08K		F-102741-TL8*‡
Shift/Engagement Concerns				
Delayed engagement, Slips, flares & bind-ups, No Forward, No Reverse, Erratic shift timing	Oversized 3/5/Reverse & Underdrive Pressure Control Valve Kit	3 102741-13K	Fits either of two locations	F-102741-TL13*‡
3-4 Flare, 4-5-6 Slip, Gear ratio codes, Pressure control out-of-range codes	Oversized Overdrive Pressure Control Valve Kit	4 102741-18K		F-102741-TL18*‡

* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.