
GM 9T45, 9T50, 9T60, 9T65



| | | | Drop-In | |
|---|------------------------------------|--------------|---|---------|
| Symptoms/Benefits | Product Name | Part No. | Details ZIP Zip Valve [™] Parts | Tooling |
| Multiple Symptoms | | | | |
| The first step in correcting common shift problems | Zip Kit® | 9T45-ZIP | ZiP | |
| Pressure Problems | | | | |
| Park release issues | ETRS Mode 2 Boost Valve Kit | 184740-06K | ZiP | |
| Harsh shifts, Burnt clutches, Pressure loss, Soft shifts, Flare shifts | O-Ringed End Plug Kit | 2 184740-03K | ZIP Includes 5 end plugs | |
| Erratic line pressure, Burnt clutches, Poor shift quality, Low converter & lube flow | Pressure Regulator Boost Valve Kit | 3 184740-02K | ZiP | |
| Burnt clutches, Soft shifts, Shift concerns associated with circuit pressure loss | Signal Damper Piston Kit | 4 184740-01K | ZIP Includes 4 pistons | |
| Component Damage/Failure | | | | |
| Loss of shift solenoid control pressure, Poor shift quality, Various shift concerns | Solenoid Stabilization Clip Insert | 5 184740-04K | ZIP 4/Bag | |

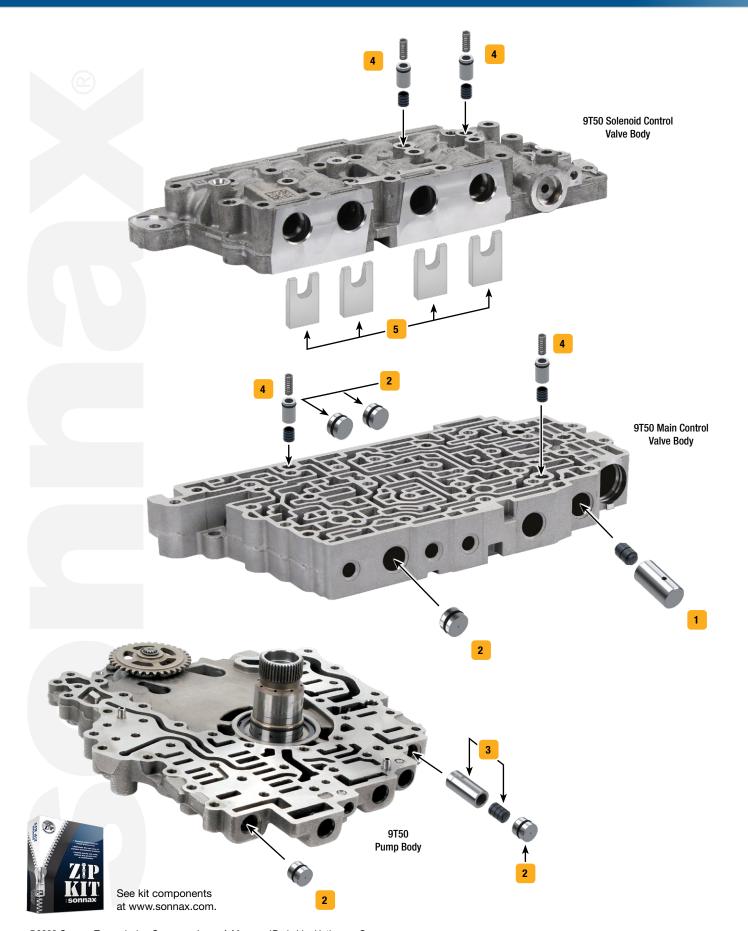

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.