


Jatco/Nissan JF011E (RE0F10A)

These parts also fit Mitsubishi F1CJA.

sonnax®

Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

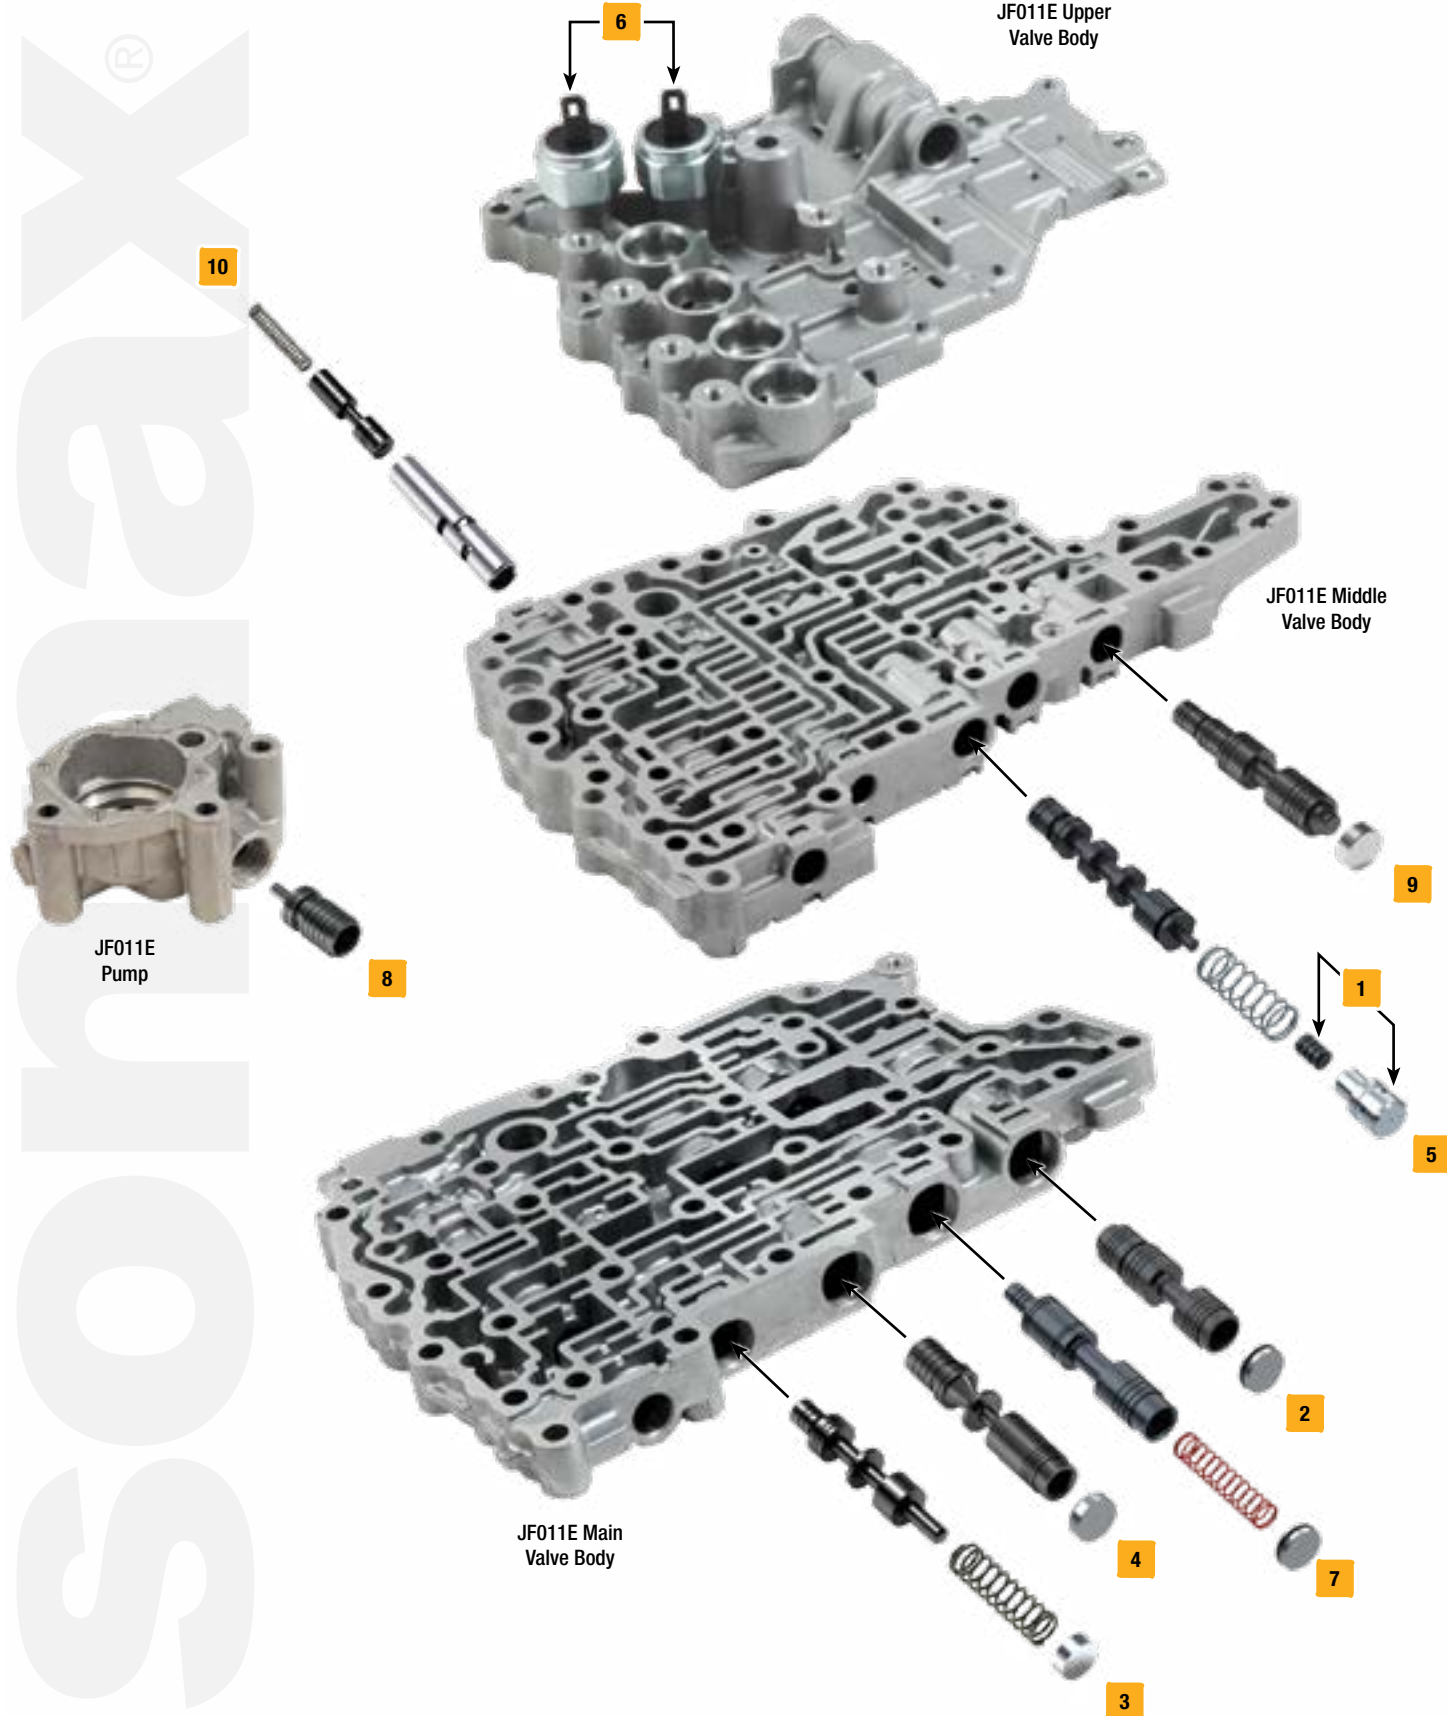

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms					
Jerking on coastdown, High engine RPM, Engine stall on engagement, No lockup	Lockup Control Plunger Valve Kit	1 113741-11K	ZIP		
Push belt slippage & pulley fracture, Chatter on acceleration, RPM surge on acceleration	Oversized Secondary Pressure Regulator Valve Kit	2 113741-21K			F-113741-TL21*
Engine stall on engagement, No lockup, Increased RPM during acceleration, Ratio codes	Oversized TCC Limit & Lube Valve Kit	3 113741-04K			F-113741-TL4*
Converter shudder & TCC slip, TCC apply & release concerns, TCC codes, Overheating	Oversized Torque Converter Pressure Regulator Valve Kit	4 113741-13K			F-113741-TL13*
Shift/Engagement Concerns					
Jerking on coastdown, Harsh engagement, High engine RPM, No lockup	Oversized Lockup Control Valve Kit	5 113741-22K			F-113741-TL22*
Shift concerns	Primary & Secondary Pressure Sensor	6 33417N	Fits either of 2 locations		
Chatter on acceleration, Damaged valve body casting, Slips in Forward & Reverse	Oversized Primary Pressure Regulator Valve Kit	7 113741-09K			F-113741-TL9*
Push belt slippage, Delayed engagement, Low pump volume	Pump Flow Control Valve	8 33510N-02	ZIP '07-Later		
	Oversized Pump Flow Control Valve	8 33510N-01	'07-Later		F-33510N-TL*
RPM surge or chatter on acceleration, Push belt slippage & pulley fracture	Oversized Secondary Pulley Control Valve Kit	9 113741-19K			F-113741-TL17*
Chatter on acceleration, No ratio change, Noise on acceleration, Push belt slippage	Solenoid Regulator Valve Kit	10 113741-01K	ZIP		

* VB-FIX Required